



Technical Service Bulletin

Technical Service Bulletin: TSB104264

Released Date: 21-Dec-2010

New Cylinder Head Gaskets

New Cylinder Head Gaskets

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

A new cylinder head gasket, Part No. 3076189 has been released for all NT and N14 engines. This new cylinder head gasket is a fully molded gasket and supersedes cylinder head gasket, Part No. 3074982.

The difference between the old and the new cylinder head gasket is that the new gasket does **not** have grommets or the molded cluster. All sealing on the new cylinder head gasket is done with edge molded rubber.

A new 0.25 mm [0.010–inch] thicker cylinder head gasket, Part No. 3082563 is also being released to supersede cylinder head gasket, Part No. 3080180. The new 0.25 mm [0.010–inch] thick cylinder head gasket is also a fully molded gasket.

The use of this new cylinder head gasket requires clean head and block surfaces. These surfaces can be cleaned with any safety solvent. The use of soluble oil in (water pump lubricant) the cooling system will damage the rubber seal in the new gasket. Do **not** use soluble oil in the cooling system when the new gasket is being used.

Full production of the fully molded cylinder head gasket started in January 1995, with ESN first 11754745, at Columbus Engine Plant. Full production of this cylinder head gasket at Shotts began in March 1995, with ESN first 23235840. Mexico is expected to make this change mid fourth quarter 1995. Recon® is expected to change the new cylinder head gasket in July 1995.

Refer to the Parts Status Table for a listing of all the part numbers that have been superseded to include the new fully molded cylinder head gasket and other kits that have been updated to include the new gasket. Other gasket kits will be updated later this year to include the new gasket. This Service Parts Topic will be revised later this year.

Parts Status Table			
New Part No.	Part Name	Old Part No.	Old Stock Disposition
3804274	Set, Single Head Gasket	3801324	Use
380275	Set, Single Head Gasket	3801328	Use
380275	Set, Single Head Gasket	3801329	Use
3804276	Set, Upper Engine Gasket	3801330	Use
3804282	Set, Upper Engine Gasket	3801332	Use
3804281	Set, Upper Engine Gasket	3801334	Use
3804276	Set, Upper Engine Gasket	3801348	Use
3803983	Set, Upper Engine Gasket	3801451	Use
3804279	Set, Single Head Gasket	3801453	Use
3804283	Set, Single Head Gasket	3801753	Use
3803982	Set, Upper Engine Gasket	3801754	Use
3803981	Set, Upper Head Gasket	3803040	Use
3804284	Set, Single Head Gasket	3803150	Use
3804286	Set, Upper Engine Gasket	3803713	Use
3804291	Set, Single Head Gasket	3803715	Use
3804287	Set, Upper Engine Gasket	3803716	Use
3804288	Set, Single Head Gasket	3803885	Use
3803562	Bearing / Gasket Kit		
3803737	Bearing / Gasket Kit		

Note : Old cylinder head gaskets, Part Nos. 3801328 and 3801329 are both being superseded to cylinder head gasket, Part No. 3804275. Cylinder head gasket, Part No. 3801328 has standard size water grommets and cylinder head gasket, Part No. 3801329 has 0.25 mm [0.010-inch] oversize grommets. Oversize grommets are not needed with the new fully molded cylinder head gasket.

⚠ CAUTION ⚠

Care must be taken when opening the box so that the gaskets are not cut. Lay the box flat with the label facing up. Cut only the tape along the dotted line as shown in Figure 3.



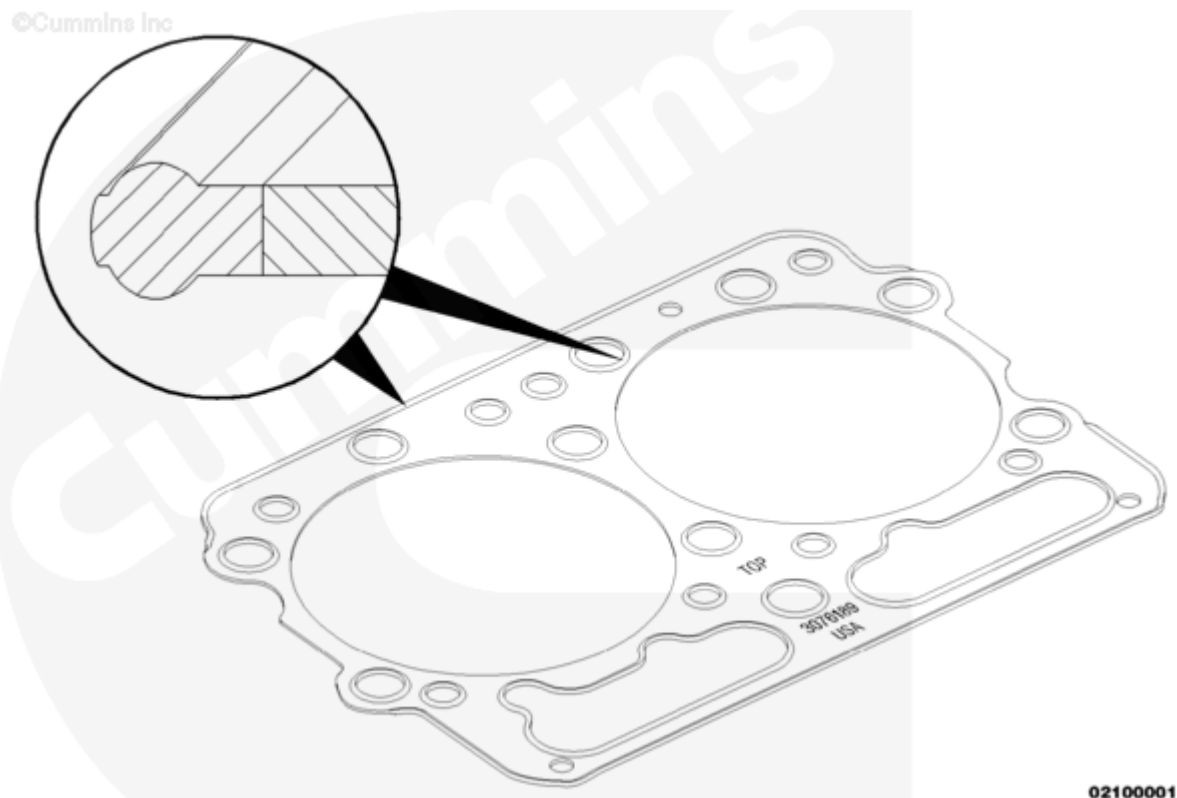


Figure 1, New cylinder head gasket.

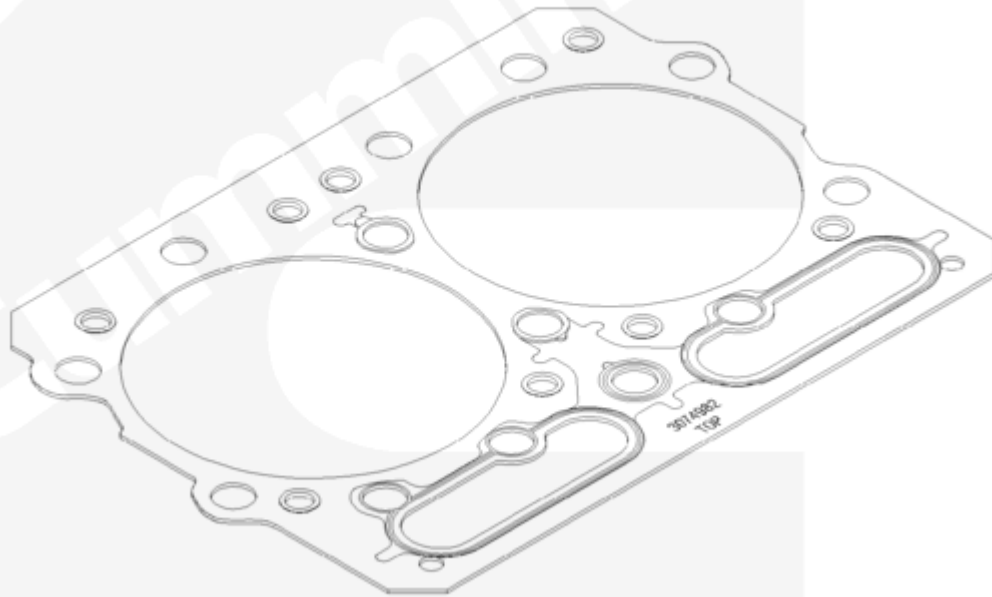

02100002

Figure 2, Old cylinder head gasket.

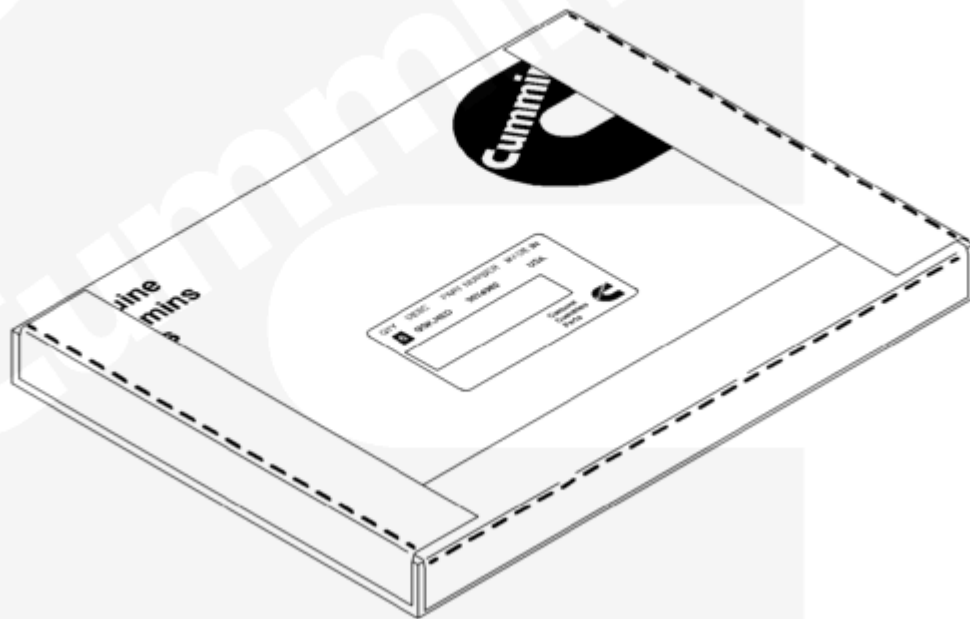

02100003

Figure 3, Opening box diagram.

Refer to Figures 1 and 2 for a comparison of the old and new cylinder head gaskets.

Refer to Figure 3 for instruction diagram on opening the quantity packed box of the new fully molded cylinder head gaskets, Part No. 3076189. It is important to follow these instructions to prevent cutting the gaskets when opening the box.

Document History

Date	Details
2010-12-17	Module Created

Last Modified: 21-Dec-2010
