



Technical Service Bulletin

Technical Service Bulletin: TSB110104

Released Date: 11-Apr-2011

Cylinder Block Service Kits

Cylinder Block Service Kits

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document was originally released between 1994 and 2001. It has been added to QSOL for informational purposes

This document identifies the correct service cylinder bloc kits required to replace a C series cylinder block. The cylinder block used in **pre-1991** engines, **part number 3802265**, has been obsoleted and replaced by a cylinder block with thick walled cylinder liner bores, **part number 3802549**. Use the **part number 3802559** cylinder block as a replacement for engines produced during **1991** and after.

Pre-1991 Engines

Pre-1991 engines were built with single piston cooling nozzles per cylinder and a lower capacity lubrication system. The cylinder block now in production has dual piston cooling nozzles per cylinder and a higher capacity lubrication system. This difference requires the use of the cylinder liner kit and service cylinder block kit listed below when replacing the cylinder block on engines built prior to **engine serial number (ESN) 44487830 (CDC), ESN 21083000 (DEP), and ESN 30417102 (BZL)**.

Description	Part Number	Number Required
Cylinder Liner Kit	3802407	6
Cylinder Block Kit	3802549	1

3802549 includes:

Description	Part Number	Quantity
Main/thrust Bearing	3802210	1
Cylinder Block and Hardware	3802559	1
Cylinder Head Capscrew	3917728	14

Description	Part Number	Quantity
Cylinder Head Capscrew	3917729	12
Lube Oil Pressure Regulator	3918532	1
Lubricating Oil Pump	3926201	1

1991 Engines with Thin-Wall Cylinder Block

Engines with the following ESN's were built with dual piston cooling nozzles per cylinder, high capacity lubrication system and thin-wall cylinder block.

ESN 44487830 to 44706125 (CDC)

ESN 21083000 to 21123435 (DEP)

ESN 30417102 to 30417119 (BZL)

Use the following cylinder liner kit and cylinder block kit when replacing the cylinder block.

Description	Part Number	Number Required
Cylinder Liner Kit	3802407	6
Cylinder Block Kit	3802559	1

3802559 includes:

Description	Part Number	Quantity
Hardware Kit	3802367	1
Cylinder Block	3926145	1

1991 Engines With Thick-Wall Cylinder Block

Use the following cylinder block kit when replacing the cylinder block. The cylinder liners **can** be reused **if** they meet the reuse guidelines.

Description	Part Number	Number Required
Cylinder Block Kit	3802559	1


3802559 includes:

Description	Part Number	Quantity
Hardware Kit	3802367	1
Cylinder Block	3926145	1


Note : A new cylinder head gasket, part number 3928168, is also required for use with any of the above listed kits. The following list identifies the correct piston kit to order based on engine application.

Piston/Cylinder Kits For Use With Thick-Wall Cylinder Block, Part Number 3802549 and 3802559

Engine Model	Application	Piston Part No.	Piston Kit Part No.	Cylinder Kit Part No.	Liner Kit Part No.
6C	All	3919567	3352808	3355288	3802407
6CT	All	3919564	3352809	3355286	3802407
6CTA	U.S. (Engine Coolant Aftercooled)	3919565	3352810	3355287	3802407
6CTA	Marine	3919566	3802280	3802405	3802407
6CTA	U.S. (1991 Charge Air Cooled)	3917707	3802263	3802406	3802407
6CTA	Europe (Pre-1991 Charge Air Cooled)	3919567	3352808	3355288	3802407
6CTA	Europe (1991 Charge Air Cooled)	3919247	---	---	---

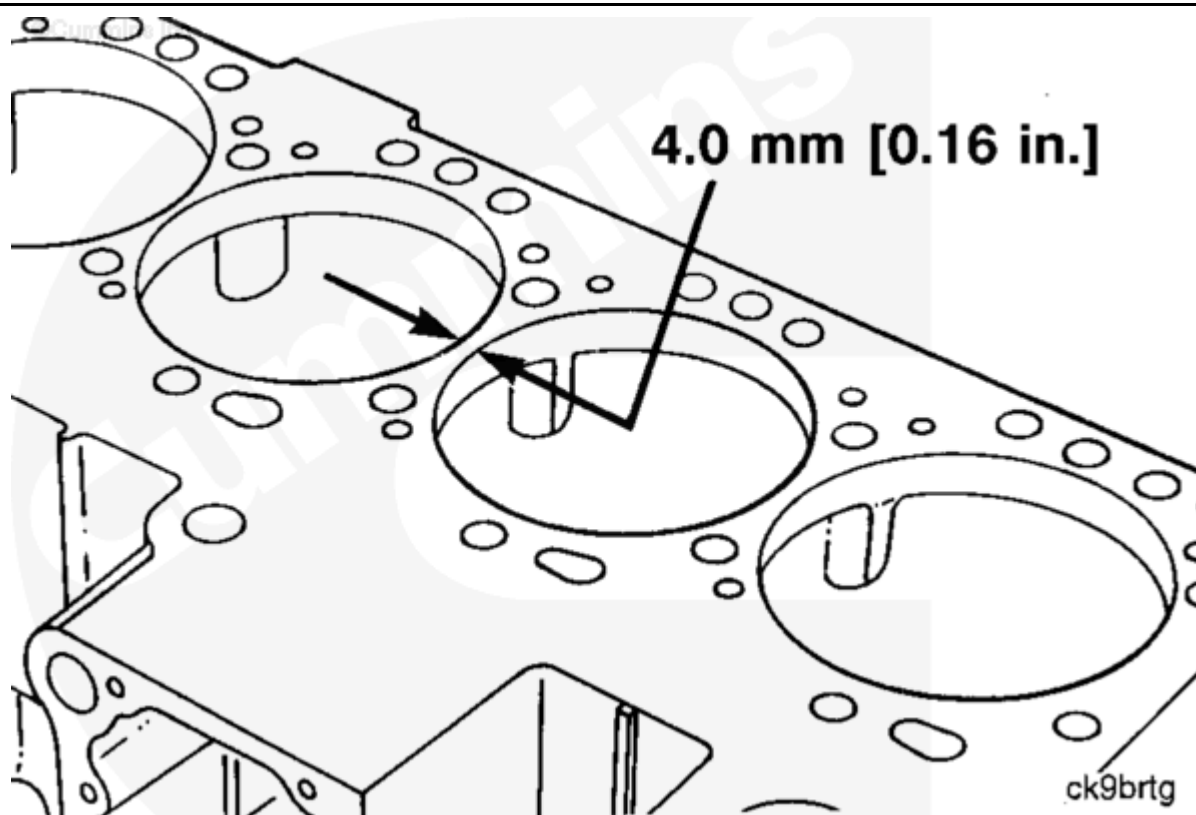

Thin-Wall Cylinder Block

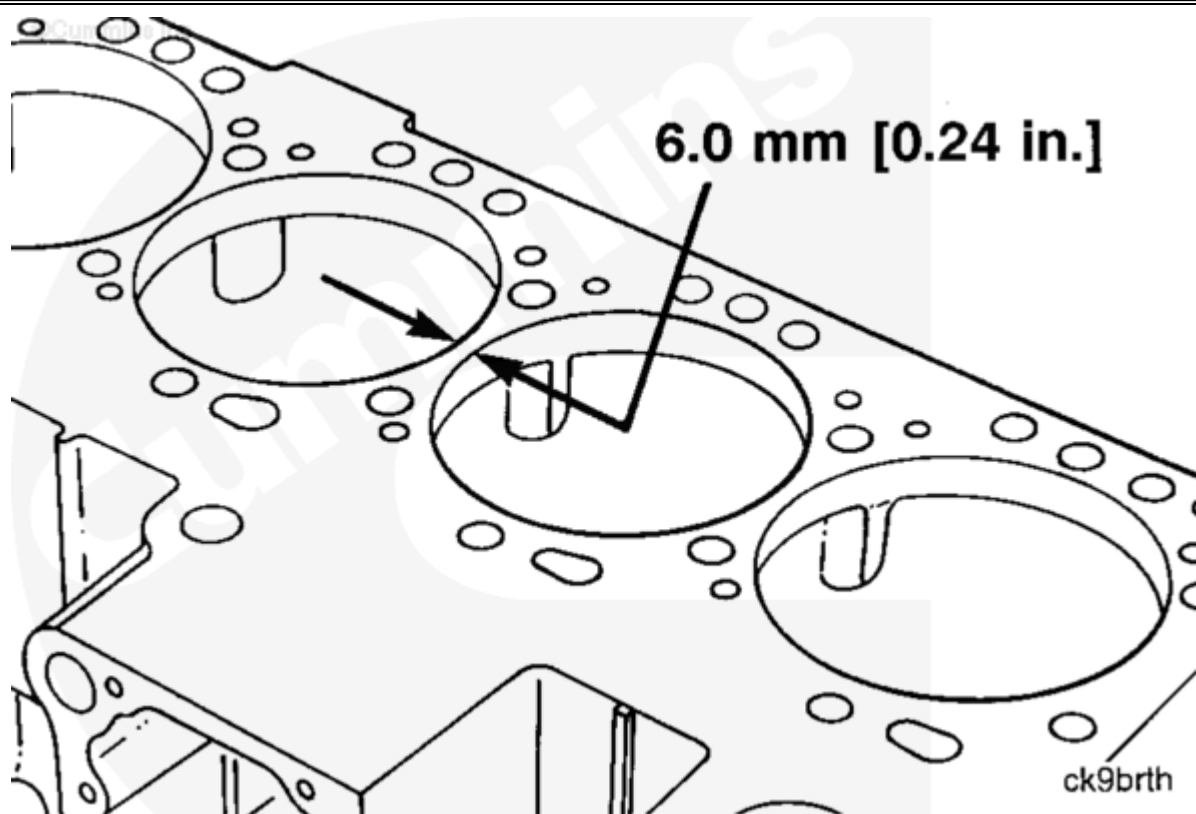

Thick-Wall Cylinder Block

Document History

Date	Details
2011-4-8	Module Created

Last Modified: 11-Apr-2011
