



Technical Service Bulletin

Technical Service Bulletin: TSB110121

Released Date: 21-Apr-2011

Common Cylinder Liners for C and ISC Series Engines

Common Cylinder Liners for C and ISC Series Engines

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document was originally released between 1994 and 2001. It has been added to QSOL for informational purposes

The purpose of this document is to introduce common cylinder liners for C and ISC Series engines.

In the beginning of 1998, both C and ISC engines began using a common cylinder liners, Part No. 3944344, in production. This cylinder is now the **only** liner in production. However, the old liner, Part No. 3919937, will be retained as a service part for C Series engines built prior to the engine serial numbers listed below.

	Engine Serial Number First	Date
CDC	4563466	5 January 1998
DEP	21301477	20 February 1998

The ISC liner, Part No. 3944344, is 3-mm shorter than the C liner, Part No. 3919937. For this reason the old C block, Part No. 3928964, is designated for the shorter liner. To accept the shorter liner, block machining has been modified to stop 3-mm shorter than the old block (refer to Fig. 1 and 3). **When replacing C Series blocks, the liner must also be replaced.** Old liners in a new block will sit above the head deck by about 3 mm, which is unacceptable (refer to the Fig. 3). The ISC block, Part No. 3945063, will remain the same. Refer to the table below.

Note : Replace cylinder liner with like cylinder liner. Only use new cylinder liner on C series blocks that are new.

	Old C Block	New C Block	ISC Block
Cylinder Block	Obsolete, Part No. 3928964	Production/Service Part No. 3934906	Production/Service Part No. 3945063


	Old C Block	New C Block	ISC Block
Cylinder Liner	Service Only Part No. 3919937	Production/Service Part No. 3944344	Production/Service Part No. 3944344

The following blocks have been superseded:		
Old (Obsolete)	Style	New (Supersedes Old)
3355051	Short block	3934578
3355054	Short block	3934579
3355446	Repair kit	3934904
3355448	Repair kit	3934905
3355449	Repair kit	3934907
3802559	Repair kit	3934906
3926151	Short block	3934596
3926152	Short block	3934597
3929331	Short block	3934598
3927332	Short block	3934599

Note : All of the above blocks take the new liner, Part No. 3944344.


When replacing liners within the old C block (**not** replacing the block, liner kit, Part No. 3802407, is still available with the old liner.

Note : This is a product improvement and is not subject to campaign.

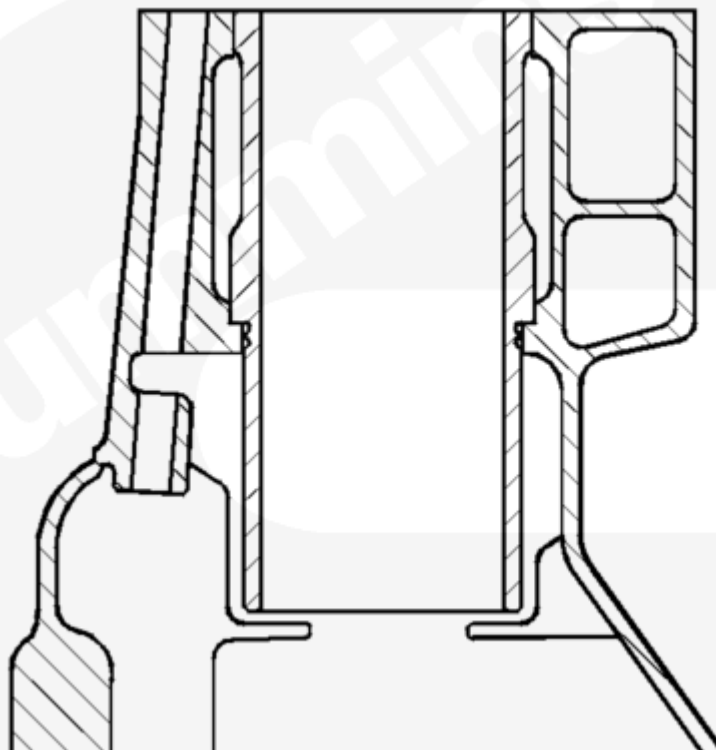


01900178

Fig. 1, Old Liner/Old Block

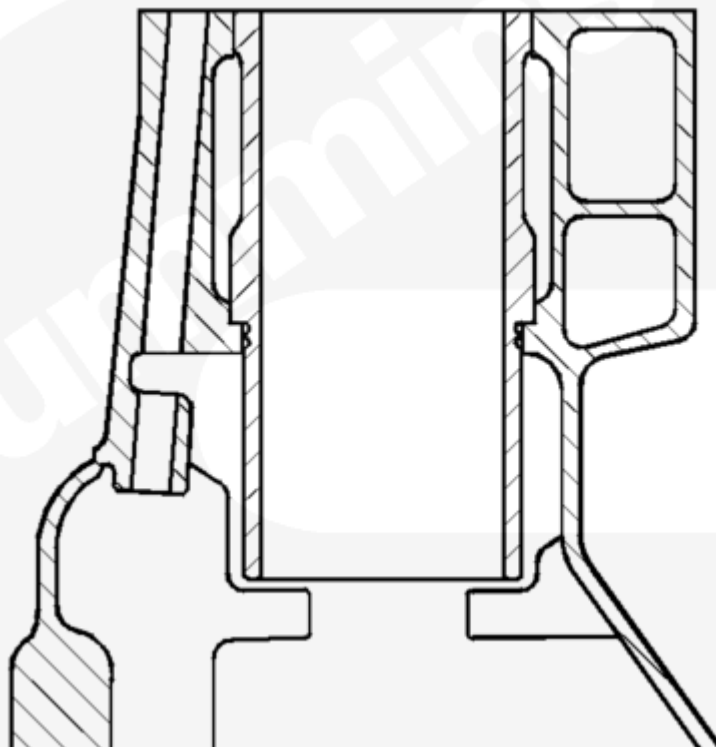

01900179

Fig. 2, New Liner/New Block

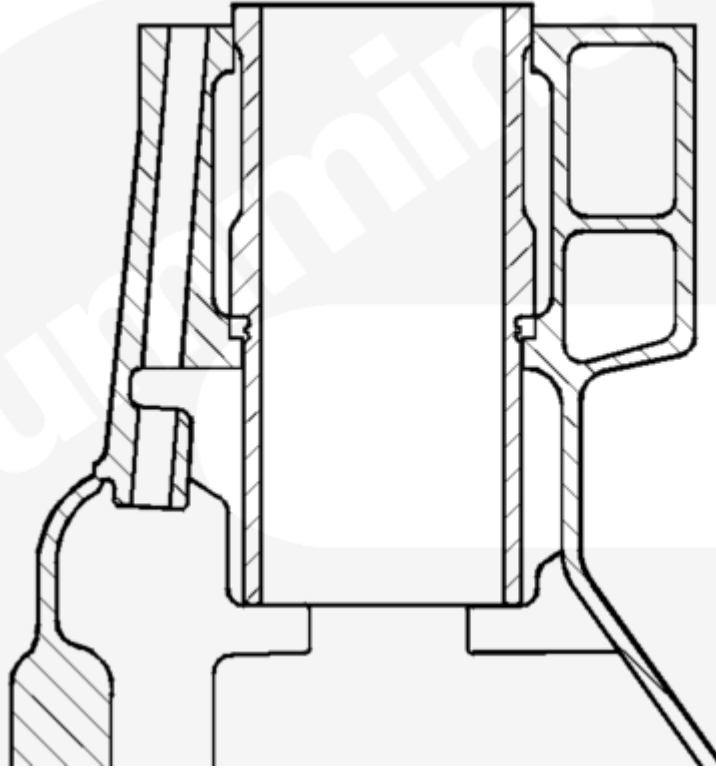

01900177

Fig. 3, Old Liner/New Block

Document History

Date	Details
2011-4-20	Module Created

Last Modified: 21-Apr-2011
