



Technical Service Bulletin

Technical Service Bulletin: TSB110150

Released Date: 19-May-2011

Hydraulic Pump Drives and Adapters

Hydraulic Pump Drives and Adapters

Warranty Statement



The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document was originally released between 1994 and 2001. It has been added to QSOL for informational purposes

This document introduces a new hydraulic pump adapter for hydraulic pump drive options in applications where an air compressor is **not** used. The new adapter was introduced on January 20, 1993 at CDC. Engine Serial Number first 44828852. The new adapter includes a drilling that transfers lubricating oil from the gear housing to the hydraulic pump drive connection to the hydraulic pump spline shaft to reduce wear on the spline drive teeth. Failure of lubricating oil reaching this connection could result in spline shaft or spline drive failure.

Install by orientating the adapter so that the oil collection hole is on the top side of the accessory gear. The word "TOP" is printed on the face of the adapter and should be positioned so that it is on the top end of the adapter when installing. Failure to install properly will **not** allow lubricating oil to reach the spline shaft connection. See page 2 for a list of new part numbers which have the lubricating oil collection hole improvement.

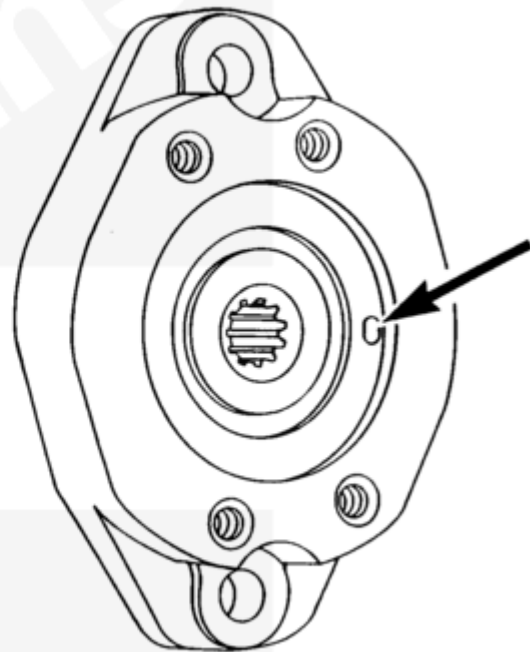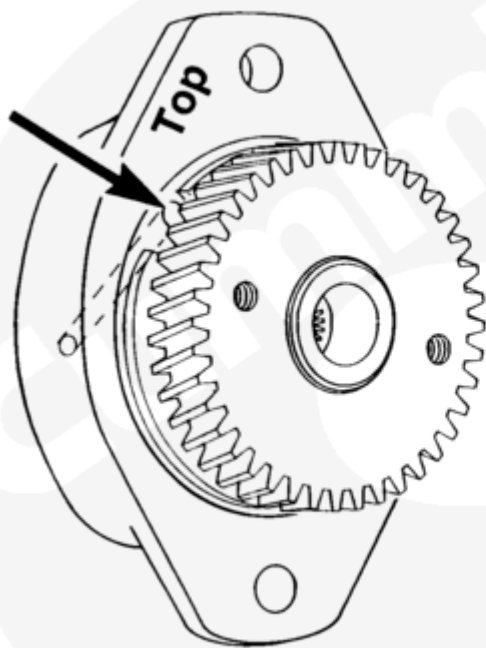

he900ga

Hydraulic Pump Front and Rear View

Spline Size	Old Part No.	New Part No.	Description
13 Tooth	3910653	3923319	Hydraulic Pump Drive
	3916280	3923237	Adapter
	3912204	3923242	Drive Shaft
	3910652	3924552	Hydraulic Pump Drive
	3916147	3924881	Adapter
	3912204	3923242	Drive Shaft
	3354527	*3924883	Hydraulic Pump Drive
	3916147	3924881	Adapter
	3354526	3354526	Drive Shaft
11 Tooth	3910654	3923320	Hydraulic Pump Drive
	3916146	3923239	Adapter
	3912205	3923243	Drive Shaft
9 Tooth	3910655	3923321	Hydraulic Pump Drive
	3916146	3923239	Adapter
	3912206	3923244	Drive Shaft

***Not** available as an assembly for service parts. Must order adapter and drive shaft separately.

Document History

Date	Details
2011-5-12	Module Created

Last Modified: 19-May-2011
