



Technical Service Bulletin

Technical Service Bulletin: TSB120287

Released Date: 21-Dec-2012

K/QSK19 Edge Molded Rubber Oil Pan Adapter Gasket

K/QSK19 Edge Molded Rubber Oil Pan Adapter Gasket

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents


This document announces the release of a new style oil pan adapter gasket. The new edge molded rubber gasket is being released to address oil leaks at the oil pan adapter joint. This new oil pan adapter gasket utilizes a metal carrier and edge molded rubber to prevent capscrew preload loss at the oil pan adapter joint.

New Part Number	Old Part Number
2888747	4000595

All QSK19 engines built in the Seymour Engine Plant as of 11/15/2012 build date will use oil pan adapter gasket, Part Number 2888747. ESN first for this change is 37256362. At this time, the K series engines will continue to be built using oil pan adapter gasket, Part Number 4000595.


Oil pan adapter gasket, Part Number 4000595, will **no** longer be used in service. All kits containing oil pan adapter gasket, Part Number 4000595, will now contain the new oil pan adapter gasket, Part Number 2888747. The effective date for this change at the Part Distribution Centers is 12/15/2012. It is important to note that oil pan adapter gasket, Part Number 2888747, can be installed on K series engines also.

Installation of this new gasket is critical to the gasket's ability to seal properly. The proper installation procedure must be followed in order to maintain a leak free joint. The installation procedure can be found in the service manual for the engine being serviced, in Procedure 007-027 (Lubricating Oil Pan Adapter).

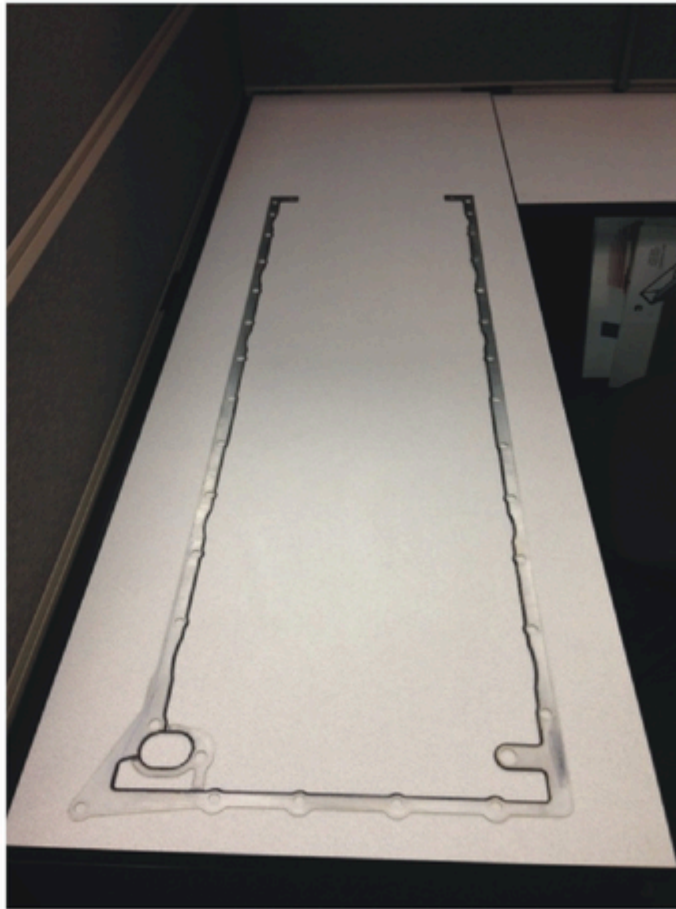

01f00011

New Oil Pan Adapter Gasket, Part Number 2888747

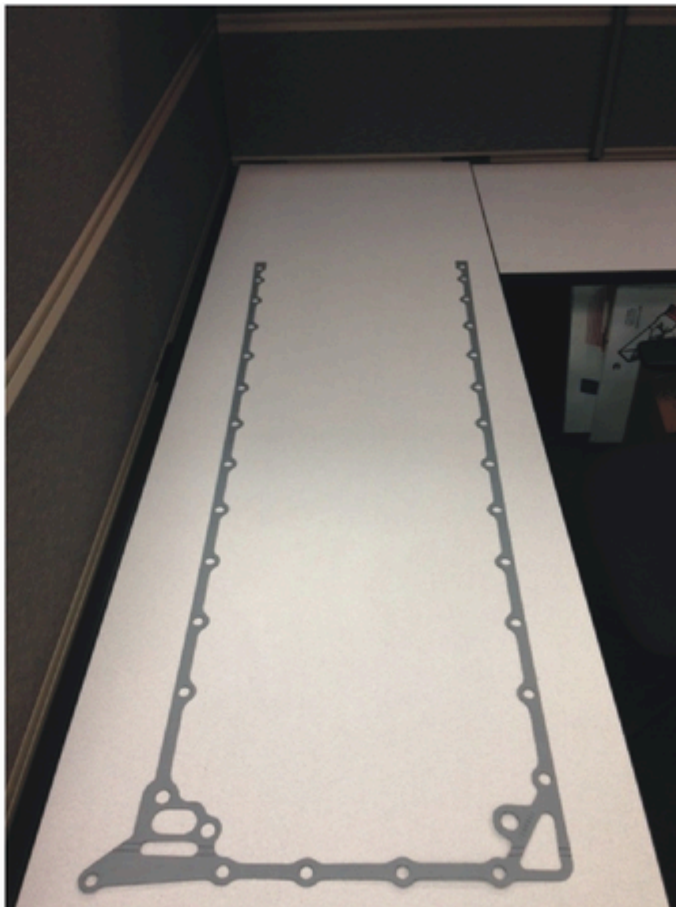

01f00012

Old Oil Pan Adapter Gasket, Part Number 4000595

Document History

Date	Details
2012-11-13	Module Created

Last Modified: 21-Dec-2012
