



Technical Service Bulletin

Technical Service Bulletin: tsb100283

Released Date: 09-Jul-2004

New Exhaust Manifold Sections

New Exhaust Manifold Sections

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces new turbocharger section exhaust manifolds and an end section exhaust manifold on the QSK60 series engines. The manifolds have been revised to improve the durability of the system components. The two turbocharger sections have been revised to include localized wall thickening, and the end section has strengthening ribs added. New exhaust manifold mounting capscrew lock plates have also be introduced which need to be fitted to the new manifold sections when they are installed.

QSK60 Single stage engines.

QSK60 single stage engines require the turbocharger exhaust manifold sections Part Numbers 4101347 and 4101349 along with end section exhaust manifold Part Number 4101345 to be changed to complete the update.

Table 1. New Parts Required for QSK60 Single Stage Engines

New Part Number	Manifold Identification	Old Part Number	Quantity Required
4101345	End Section	4000738	2
4101347	Turbo Section	4000742	2
4101349	Turbo Section	4000739	2
3171421	Lockplate		4 per manifold

QSK60 two stage engines built after and including engine serial number (ESN) 33151884.

QSK60 two stage engines built after ESN 33151884 contain a rear header plate Part Number 4100953, for which the outlet ports on the plate are machined at an angle relative to the water header mounting surface on the cylinder block. When the new end section exhaust manifold is installed with this rear header plate a new intercooler water transfer tube Part Number 3635939 **must** be used to prevent a foul condition with the manifold.

If the engine is fitted with the rear header plate that does **not** have the angled outlet ports, and the new exhaust manifolds are fitted, then the water transfer tube need **not** be changed.

Table 2. New Parts Required for QSK60 Two Stage Engines

New Part Number	Manifold Identification	Old Part Number	Quantity Required
4101345	End Section	4000738	2
4101347	Turbo Section	4000742	2
4101349	Turbo Section	4000739	2
3635939	Tube, Water Transfer	4100448	1
3171421	Lockplate		4 per manifold

Note : The old part numbers, listed in Tables 1 and 2 remain available for service.

Note : This is a product improvement and is **not** subject to campaign.

©Cummins Inc

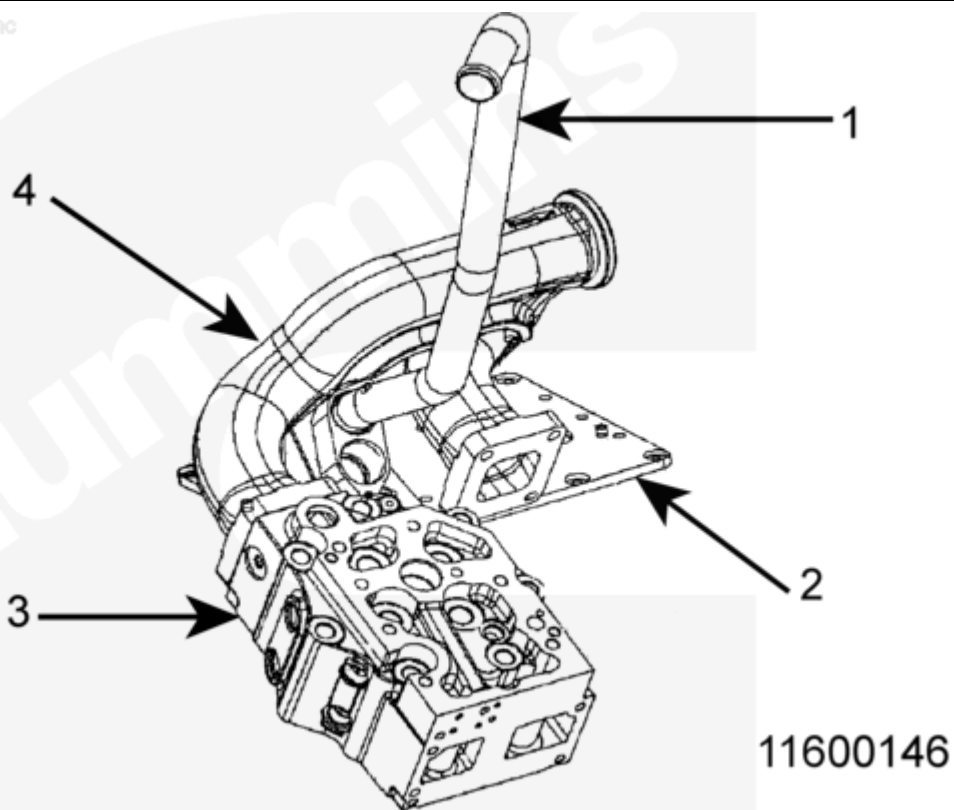


Figure 1

Table 3. Parts Identification (See Figure 1)

Item Number	Identification
1	Water transfer tube, Part Number 4100448
2	Rear water header plate - angled outlet
3	Number 8 right bank cylinder head
4	End section manifold, Part Number 4101345

Last Modified: 09-Jul-2004
