



Technical Service Bulletin: tsb100295

Released Date: 18-Aug-2004

Aftercooler Vent Hose Removal and Aftercooler Cover Change

Aftercooler Vent Hose Removal and Aftercooler Cover Change

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.


Contents

This Technical Service Bulletin is to inform the field of a product change for all QSK45 and all QSK60 engines aftercooler water air vent systems, and an aftercooler cover change.

Air Vent Hose Removal

A product change has been introduced to remove the water air vent line system from the QSK product range. This will mean there are now three variations of air vent line installation.

- Old Type 1 - This consists of the original set up with vent lines installed
- Old Type 2 - Vent lines removed and aftercooler core vent outlets plugged (Introduced July 2002).
- New Type - Vent outlet removed from aftercooler cores and new aftercooler covers introduced. Engine serial number first for the QSK60 was 33156143, built - 17th of March 2004, and for the QSK45 was 33156082, built 8th of March 2004.

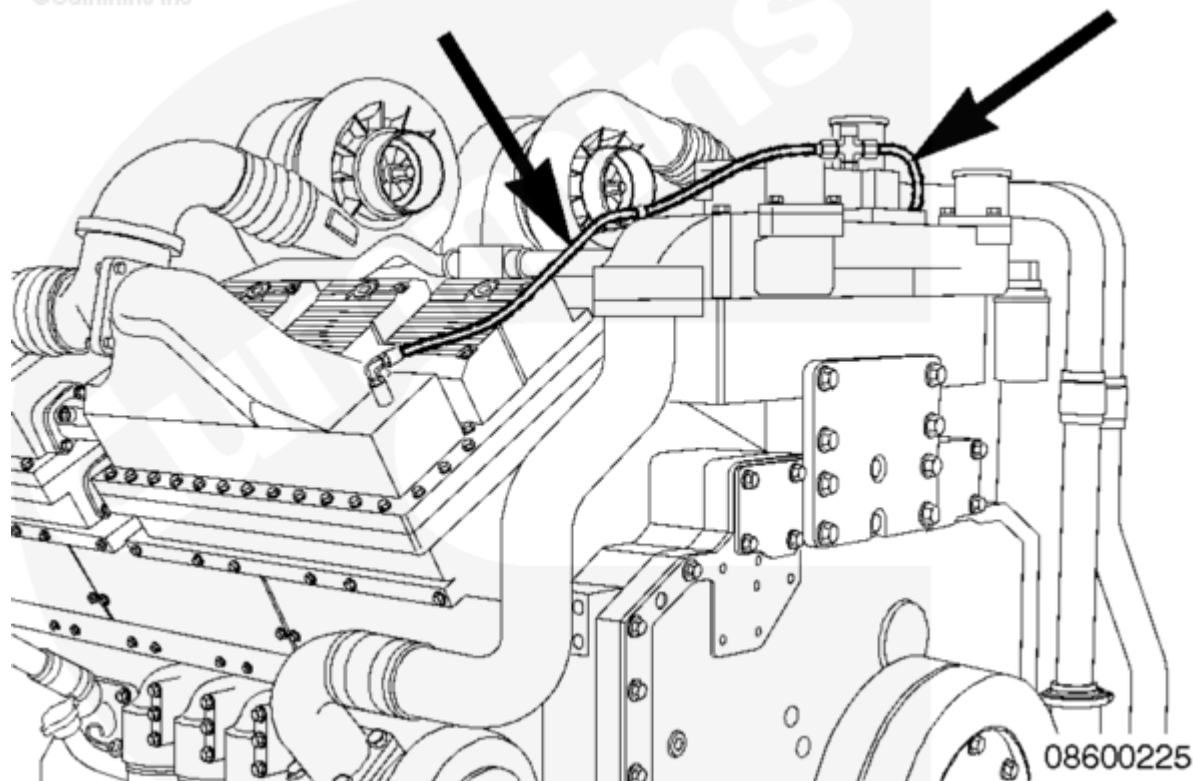

Old Type 1 Installation with Aftercooler Vent Line Locations

Aftercooler Core Part Number Changes

Listed below are the part numbers of the aftercooler cores for Old Type 1, Old Type 2, and New Type

Note : This is a product improvement, not subject to campaign.

Aftercooler Core Part Number Changes

INSTALLATION TYPE	ENGINE MODEL	AFTERCOOLER CORE PART NUMBER
Old Type 1 and Old Type 2 - Aftercooler core with vent line outlet	QSK60 all models	4100636
Old Type 1 and Old Type 2 - Aftercooler core with vent line outlet	QSK45 all models	4001325
New Type - Aftercooler core with vent line removed	QSK60 all models	4101030
New Type - Aftercooler core with vent line removed	QSK45 all models	4101032

Note : If a NEW type aftercooler core is fitted to an OLD Type 1 or OLD Type 2 engine, the aftercooler cover will also have to be changed. If the covers are to be replaced, depending on aftercooler location on the engine, the correct orientated cover will have

to be installed. If a NEW type cover is to be fitted to a OLD Type 1 or OLD Type 2 engine a NEW type core will have to be fitted.

Aftercooler Cover/Parts Availability

Parts Availability	
PARTS	AVAILABILITY
Old Type 1 and Old Type 2 Aftercooler Core	Service
Old Type 1 and Old Type 2 Aftercooler Cover	Service
New Type Aftercooler Core	Production and Service
New Type Aftercooler Cover	Production and Service

Aftercooler Cover Part Number and Fitting Location

Cover Part Number and Location			
MODEL	OLD COVER PART NUMBER	NEW COVER PART NUMBER	FITTED LOCATION
QSK60 All models with Old Type 1 and Old Type 2 set up (with vent hole)	4080569	3636408	Left Bank Front/Right Bank Rear
QSK60 All models with Old Type 1 and Old Type 2 set up (with vent hole)	4080570	3636411	Left Bank Rear/Right Bank Front
QSK60 All models with New Type setup (without vent hole)	4101031	3636409	Left Bank Front/Right Bank Rear
QSK60 All models with New Type setup (without vent hole)	4101040	3636412	Left Bank Rear/Right Bank Front
QSK45 All models with Old Type 1 and Old Type 2 set up (with vent hole)	4001208	N/A	Left Bank Rear/Right Bank Front
QSK45 All models with Old Type 1 and Old Type 2 set up (with vent hole)	4001209	N/A	Left Bank Front/Right Bank Rear
QSK45 All models with New Type setup (without vent hole)	4101033	N/A	Left Bank Rear/Right Bank Front

Cover Part Number and Location			
MODEL	OLD COVER PART NUMBER	NEW COVER PART NUMBER	FITTED LOCATION
QSK45 All models with New Type setup (without vent hole)	4101039	N/A	Left Bank Front/Right Bank Rear


⚠ CAUTION ⚠

If you are fitting a NEW type aftercooler core to an OLD type 1 or OLD type 2 engine, do NOT attempt to plug the vent outlet hole in the aftercooler cover. A NEW type aftercooler cover must be installed.

Aftercooler Cover Changes


This change was made to increase the durability of this component. Improvements have been made by adding a number of strengthening ribs in the critical internal and external areas.

©Cummins Inc

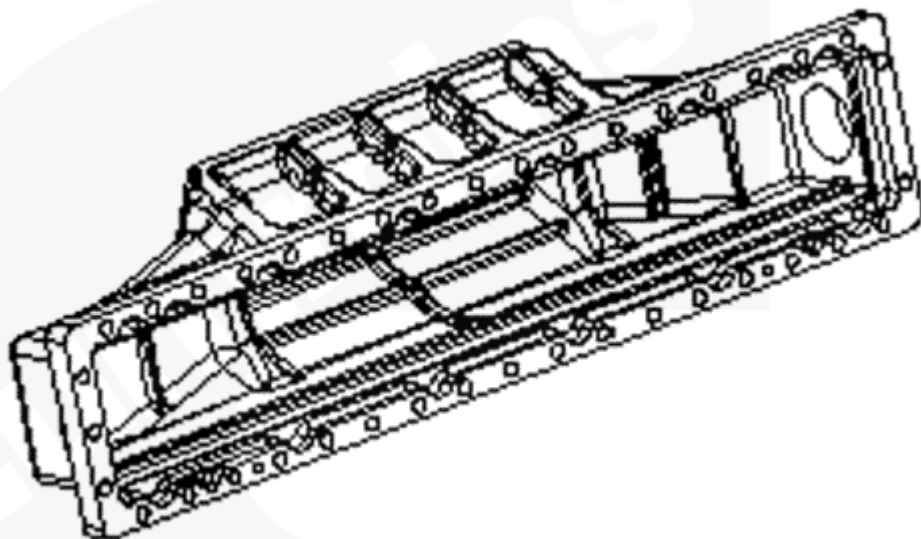


08600623

New Aftercooler Cover (internal view)

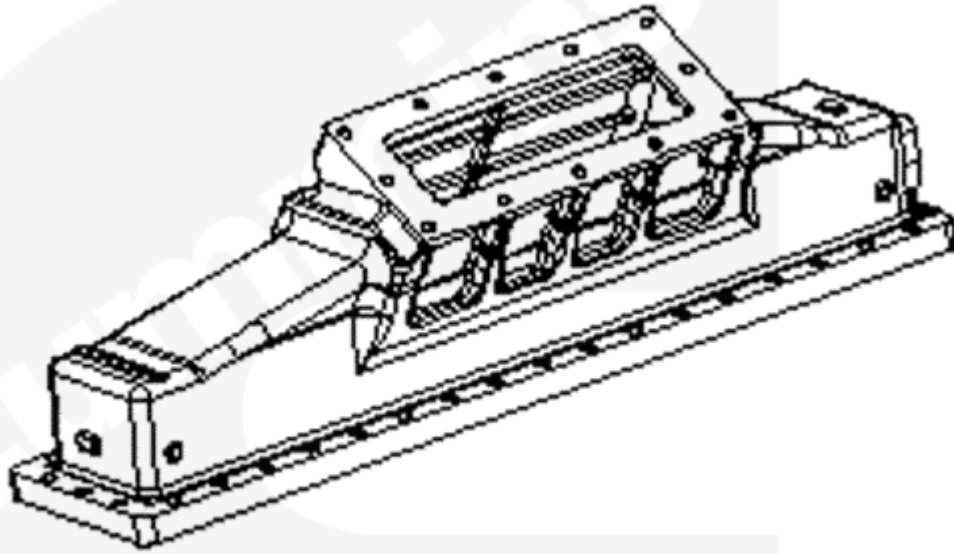


08600624

New Aftercooler Cover (external view)

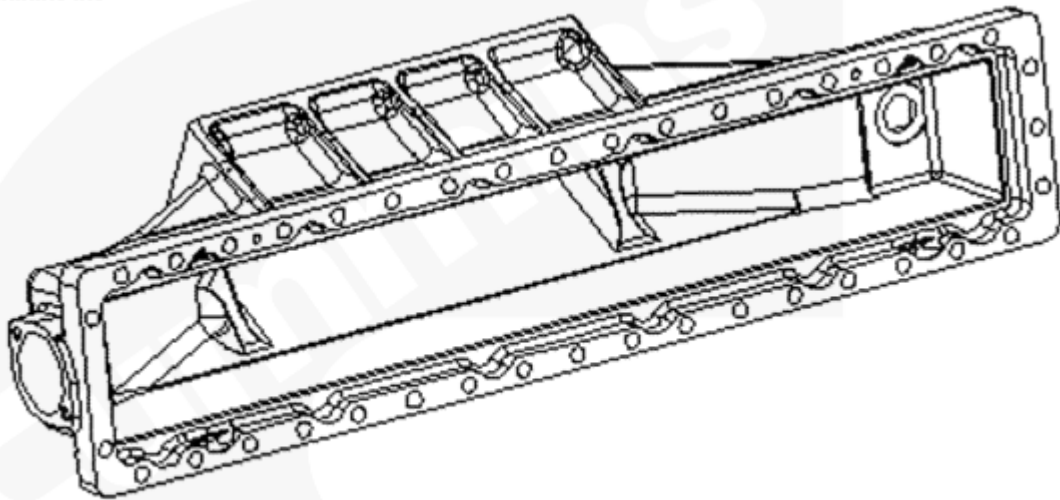

08600625

Old Aftercooler Cover (internal view)

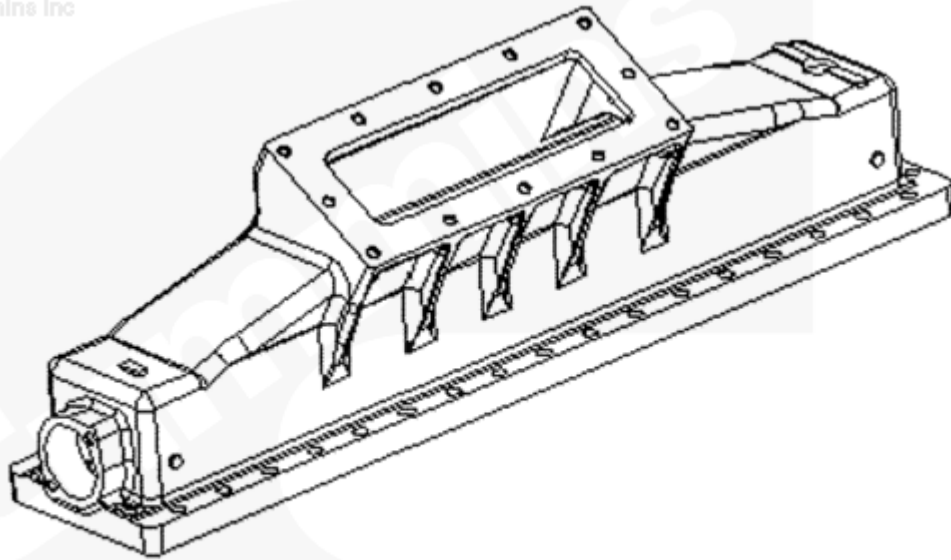

08600626

Old Aftercooler Cover (external view)