



Technical Service Bulletin

Technical Service Bulletin: tsb100297

Released Date: 08-Sep-2004

New Connecting Rods

New Connecting Rods

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents


This Service/Parts Announcement introduces new connecting rod assembly, Part Number 3635126.

The affected applications are all QSK45 and QSK60 engines made on or after February 2, 2004, with engine serial number first 33155764.

The new connecting rod assembly is more robust. It features more serrated surface, with the serrations' slope angle optimized. These modifications increase the strength of the connecting rod. The new assembly also features new spring-type dowels that replace the old solid-type ring dowels, to be sure of more evenly distributed bolt pre-load at the time of assembly.

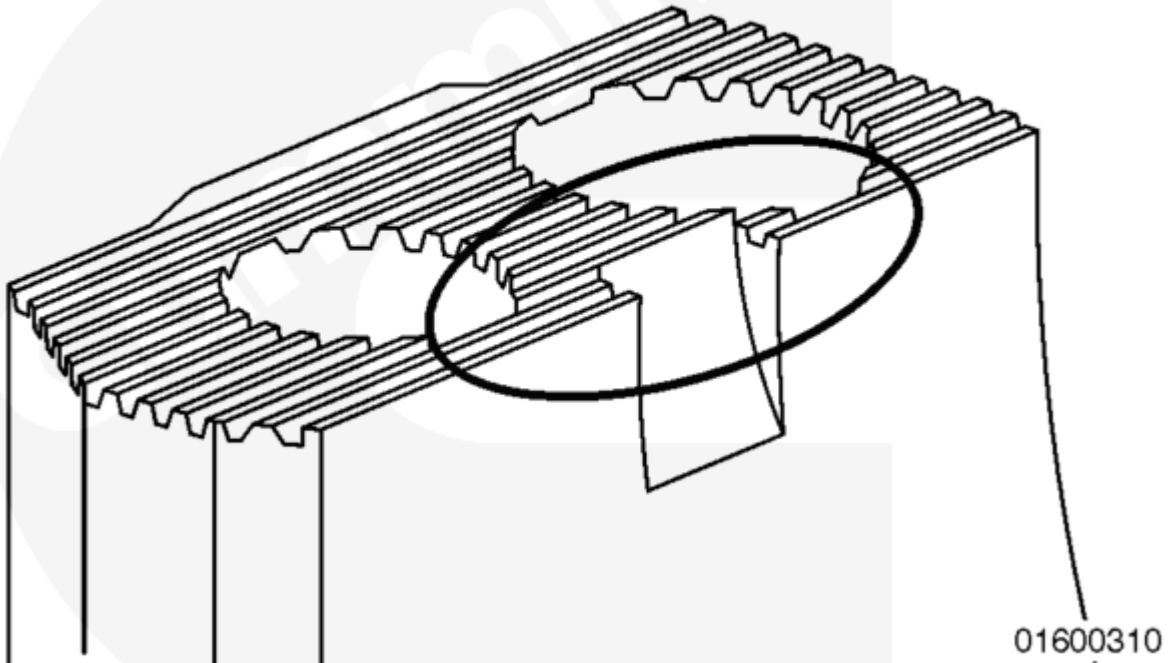

Improved Serration Surface

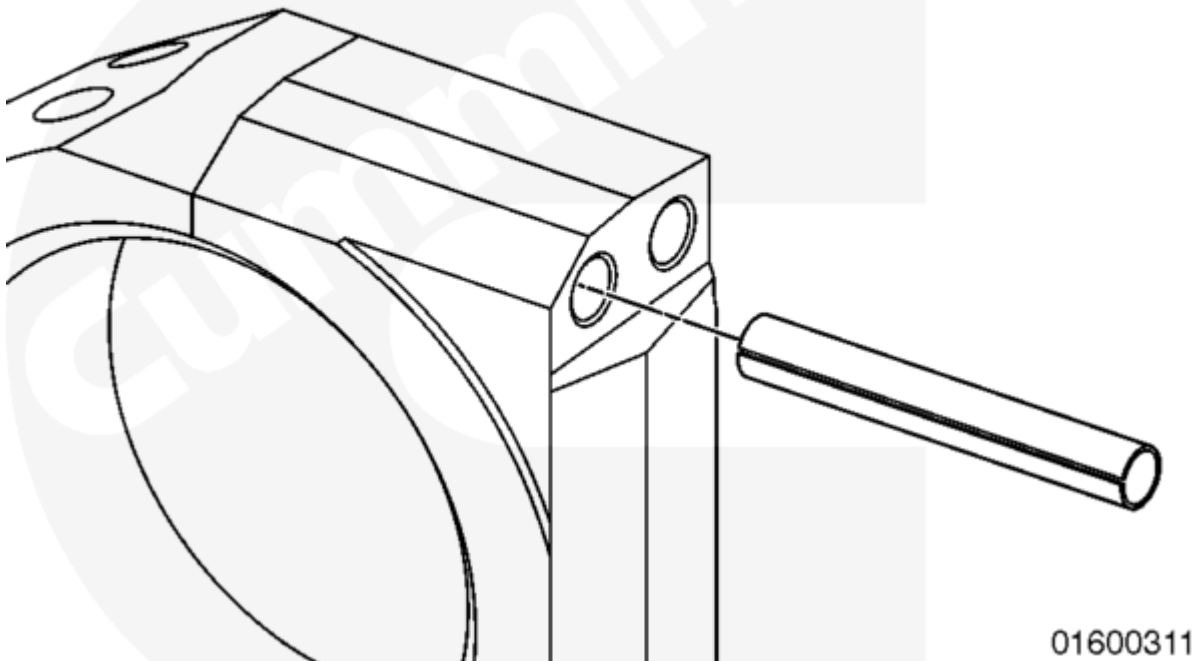

Spring Dowels (Exploded View)

The new connecting rod assembly, Part Number 3635126, supersedes assembly, Part Number 3171061. No stock of the old connecting rods is left in factory production, as of February 2, 2004. Please replace all entries of assembly Part Number 3171061 with assembly Part Number 3635126 on hard copies of the QSK45 and QSK60 Parts Catalogs.

Please note the following compatibilities between the new and old connecting rods, and the new and old connecting rod bearings:

Note : This is a product improvement and is not subject to campaign.

Table 1, Connecting Rod and Connecting Rod Bearing Compatibility

Part Number (type)	Old Connecting Rod Assembly, Part Number 3171061	New Connecting Rod Assembly, Part Number 3635126
3099872 (Old Rod Bearings)	Compatible	Not compatible
3099873 (Old Rod Bearings)		
3099874 (Old Rod Bearings)		
3099875 (Old Rod Bearings)		
3099876 (Old Rod Bearings)		
4100932 (New Rod Bearings)	Compatible	Compatible
4100935 (New Rod Bearings)		
4100936 (New Rod Bearings)		
4100937 (New Rod Bearings)		
4100938 (New Rod Bearings)		

The new connecting rod bears the old forging number as-cast, Part Number 3171061. Do **not** use the as-cast markings as a criterion to differentiate new and old units.