



Technical Service Bulletin

Technical Service Bulletin: tsb100300

Released Date: 23-Sep-2004

New Turbocharger Oil Supply Plumbing for Single-Stage Engine

New Turbocharger Oil Supply Plumbing for Single-Stage Engine

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Service/Parts Announcement introduces new oil supply plumbing for the turbochargers of the single-stage QSK60 engine.

The affected applications are all single-stage turbocharged QSK60 engines made on or after September 8, 2003, with engine serial number first 33154763. The plumbing option affected is TP 6726. The following table details the parts added and the parts obsoleted:

**Table 1,
Plumbing
Option TP 6726,
Part Number
Reference**

New Part Number	Description	Quantity	Old Part Number	Description
3635128	Flexible hose, tee to turbocharger	2	3089618	Flexible hose
3635129	Flexible hose, tee to turbocharger	2	3089619	Flexible hose
3635130	Flexible hose, flywheel housing to tee, Left Bank	1	3171844	Tube
3635131	Flexible hose, flywheel housing to tee, Right Bank	1	3171845	Tube

Table 1, Plumbing Option TP 6726, Part Number Reference				
New Part Number	Description	Quantity	Old Part Number	Description
3093957	Capscrew, hexagon flange head	1	3093957	Capscrew, hexagon flange head
3629452	Clip	9	3629452	Clip
3171784	Bracket, water tube	1	Not Applicable	

The turbocharger oil supply hoses have been rerouted as illustrated below, constituting a product improvement over the previous hybrid arrangement made of tubes and hoses.

Note : This is a product improvement and is not subject to campaign.

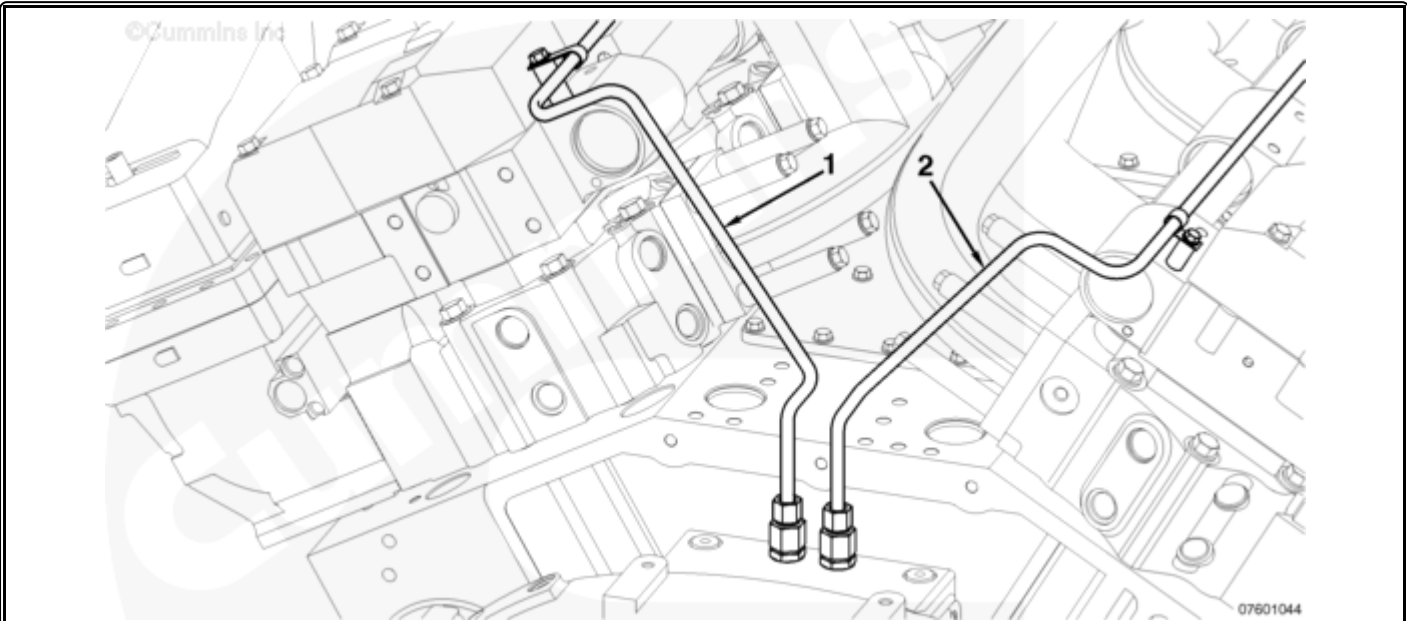


Figure 1, Old arrangement with oil supply tubes from the flywheel housing.

- 1. Old Part Number 3171844 (left bank)
- 2. Old Part Number 3171845 (right bank)

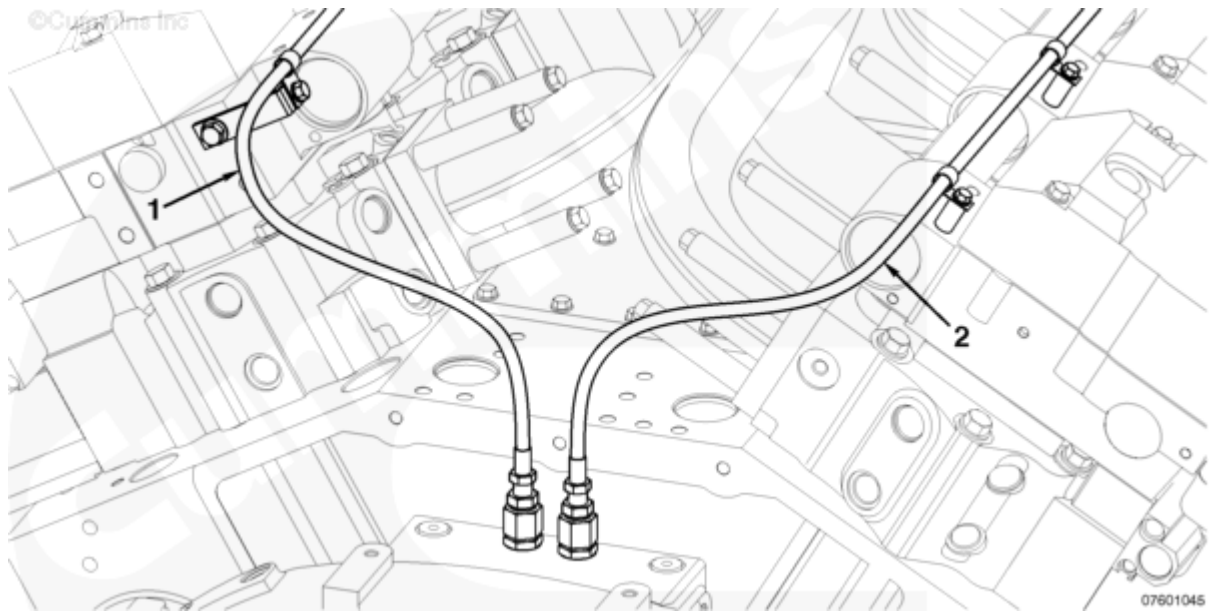


Figure 2, New arrangement with oil supply hoses from the flywheel housing to tees

1. New Part Number 3635130 (left bank)
2. New Part Number 3635131 (right bank)

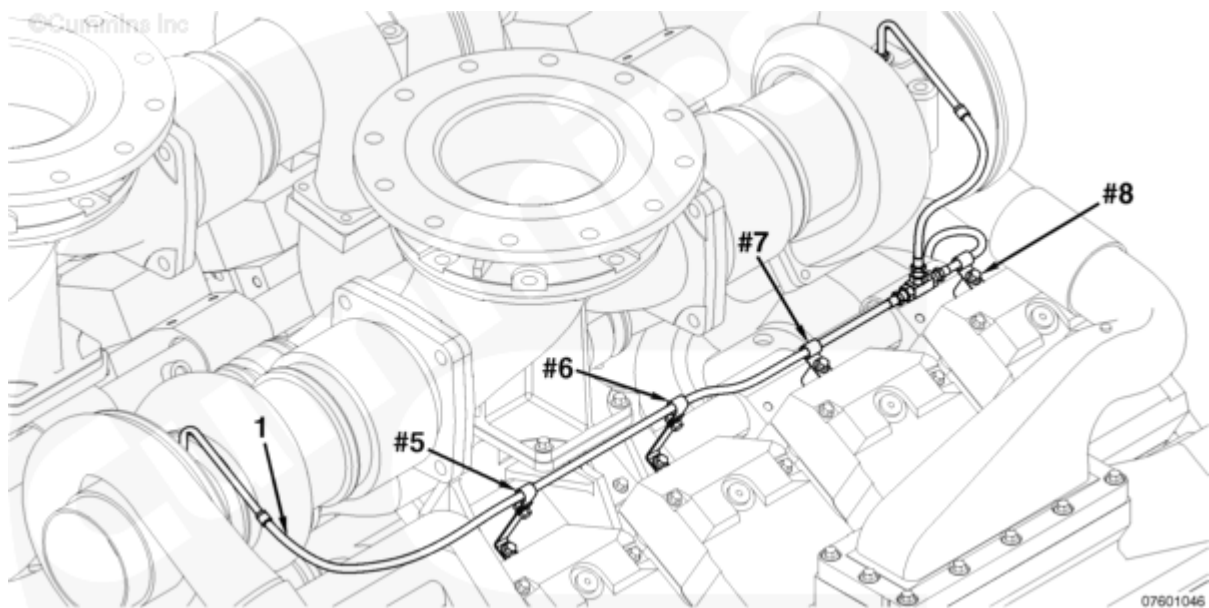


Figure 3, Left Bank, Clips at Number 5 and Number 6 are extended, clips at Number 7 and Number 8 are short.

1. New Part Number 3635129 (left bank)

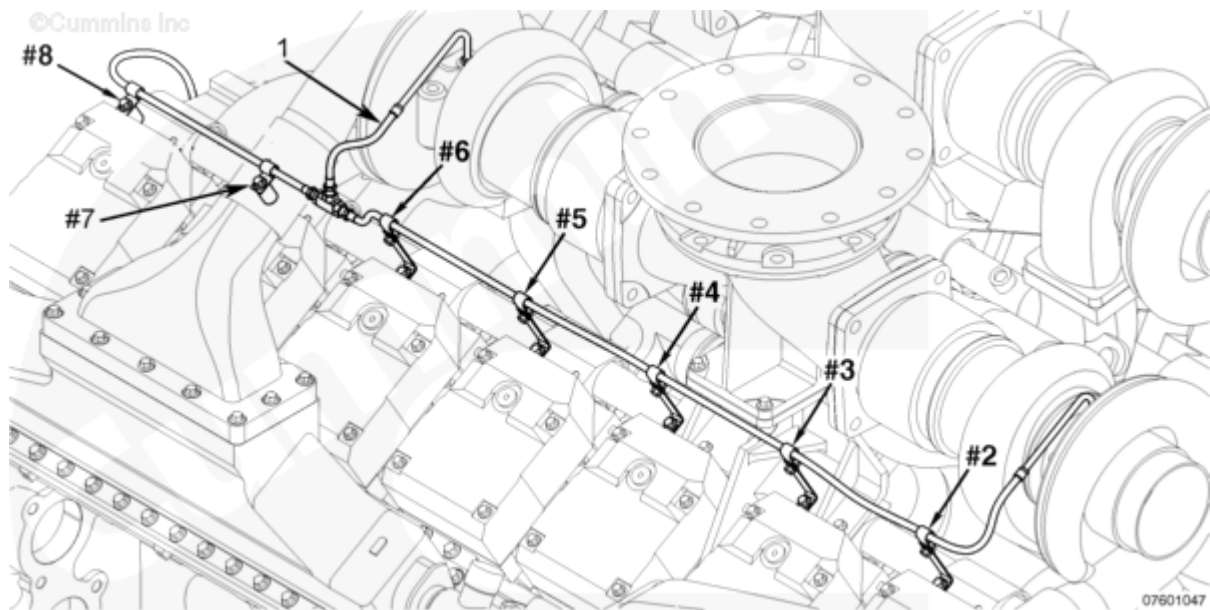


Figure 4, Right Bank, Clips at Number 2 to Number 6 are extended, Clips at Number 7 and Number 8 are short.

1. New Part Number 3635128 (left bank).

The new oil hoses use their own hardware, clips and connections, as detailed in Table 1. Reuse the existing spacers, capscrews, and clip stand-offs. Replace the part numbers in all entries of the old turbocharger oil supply option TP 6726 listed above with new part numbers on hard copies of the QSK60 and QSK60G Parts Catalogs.