



Technical Service Bulletin

Technical Service Bulletin: tsb100676

Released Date: 30-Jun-2008

New Cylinder Block and Piston Cooling Nozzles

New Cylinder Block and Piston Cooling Nozzles

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin revises topic 08T1-33; please replace 08T1-33 with this topic.

This Technical Service Bulletin documents the obsolescence of Part Number 4955924, QSK45 Cylinder Block Kit, and Part Number 4955925, QSK60 Cylinder Block Kit, and announces a part number change for the center bolt in the Piston Cooling Nozzle Kit.

A new cylinder block, piston cooling nozzles, and associated hardware are also introduced.

Casting changes in the cylinder block were made to accommodate a connecting rod design change.

The new cylinder block was implemented in production on all QSK45 and QSK60 engines, effective January 22, 2008, with the engine serial number (ESN) first being 33172060. The new block **must** be used in combination with two new piston cooling nozzles and two new piston cooling nozzle mounting bolts.

As long as the new piston cooling nozzles are used with the new cylinder block, the new block is backward compatible with older hardware.

⚠ CAUTION ⚠

Old style piston cooling nozzles must be used with the old style block and the new style piston cooling nozzles must only be used with the new style block.

Table 1, Old and New Part Numbers for QSK45 and QSK60 Cylinder Block, Cylinder Block, Piston Cooling Nozzle, Piston Cooling Nozzle Kits and Mounting Hardware

Description	Old Part Number	Description	Quantity	New Part Number
QSK45 Cylinder Block	4016528	QSK45 Cylinder Block		3640781
QSK60 Cylinder Block	4001053	QSK60 Cylinder Block		3640782
QSK45 Rail Block	4101419	QSK45 Rail Block		3640736
		Piston Cooling Nozzle Kit	1	4955917
Nozzle, piston cooling, long	4100577	Nozzle, piston cooling, long	1	3640536
Nozzle, piston cooling, short	4086586	Nozzle, piston cooling, short	1	3640540
Bolt, banjo	4001095	Bolt, banjo	1	3640543
Bolt, center	3089016	Bolt, center	1	3641125

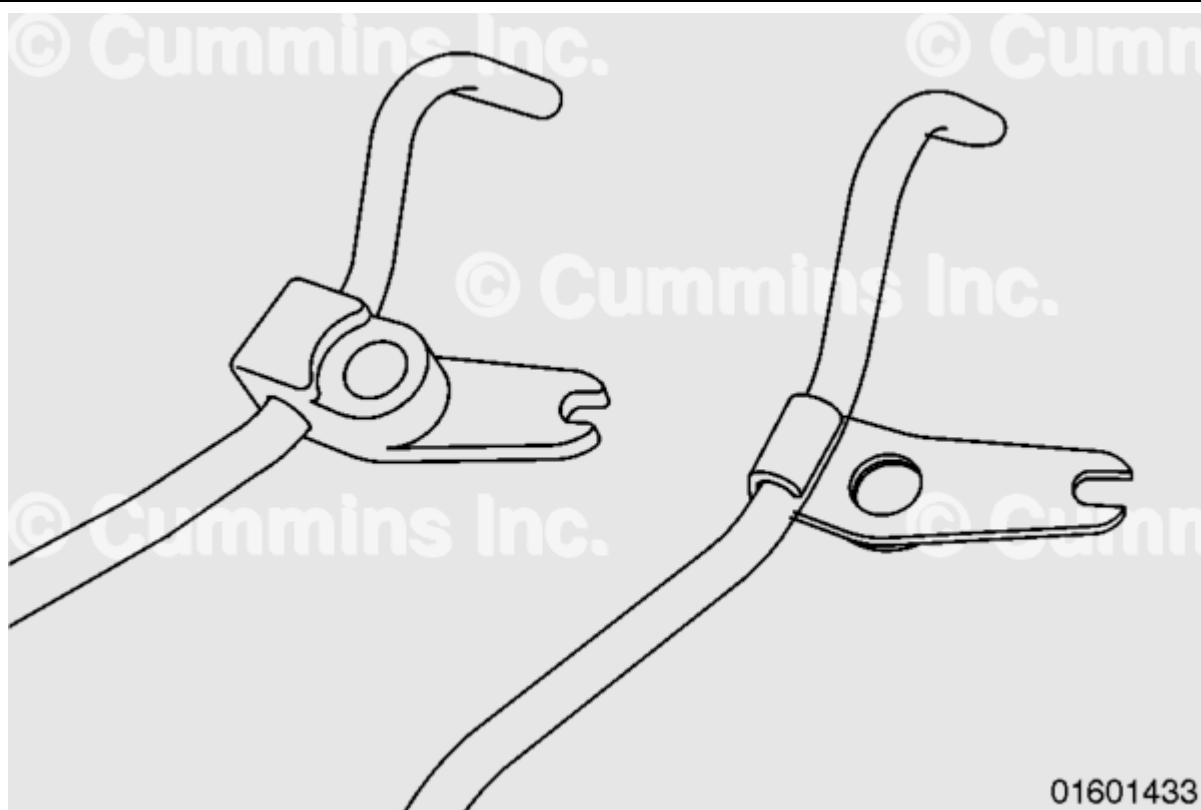


Figure 1, Old Long Piston Cooling Nozzle (left) and New Long Piston Cooling Nozzle (right)

The new long piston cooling nozzle can be identified by the thinner mating surface near the nozzle end.

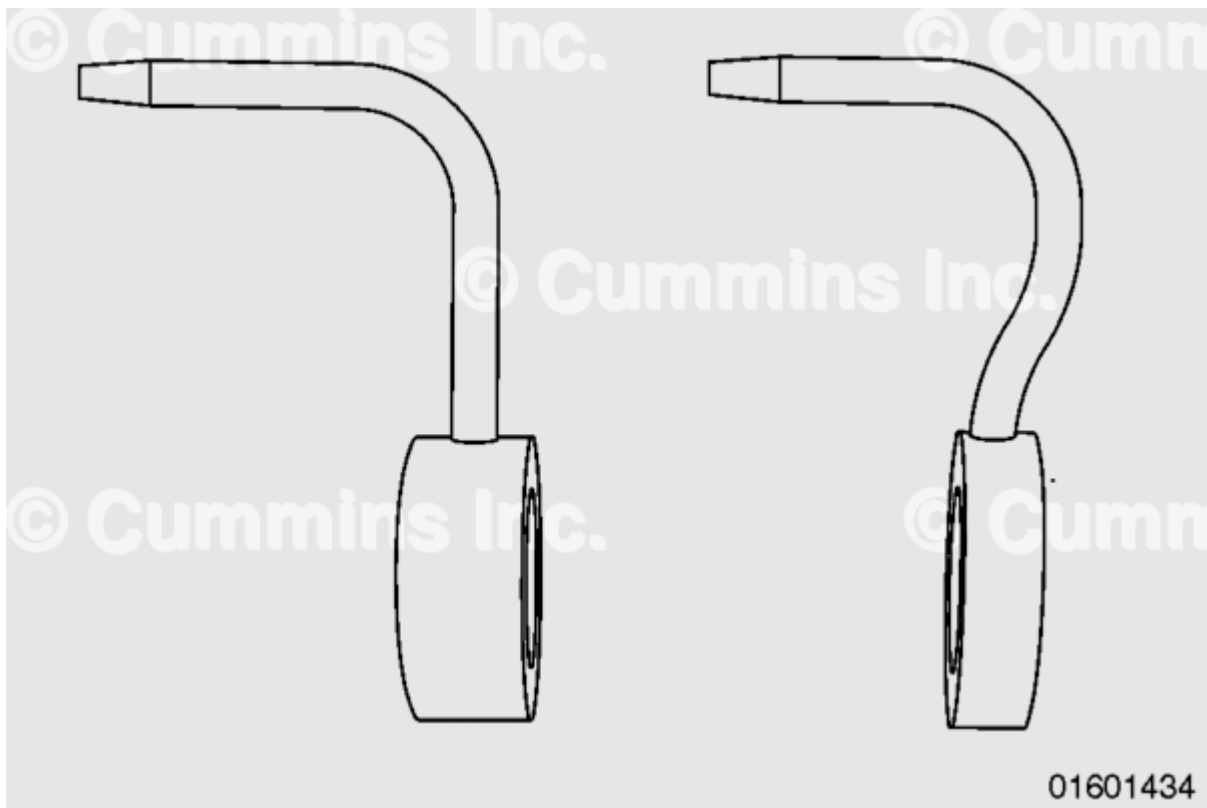


Figure 2, Old Short Piston Cooling Nozzle (left) and New Short Piston Cooling Nozzle (right)
The new short piston cooling nozzle can be identified by the additional bend in the nozzle.

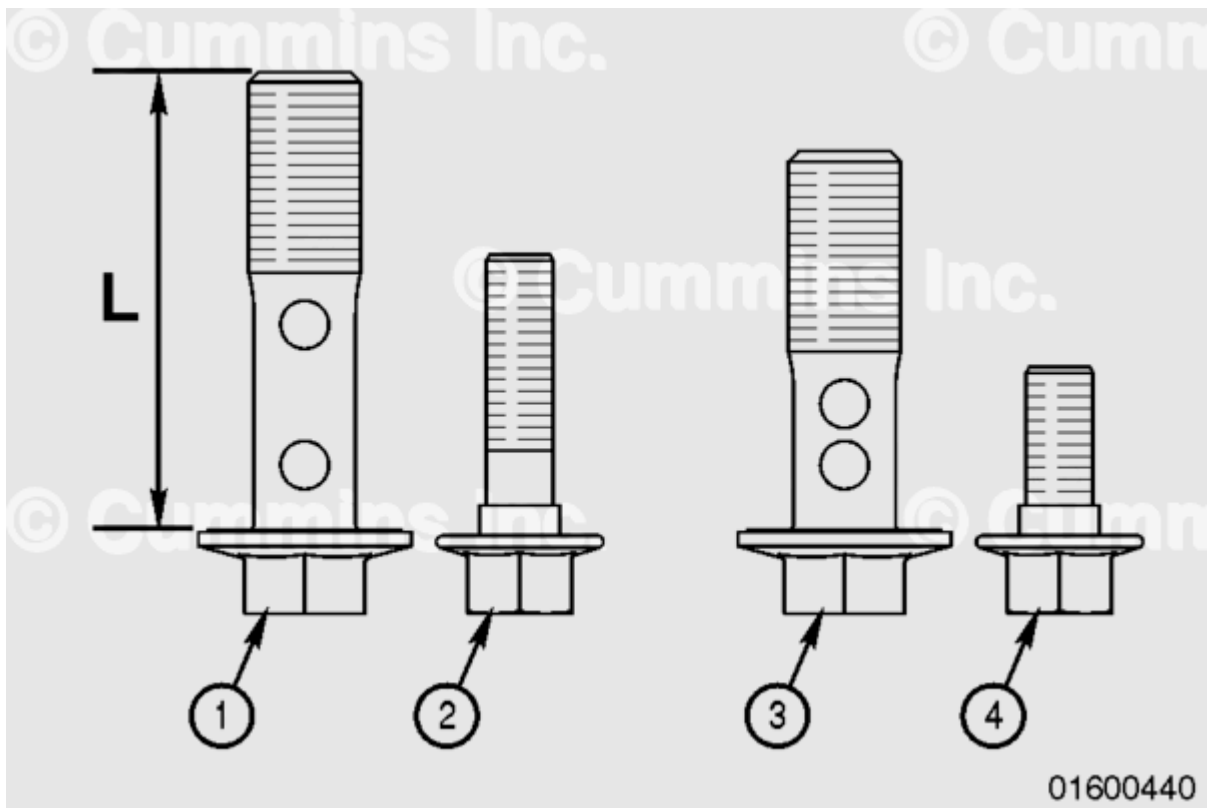


Figure 3, Old Banjo (1) and Center Bolt (2), New Banjo (3) and Center Bolt (4)

Description	Old Part Number Length mm [in]	New Part Number Length mm [in]
Bolt, banjo	57 mm [2.24 in]	45 mm [1.77 in]
Bolt, center	35 mm [1.38 in]	20 mm [0.79 in]

The new bolts are shorter than the previous bolts, as illustrated above.