



Technical Service Bulletin

Technical Service Bulletin: tsb100744

Released Date: 16-Mar-2009

New Two Piece Fuel Manifold

New Two Piece Fuel Manifold


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.


Contents

This Technical Service Bulletin introduces design changes to the QSK45 and QSK60 series engine fuel manifold.

The damage mode associated with the present fuel manifold is a fatigue crack that propagates from close to the mounting hole at the bottom edge of the manifold.

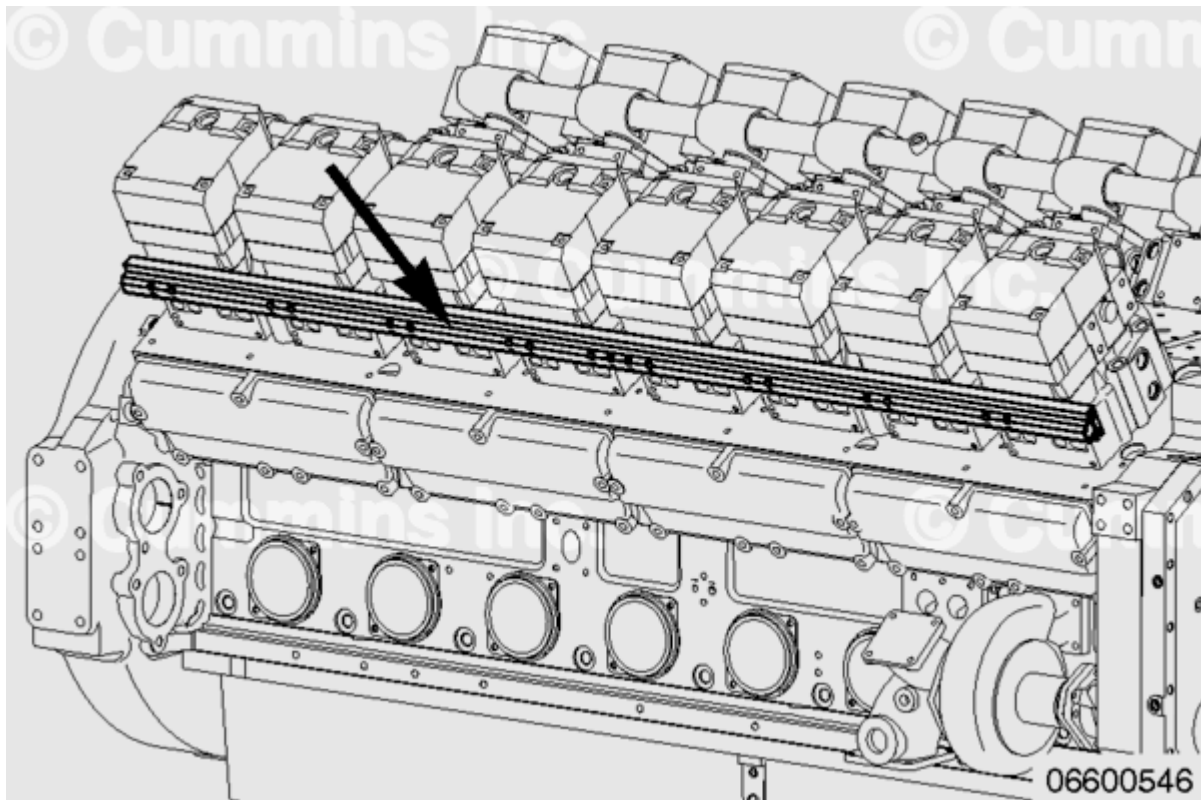

One Piece Fuel Manifold

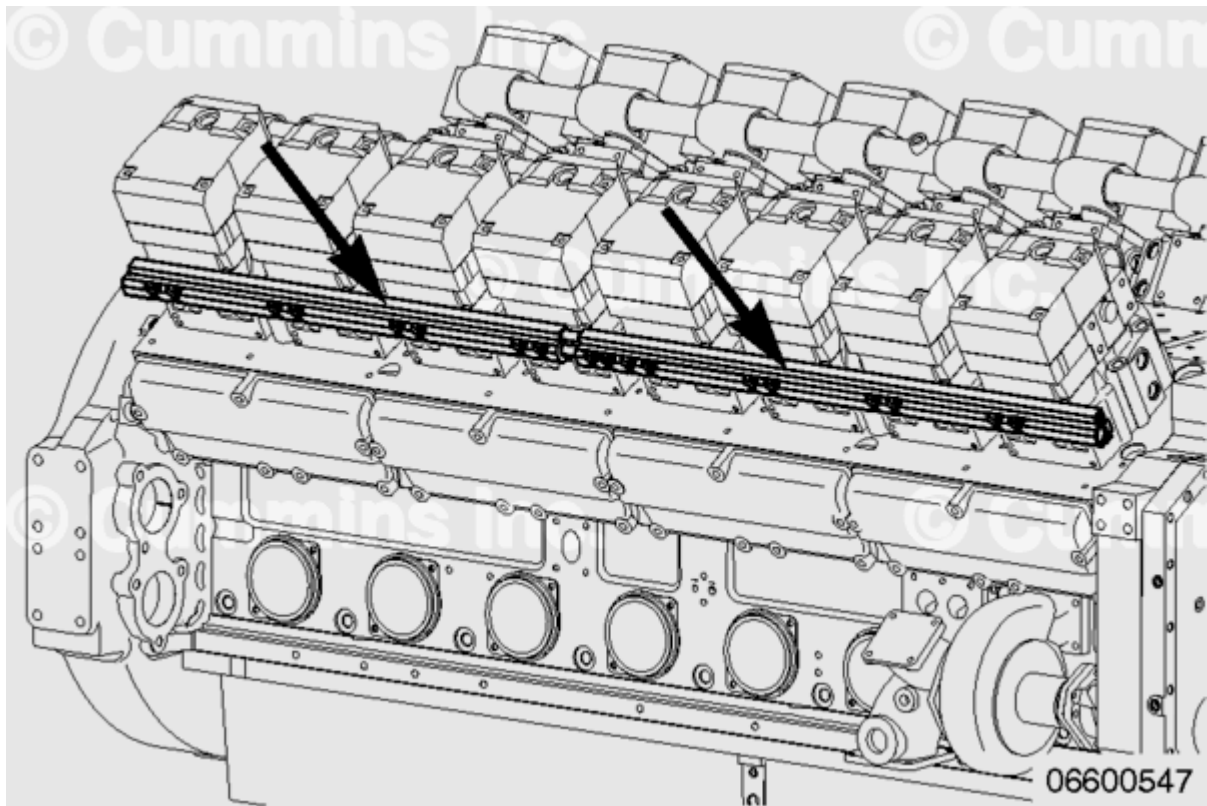


Two Piece Fuel Manifold


When a one piece fuel manifold fails, it is recommended that the fuel manifolds on both banks be replaced with the two piece manifold.

The two piece fuel manifold will reduce motion between fuel manifold(s) and gasket(s).

The two piece fuel manifolds are connected by three fuel transfer tubes with non reusable o-rings.

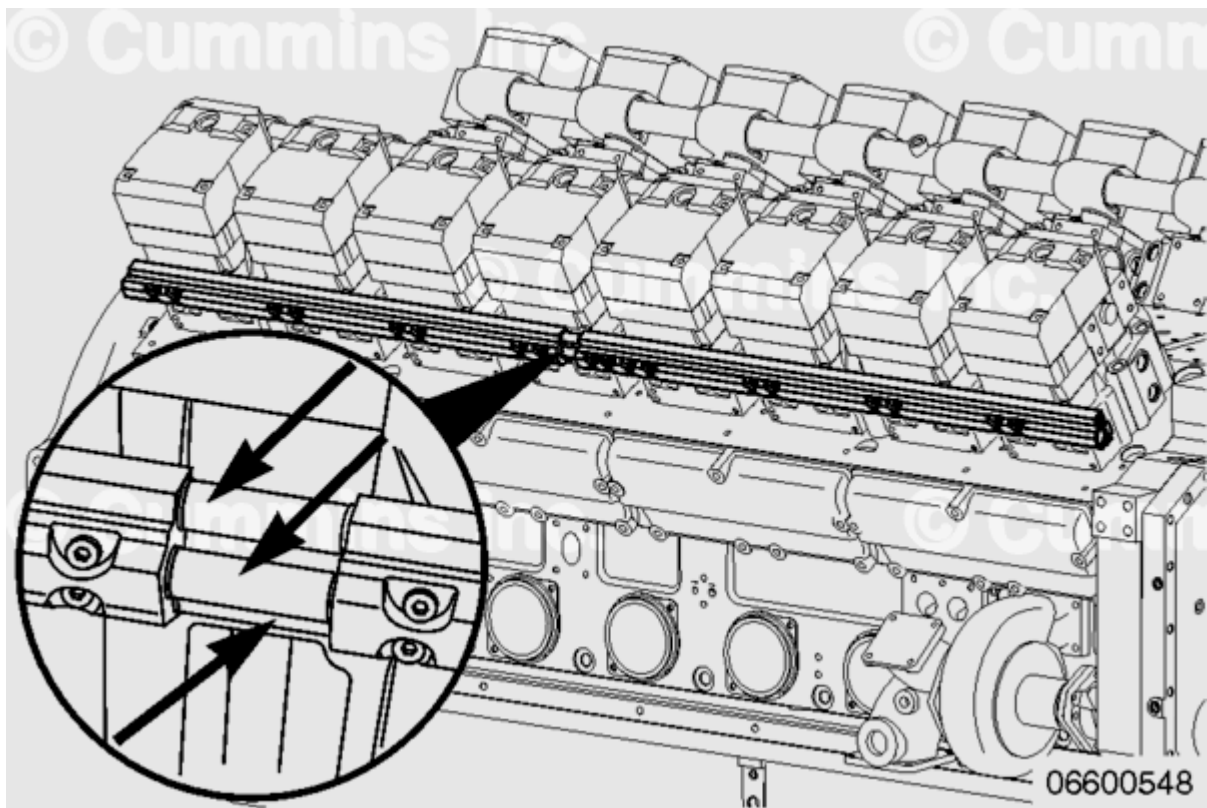


Two Piece Fuel Manifold Transfer Tubes Detail

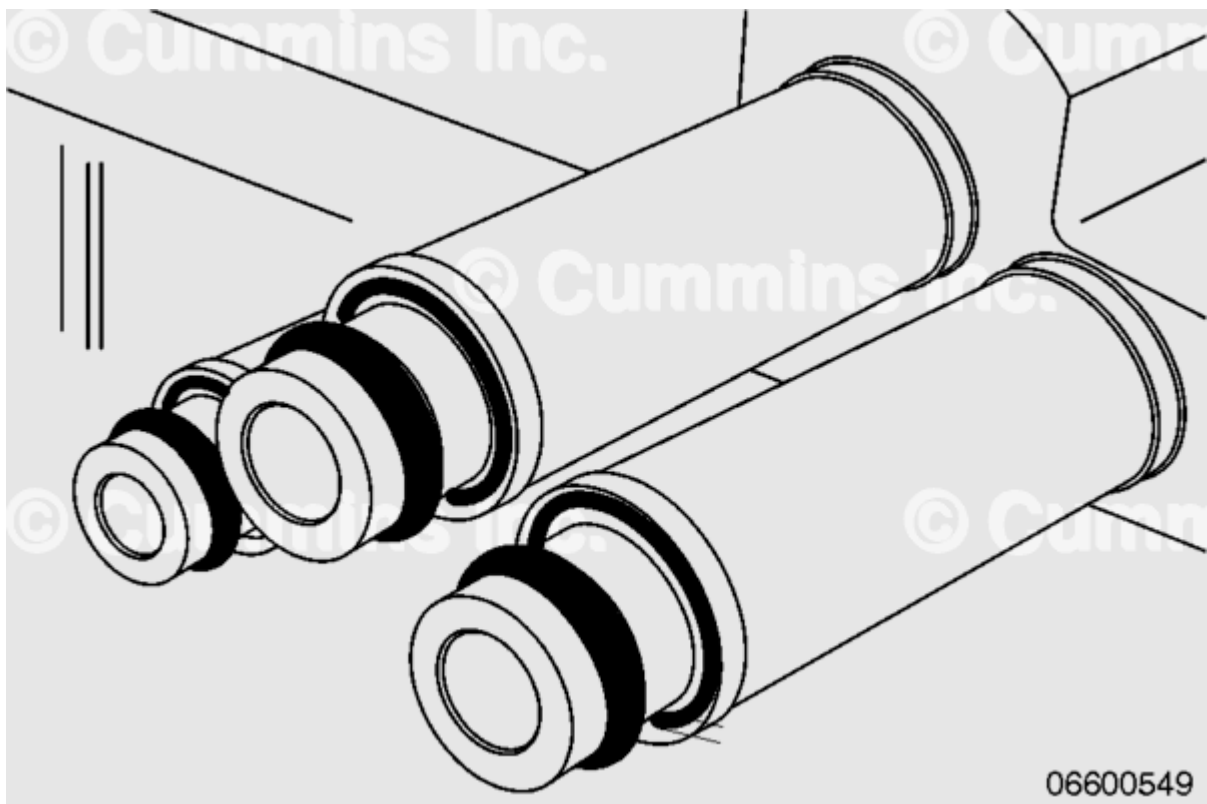

Fuel Transfer Tube o-rings and dust seals

The transfer tubes are protected by a fuel line shield as shown below.

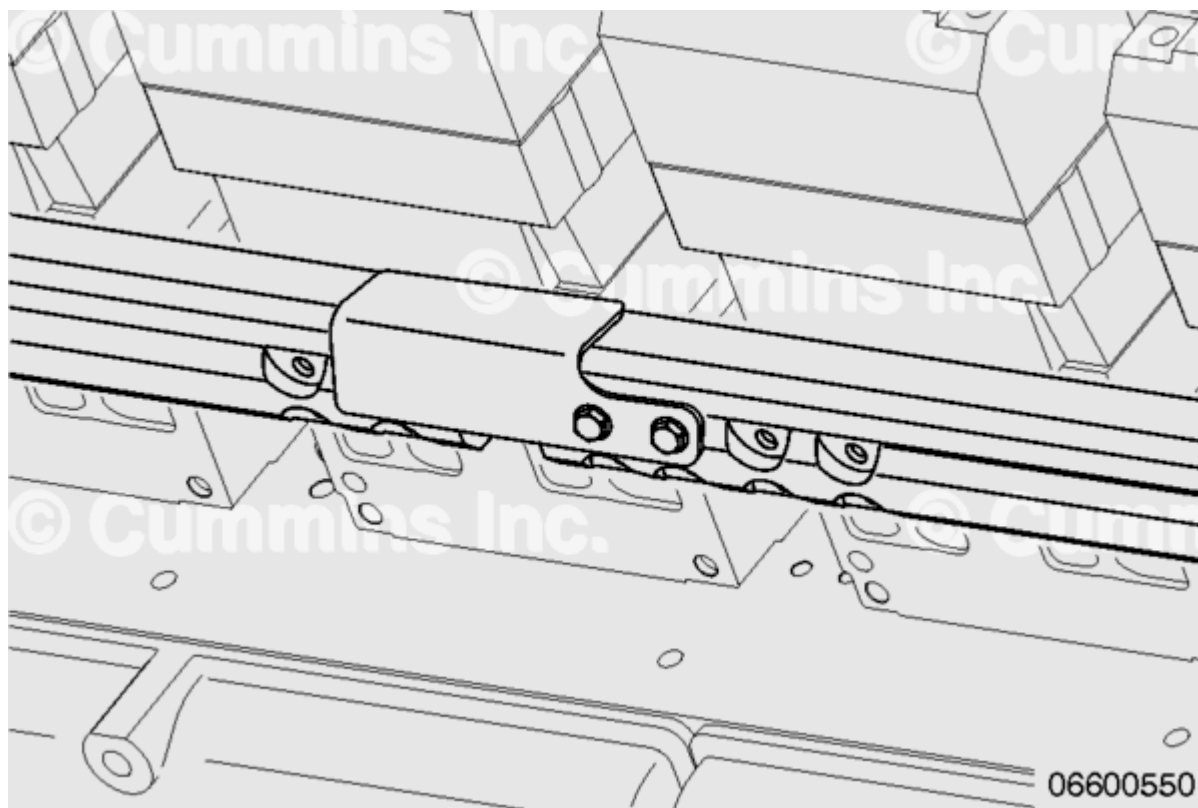

Fuel Line Shield

The two piece fuel manifolds obsolete and supersede all of the one piece fuel manifolds as shown in Table 1.

The remaining inventories of the one piece fuel manifolds have been scrapped.

Table 1

Engine	Old Part Number	New Part Number	Description
QSK 45	4086291	3638060	LB rear, RB front Fuel Manifold
QSK 45	4086291	3638061	RB rear, LB front Fuel Manifold
QSK 60	4086224	3638062	RB rear, LB front Fuel Manifold
QSK 60	4086224	3638063	LB rear, RB front Fuel Manifold

All of the parts needed to install the two piece fuel manifold are listed in Table 2 for the QSK 45 and Table 3 for the QSK 60.

Note : Each parts list indicate the parts required per bank.

Table 2

Part Number	Quantity	Description
3638060 ¹	1	Manifold, Fuel (LB rear, RB front)

Table 2		
Part Number	Quantity	Description
3638061 ¹	1	Manifold, Fuel (RB rear, LB front)
3638064 ¹	2	Tube, Fuel Transfer (Timing and Drain)
3638065 ¹	1	Tube, Fuel Transfer (Rail)
3638326 ¹	4	Seal, Dust (Timing and Drain)
3638327 ¹	2	Seal, Dust (Rail Transfer)
3638101 ¹	4	Seal, O-Ring (Timing and Drain)
3638102 ¹	2	Seal, O-Ring (Rail Transfer)
3639630 ¹	1	Shield, Fuel Line
3639283 ¹	2	Screw, Hex Flange Head Cap
3637870	6	Gasket, Fuel Manifold
3089501	4	Seal, Rectangular Ring
3171170	2	Gasket, Connection
3082358	2	Seal, O-Ring
¹ These parts are Fuel Manifold Kit, Part Number 4955977.		

Table 3		
Part Number	Quantity	Description
3638062 ¹	1	Manifold, Fuel (RB rear, LB front)
3638063 ¹	1	Manifold, Fuel (LB rear, RB front)
3638064 ¹	2	Tube, Fuel Transfer (Timing and Drain)
3638065 ¹	1	Tube, Fuel Transfer (Rail)
3638326 ¹	4	Seal, Dust (Timing and Drain)
3638327 ¹	2	Seal, Dust (Rail Transfer)
3638101 ¹	4	Seal, O-Ring (Timing and Drain)
3638102 ¹	2	Seal, O-Ring (Rail Transfer)
3639630 ¹	1	Shield, Fuel Line
3639283 ¹	2	Screw, Hex Flange Head Cap
3637870	8	Gasket, Fuel Manifold
3089501	4	Seal, Rectangular Ring

Table 3		
Part Number	Quantity	Description
3171170	2	Gasket, Connection
3082358	2	Seal, O-Ring
¹ These parts are Fuel Manifold Kit, Part Number 4955978.		

The Engine Serial Number Firsts for the QSK 45 and the QSK 60 are shown in Table 4.

Table 4		
Engine	Production Date	ESN First
QSK 45	30 June 2008	33174406
QSK 60	30 June 2008	33174389