



Technical Service Bulletin

Technical Service Bulletin: TSB101036

Released Date: 13-Sep-2010

Field Notification of Mislabels QSK60 Phase 2.0 CENSE™ Wiring Diagram, Bulletin 4021412 (Version-02 and -03)

Field Notification of Mislabels QSK60 Phase 2.0 CENSE™ Wiring Diagram, Bulletin 4021412 (Version-02 and -03)

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

The purpose of this document is to inform the field of three sensor and six wire mislabels on the Lube Oil Filter Extension Harness Connector for the QSK60 Phase 2.0 Industrial with CENSE™ Wiring Diagram, Bulletin 4021412. These mislabels exist on two versions of the wiring diagram, Bulletin 4021412-02 and 4021412-03. Reference Table 1 and Table 2 for the intended label information until Bulletin 4021412-04 of the wiring diagram is available.

Table 1: Sensor Labels from the Lube Oil Filter Extension Harness Connector

Sensor Mislabels	Intended Sensor Labels
Intake Manifold Temperature #3 (Right Bank Rear) Sensor	Intake Manifold Temperature #4 (Right Bank Rear) Sensor
Intake Manifold Temperature #3 (Right Bank Front) Sensor	Intake Manifold Temperature #2 (Right Bank Front) Sensor
Intake Manifold Temperature #2 (Left Bank Rear) Sensor	Intake Manifold Temperature #3 (Left Bank Rear) Sensor

Table 2: Wire Labels from the Lube Oil Filter Extension Harness

Wire Mislabels	Intended Wire Labels
Intake Manifold Temperature #3 (Right Bank Rear) 5 Volt Supply	Intake Manifold Temperature #4 (Right Bank Rear) 5 Volt Supply
Intake Manifold Temperature #3 (Right Bank Rear) Signal	Intake Manifold Temperature #4 (Right Bank Rear) Signal

Table 2: Wire Labels from the Lube Oil Filter Extension Harness	
Wire Mislabels	Intended Wire Labels
Intake Manifold Temperature #3 (Right Bank Front) 5 Volt Supply	Intake Manifold Temperature #2 (Right Bank Front) 5 Volt Supply
Intake Manifold Temperature #3 (Right Bank Front) Signal	Intake Manifold Temperature #2 (Right Bank Front) Signal
Intake Manifold Temperature #2 (Left Bank Rear) 5 Volt Supply	Intake Manifold Temperature #3 (Left Bank Rear) 5 Volt Supply
Intake Manifold Temperature #2 (Left Bank Rear) Signal	Intake Manifold Temperature #3 (Left Bank Rear) Signal

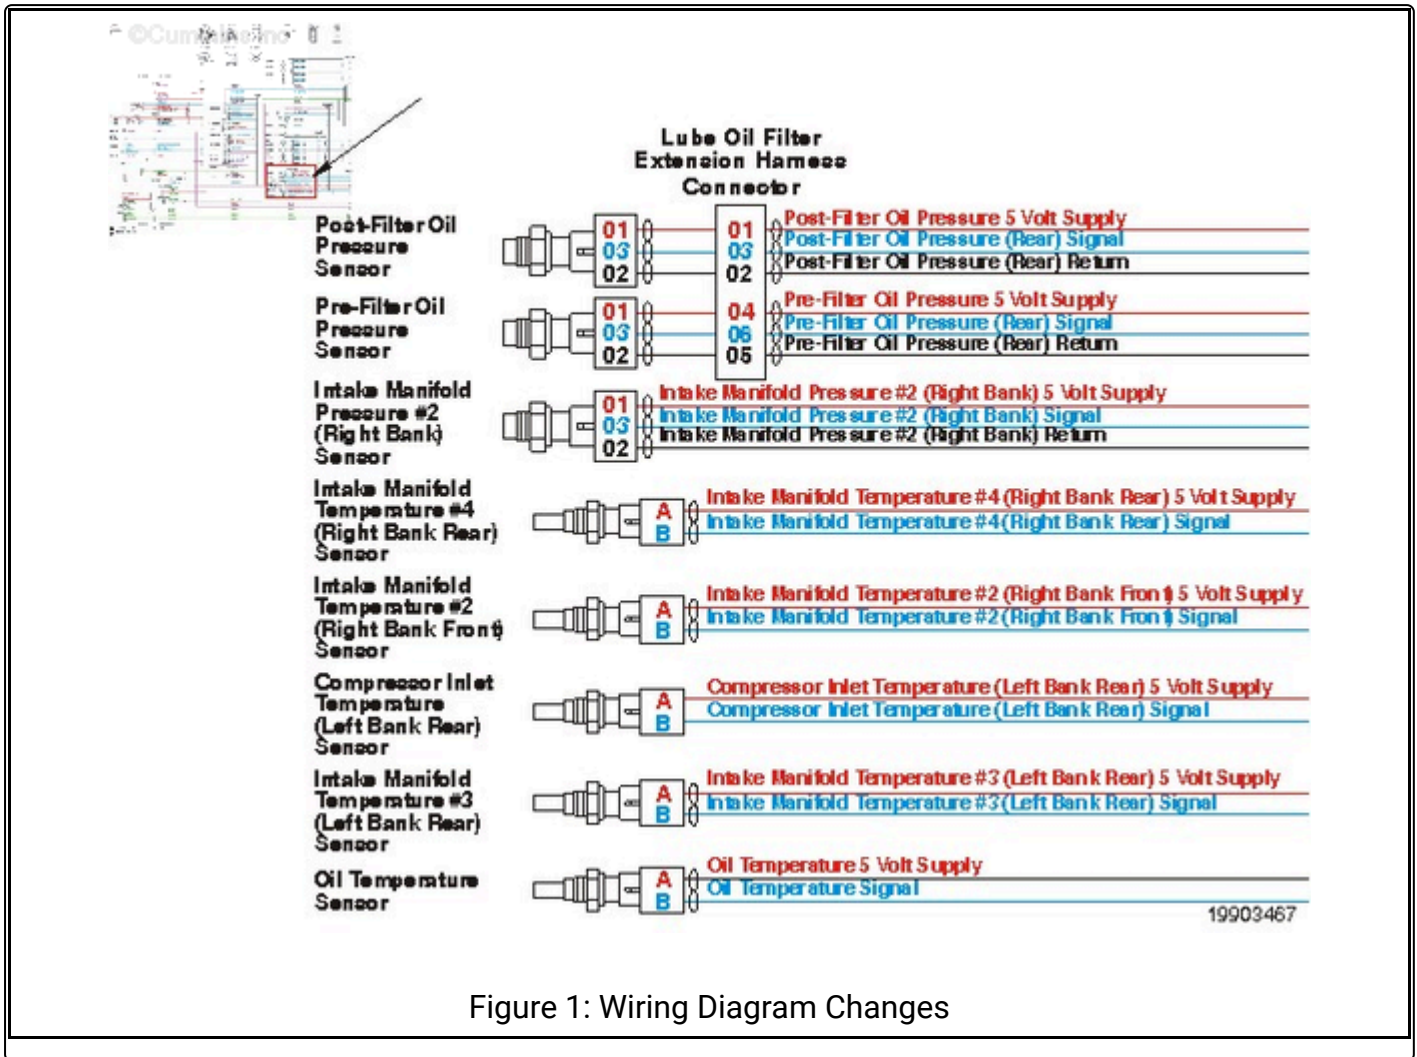


Figure 1: Wiring Diagram Changes

Document History

Date	Details
2010-8-19	Module Created

