



Technical Service Bulletin

Technical Service Bulletin: tsb101197

Released Date: 22-Oct-2002

New Fuel Manifold Introduction

New Fuel Manifold Introduction

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This service/parts topic introduces design changes to the QSK45 and QSK60 series engine fuel manifold, gasket, and fuel block. The failure mode associated with the current fuel manifold is wear of the steel carrier of the manifold gasket against the manifold.



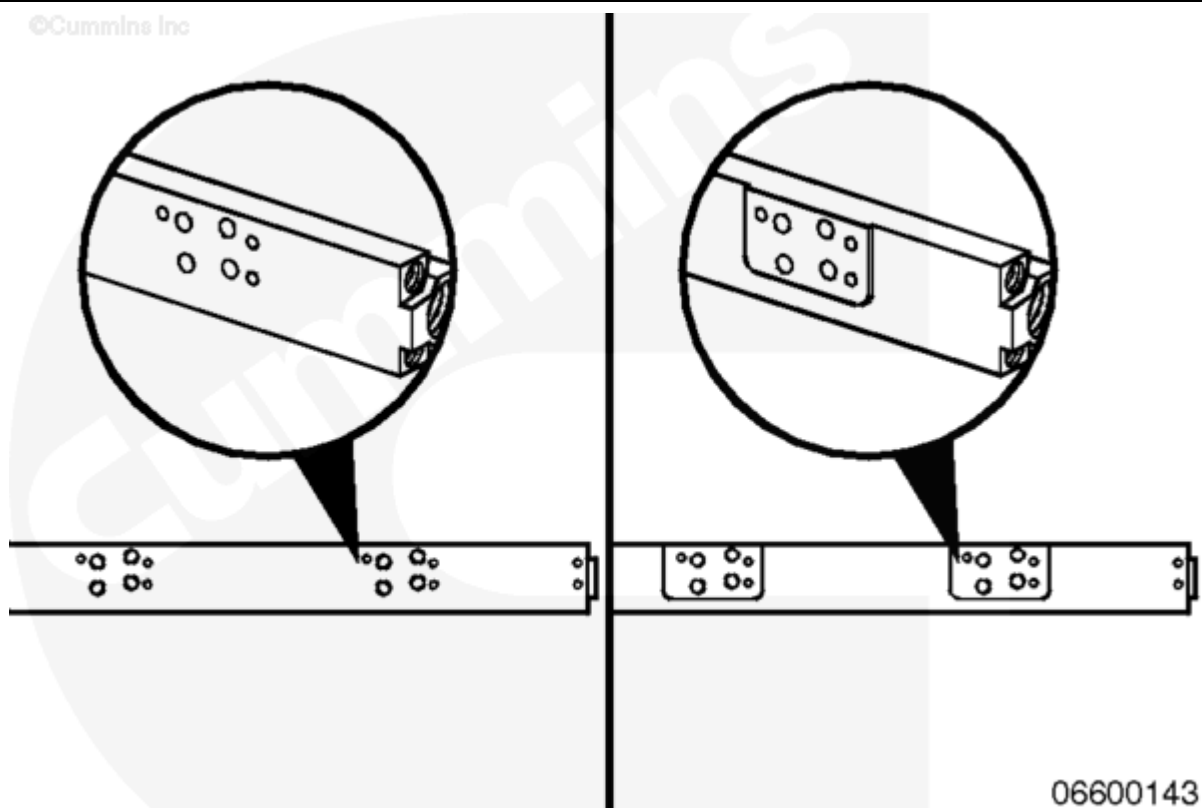


Figure 1, Old and New Style Fuel Manifold


The new manifold (Figure 1, right) has raised pads to eliminate contact between the edge of the gasket and the manifold. To accommodate this change, the fuel manifold gasket and fuel block connections have also been redesigned.

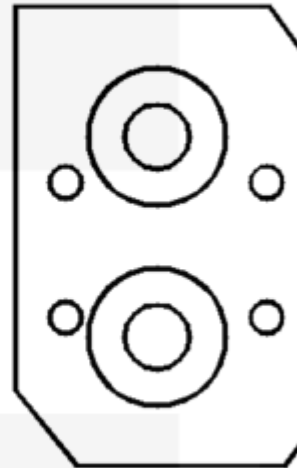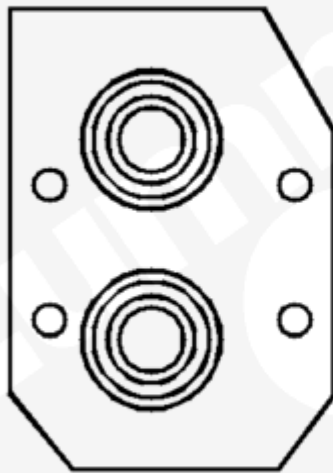

06600144

Figure 2, Old and New Style Fuel Block Connection

The fuel block connection did have molded-in seals (Figure 2, left). The new part number fuel block now uses two removeable o-ring seals instead of molded-in seals for improved serviceability (Figure 2, right).

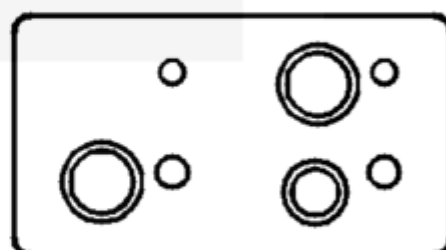

06600145

Figure 3, Old and New Style Fuel Manifold Gasket

The new fuel manifold gasket (Figure 3, right) has been modified to be compatible to the pad on the new fuel manifold .

The installation procedure has been updated to include the installation of the o-rings in the new fuel block connection and the new torque pattern for mounting the fuel manifold to the cylinder heads.

The old and new part numbers are shown in the table below:

Table 1, New Fuel Manifold Parts		
Description	Old Part Number	New Part Number
QSK45 fuel manifold	4001210	4086291
QSK60 fuel manifold	4001104	4086224
Fuel manifold gasket	3332181	4086222
Fuel block connection	3332104	4086223
O-ring	(Seal was integral with fuel block connection)	3072853*
* This o-ring is used in place of the integral seal.		

These changes went into production at the Daventry Engine Plant in June 2002. The engine serial number first for the fuel manifold change for the QSK45 series engine is ESN 33152275. The engine serial number first for the fuel manifold change for the QSK60 series engine is ESN 33152444.

The information in this document has no effect on current warranty coverage or repair practices, nor does it authorize TRP or Campaign.

Old and new parts can **not** be intermixed. The new part number fuel manifold gasket **must** be used with the new part number fuel manifolds. The old part number gasket **must** be used with the old part number fuel manifold. The new part number fuel block connection and fuel manifold gaskets **must** be used when a new part number fuel manifold is used.