



Technical Service Bulletin: tsb101469

Released Date: 08-Jul-2004

Revised Cylinder Liner Diameter Measurement

Revised Cylinder Liner Diameter Measurement

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Service/Parts Topic updates a change made to the QSK45 and QSK60 series engines. The topic provides details on Cylinder Liner Inner Diameters when installed in an engine block.

Diametrical measurements **must** be taken at the positions specified in Figure 1 and Table 1.

- Position 1 = 20 mm [0.8 in] from top of liner
- Position 2 = 115 mm [4.5 in] from top of liner
- Position 3 = 205 mm [8.0 in] from top of liner.

At each specified position, two measurements **must** be taken. The measurements **must** be 90 degrees apart. Ensure that the measurements taken fall within the limits specified within the table below.

The inner diameter **must** be **no more** than 0.064 mm [0.0025 in], out of round at each location.

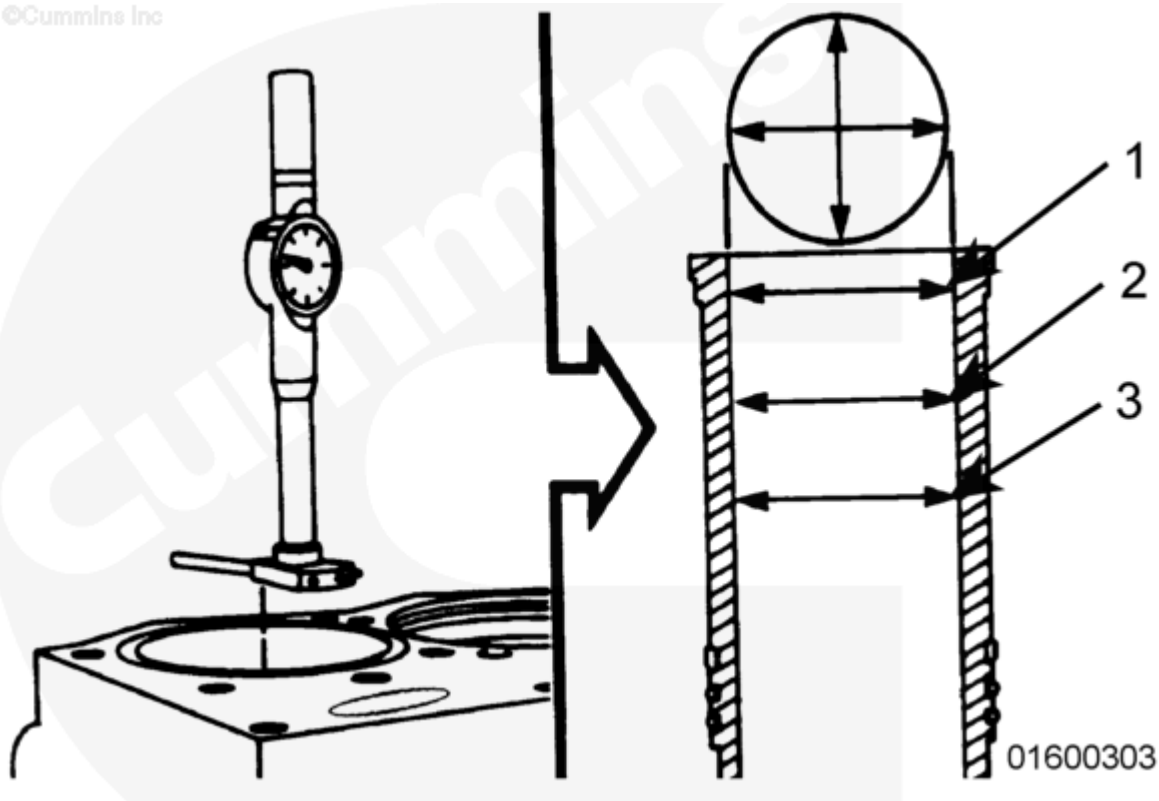


Figure 1

Table 1. Cylinder Liner Inside Diameter.

Reference Position	Distance from Top of Liner	Maximum Inner Diameter	Minimum Inner Diameter	Maximum Liner Ovality
1	20 mm [0.8 in]	158.75 mm [6.25 in]	158.65 mm [6.246 in]	0.064 mm [0.0025 in]
2	115 mm [4.5 in]	158.785 mm [6.2513 in]	158.725 mm [6.2490 in]	0.064 mm [0.0025 in]
3	205 mm [8.0 in]	158.785 mm [6.2513 in]	158.725 mm [6.2490 in]	0.064 mm [0.0025 in]

Note : This is a product improvement and is not subject to campaign.

Related Procedures

56-001-028-topic
 (/qs3/pubsys2/xml/en/procedures/56/56-001-028-topic.html)

Cylinder Liner
 (/qs3/pubsys2/xml/en/procedures/56/56-001-028-topic.html)

