



Technical Service Bulletin

Technical Service Bulletin: TSB180092

Released Date: 11-Jul-2018

Improved Aftercooler and Intercooler Cores

Improved Aftercooler and Intercooler Cores

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSKTA38-CE
- QSKTA38-ME
- QSKTA38-GE
- 12QTA38-CE
- QSKTA38-ME
- QSKTA38-GE
- QSK45-G
- QSK45-C
- QSK78-C
- QSK78-G
- QSK78-CE
- 18QTTA78-CE
- QSK78-C
- QTA60-C
- QSKTTA60-CE

Issue

Symptom:

- Intercooler leak
- Aftercooler leak
- Coolant in oil
- Coolant in cylinder
- Excessive bearing wear and engine component wear, damage or corrosion
- Sodium detected in oil over 20ppm and increased coolant consumption
- Cracks found during inspection at rebuild

Root Cause:

- Aftercooler or intercooler core flange and/or welding malfunction

Verification/Confirmation

- Instant oil feedback techniques such as viscosity tray (Viscostick/Viscotube) and hot spit plate
- Oil analysis on site or contracted oil analysis shows sodium over 20ppm
- Coolant leak visible in cylinder head
- Cracks visible

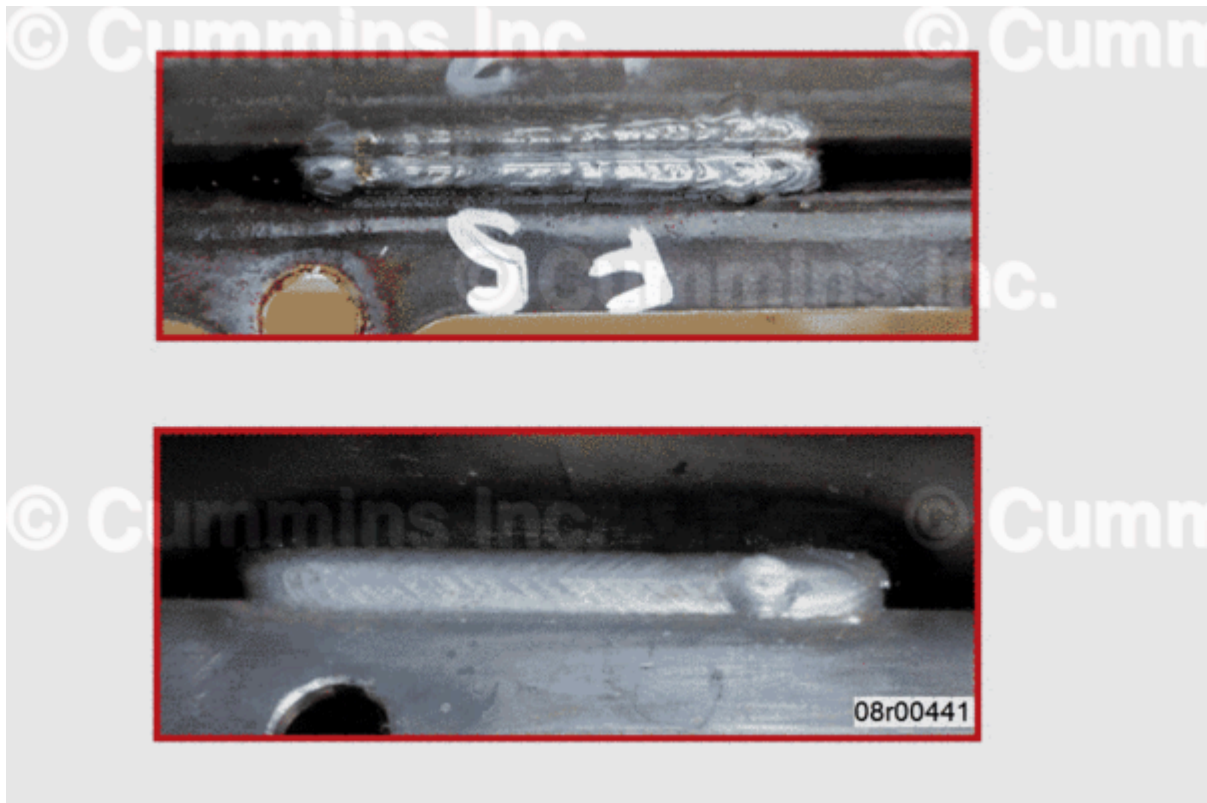


Figure 1, Top: Manual Weld Malfunction. Bottom: New Robotic Weld.

Resolution

Update to latest revision of core with more robust design.

Part Compatibility

Parts are backwards compatible.

Part Identification

Aftercooler core:



Figure 2, Aftercooler Core Part Number Identification

Table 1, Aftercooler Core Example Identification

P/N 3641079_2 Part Number_Revision	151214 (YYMMDD)	AAUKV (Supplier ID)
---------------------------------------	--------------------	------------------------

Intercooler Core:

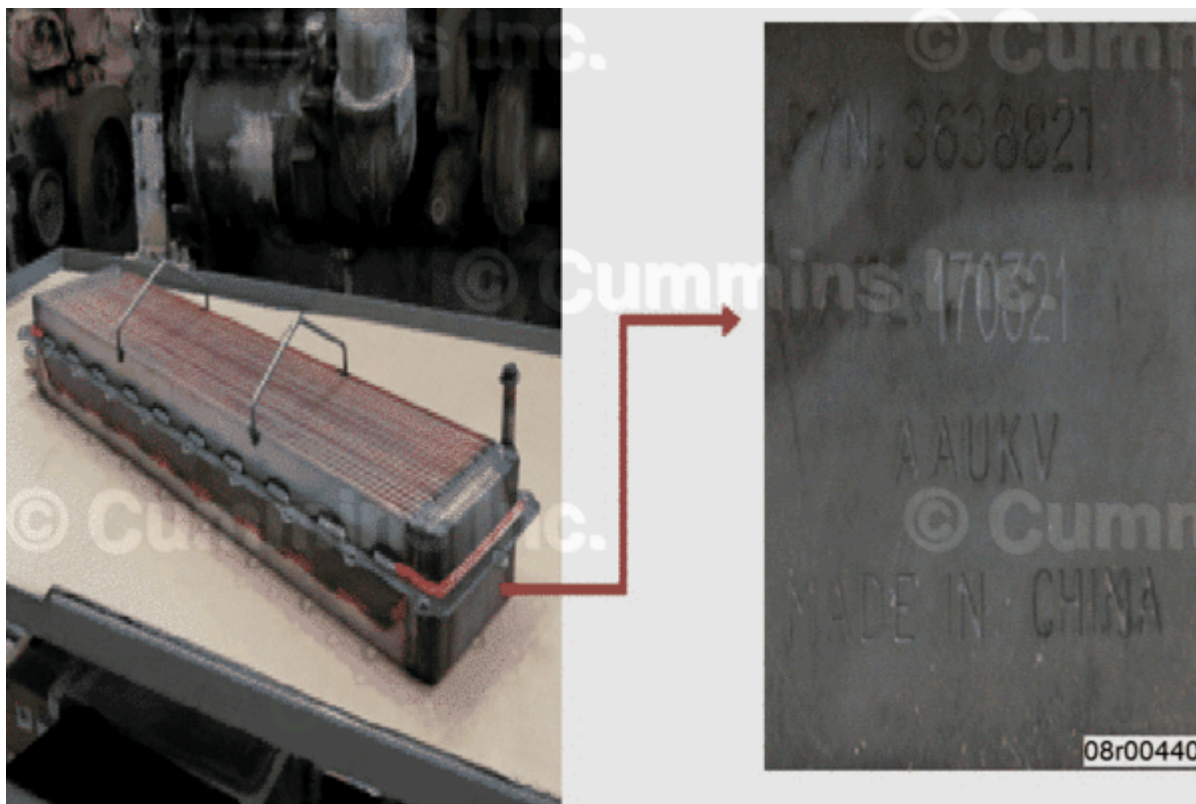


Figure 3, Intercooler Core Part Number Identification

Table 2, Intercooler Core Example Identification

P/N 3638821(_1) Part Number(_Revision)	170321 (YYMMDD)	AAUKV (Supplier ID)
---	--------------------	------------------------

Note : Revision number has been added to intercooler part number after 6 Jul 2018 – date code 180706.

Part Inventory Action

Intercooler and aftercooler cores with a rev number after the part number should be used.

Production Status

For ESN 1st fitted with an aftercooler core manufactured with improved techniques after date of 13 Oct 2015, See Table 3.

Table 3, Production Status

ESN First	Build Date ¹	Plant
33206677	21 Jan 2016	Daventry Engine Plant
66303788	20 Jan 2016	Daventry Engine Plant

¹Engine build date can be found on the engine dataplate.

Document History

Date	Details
2018-7-11	Module Created

Last Modified: 11-Jul-2018
