



Technical Service Bulletin: TSB190118

Released Date: 02-Jan-2025

Jumper Harness for Lead-Free Transition of Ambient Air Pressure (AAP) Sensor

Jumper Harness for Lead-Free Transition of Ambient Air Pressure (AAP) Sensor

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

Engine platforms affected:

- KTA38-C
- KTTA38
- KTA50-C
- KTTA50
- KTA50
- QSK23 CM500
- QSK23 CM2250
- QSK23 CM2350
- QST30 CM552
- QST30 CM2350
- QSK45-C
- QSK60-C
- QSK60-G
- QTA60-C

Description of Change

Due to the Cummins lead-free transition, leaded Ambient Air Pressure (AAP) sensors have been replaced by lead-free AAP sensors. The changes in some early sensor designs results in a difference in connector.

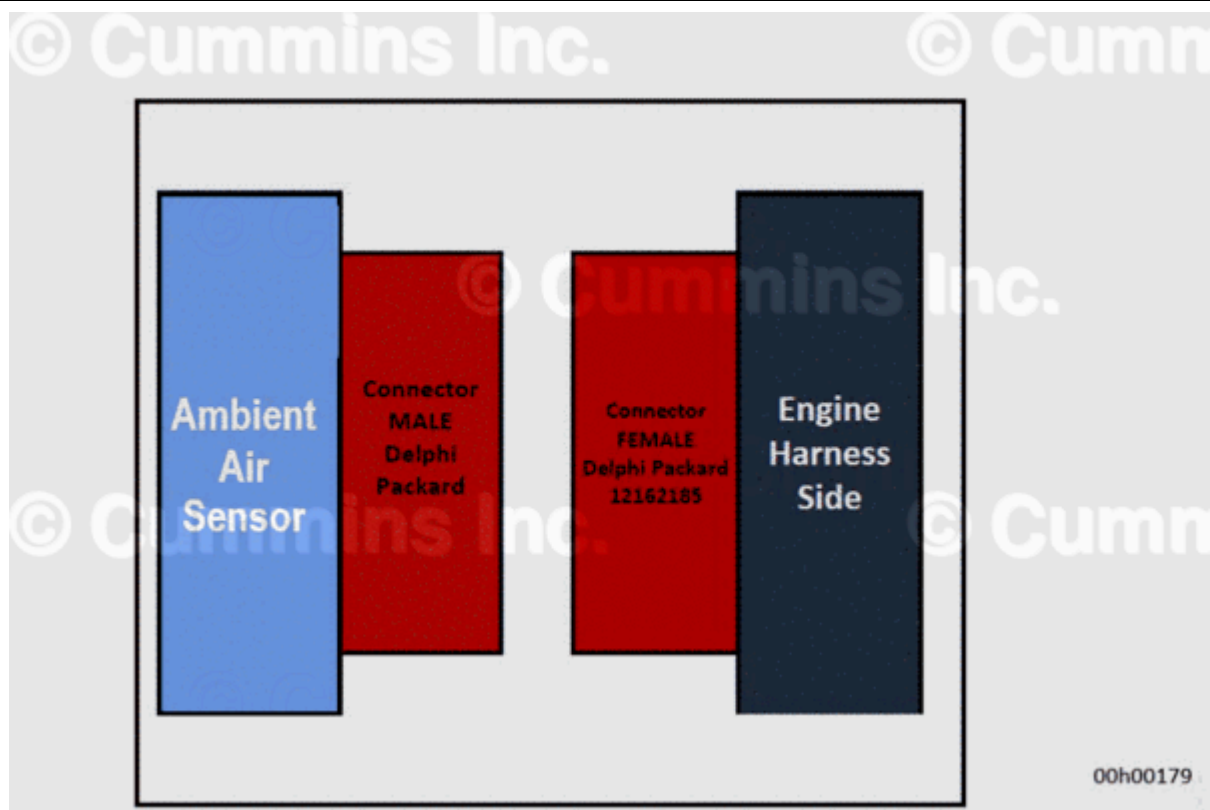


Figure 1, Current Scenario

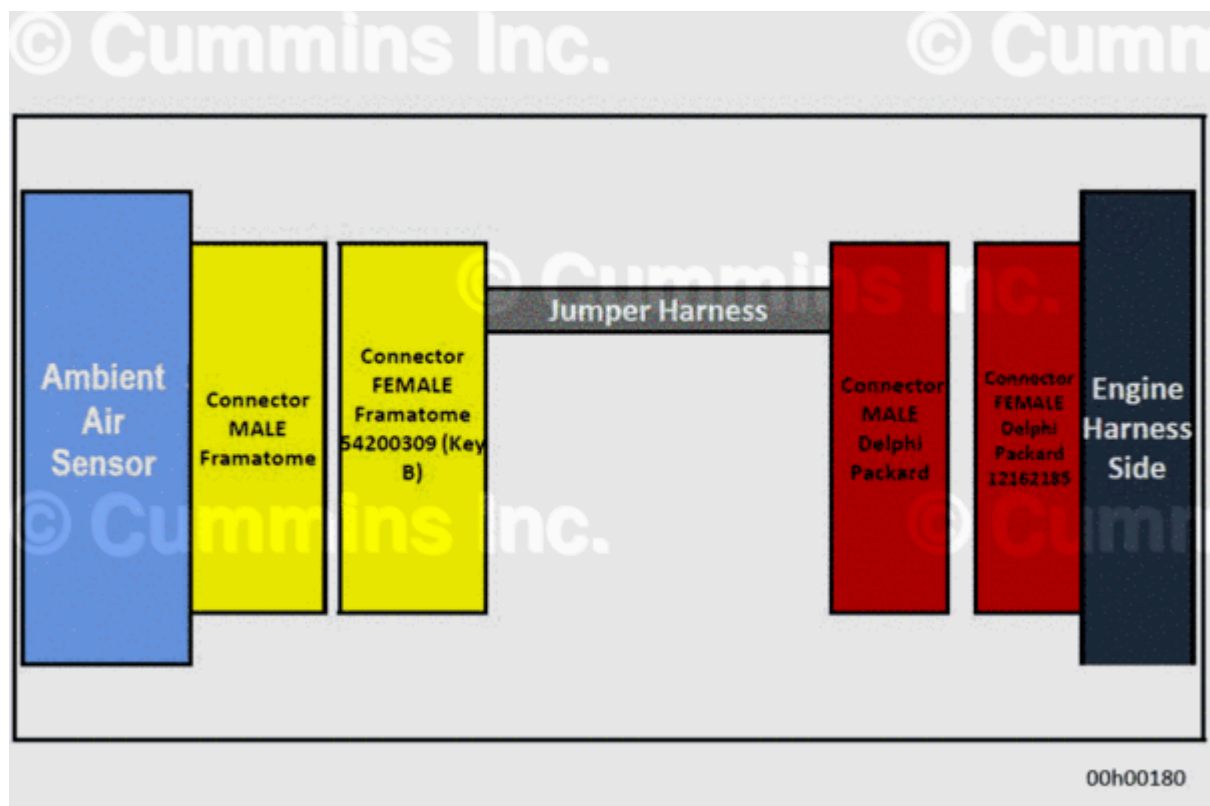


Figure 2, Proposed Solution

The jumper harness listed in Table 1 will allow customers using the existing harness listed in Table 1 to use the new AAP sensor.

Use the correct Ambient Air Pressure sensor. If applicable, install jumper harness. Some engine wire harnesses require the jumper harness to match the sensor connector. Using the incorrect replacement Ambient Air Pressure Sensor can cause engine shutdowns or derates with no associated fault codes.

The pressure range in which the different sensors operate and the harness connector keys being the same for both pressure ratings.

Refer to Table 1.

Reason for Change

Cummins is transitioning away from lead based product to an alternative unleaded equivalent.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
AAP sensor [0-15 PSIA]	4902720	Yes	Yes	4359572
AAP sensor [6-16 PSIA]	4076493	Yes	Yes	2897331
Jumper Harness	N/A	No	No	4384743
Engine Harness	3639186	No	Yes	5538717
	3646913			5538718
	4323225			5538719
	4328452			5538720
	5371865			5538721
	3640128			5538728
	4323226			5538729
	4328451			5538730

Part Inventory Action

Use existing part number inventory before using the new part number.

Document History

--

Date	Details
2019-7-2	Module Created
2021-7-8	Non-Product Problem Solving (PPS)
2024-9-26	Added additional products to product affected list. Updated Description of Change and Reason for Change sections to include information on ambient air sensor rather than Existing Sensor Part Number 4902720 or 4359572.

Last Modified: 02-Jan-2025
