



Technical Service Bulletin

Technical Service Bulletin: TSB190078

Released Date: 18-Jun-2025

New Lubricating Oil Filter Differential Pressure Fault Code Thresholds

New Lubricating Oil Filter Differential Pressure Fault Code Thresholds

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK38 CM2150 K106
- QSK38 CM2150 K138M
- QSK38 CM2150 K142M
- QSK38 CM2150 MCRS M
- QSK45 CM500
- QSK50 CM2150 K107
- QSK50 CM2150 K140M
- QSK50 CM2150 MCRS M
- QSK50 CM2350 K108
- QSK60 CM2150 K132M
- QSK60 CM2150 MCRS
- QSK60 CM2350 K116
- QSK60 CM2350 K117
- QSK60 CM500
- QSK78 CM2350 K126
- QSK78 CM2350 K137
- QSK78 CM500

Description of Change

This document announces the introduction of unique lubricating oil filter differential pressure fault code thresholds for the two lubricating oil filter types available today: spin-on filter canisters and Eliminator™ filtration systems. In addition, the lubricating oil filter differential pressure feature now supports engine protection derates for engines equipped with Eliminator™.

Reason for Change

In the past, engines equipped with either Eliminator™ filters or spin-on filter canisters used the same lubricating oil filter differential pressure fault code threshold. This fault code threshold was originally designed to alert operators to the condition of lubricating oil filter bypass caused by lubricating oil filter plugging.

Due to the differences in filter element design, Eliminator™ filters require a lower fault threshold. Therefore, two separate thresholds have been implemented; a threshold for engines equipped with Spin-On filters, and another specific for engines equipped with Eliminator™.

Verification

Verify engine control module (ECM) code to ensure this feature is enabled. See Tables 1, 2, 3, 4, 5, 6, 7, and 8 below.

Customer Communication

A new Fault Code 3491 with Red Lamp (and an associated speed derate) has been introduced to complement the current FC1362 with Amber Lamp.

Equipment operators can experience an engine derate without any lamp or FC3491 displayed if the equipment's display software is not updated specifically for the new fault code.

For engines equipped with spin-on filter canisters, FC1362 (Amber) will become active when the differential pressure reaches sufficient levels to drive lubricating oil filtration bypass: 345kPa [50 psi]. Engines equipped with Eliminator™ filtration will see a FC1362 (Amber) once the differential pressure increases beyond nominal stable values indicative of proper backflush operation: 62kPa [9 psi]. If the lubricating oil filter assembly is **not** serviced, and differential pressure continues to increase, a FC3491/ FC612 (Red) will be received before the differential pressure drives lubricating oil filtration bypass: 96.5kPa [14 psi]. This FC3491/ FC612 is accompanied by an engine derate to limit the engine ability to force lubricating oil filter bypass operation.

Service Instructions

For Marine installations utilizing a C-Command Elite or Elite Plus panels, the panel monitors the lubricating oil differential pressure. To avoid duplicate fault codes, the lubrication oil differential pressure monitoring must be disabled in the Marine panel using the web configuration tool.

1. Connect an ethernet cable into the personal computer and the other end into the ethernet switch inside the panel. If there is no ethernet switch, connect directly to the Diesel Control Unit (DCU). See Figure 1.



Figure 1, Ethernet Cable Connection.

2. Go to the Marine panel and select the menu/home button on the DCU. Highlight the Settings button and press the 'Ok' button. See Figure 2.



Figure 2, DCU Menu Screen.

3. Find and highlight the 'Connect to a PC' button (this will possibly be on the next page) and press 'Ok' button. See Figure 3.



Figure 3, DCU Settings Screen.

4. The IP address will then be displayed. Record the IP address for reference. See Figure 4.

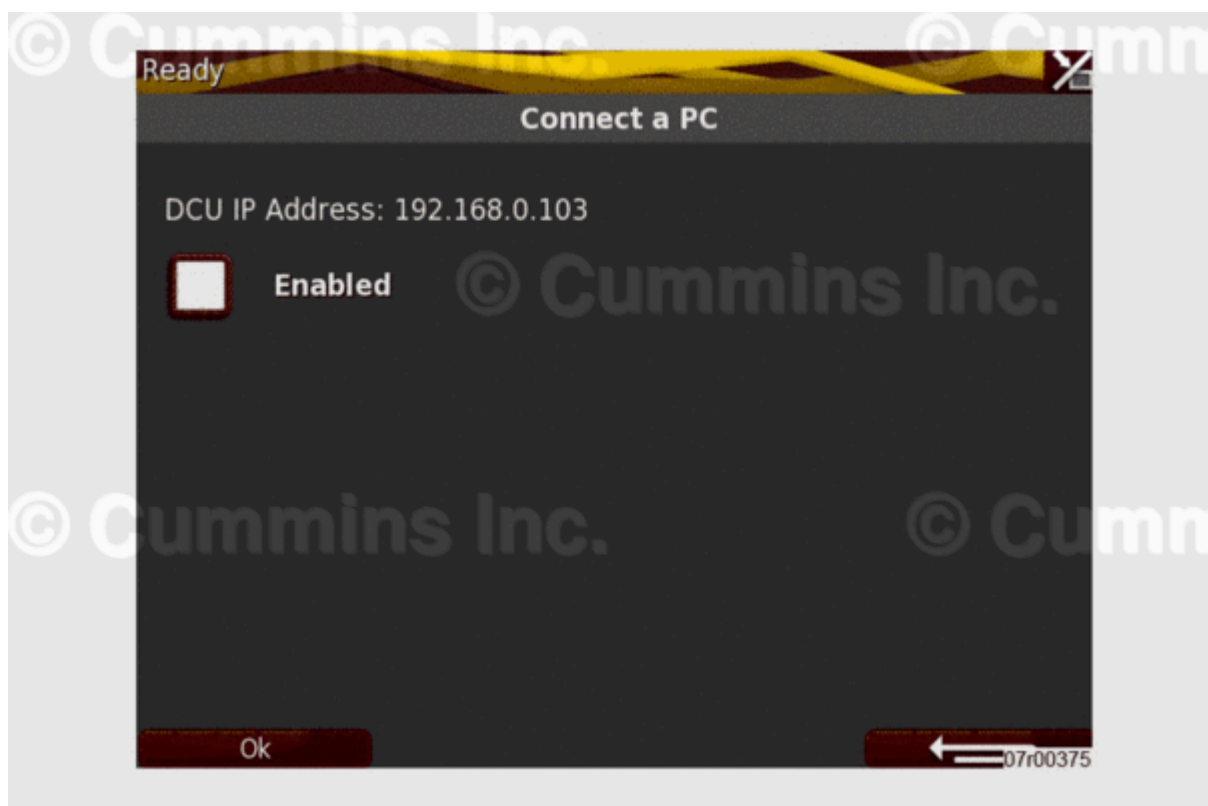


Figure 4, DCU IP Address Screen.

5. Select the 'Down' arrow button and the soft buttons on the bottom of the screen will change. A 'Toggle' button will appear. Select the soft button below the 'Toggle' button and a check mark will appear in the 'Enabled' box. See Figure 5. Then select the 'Ok' button.

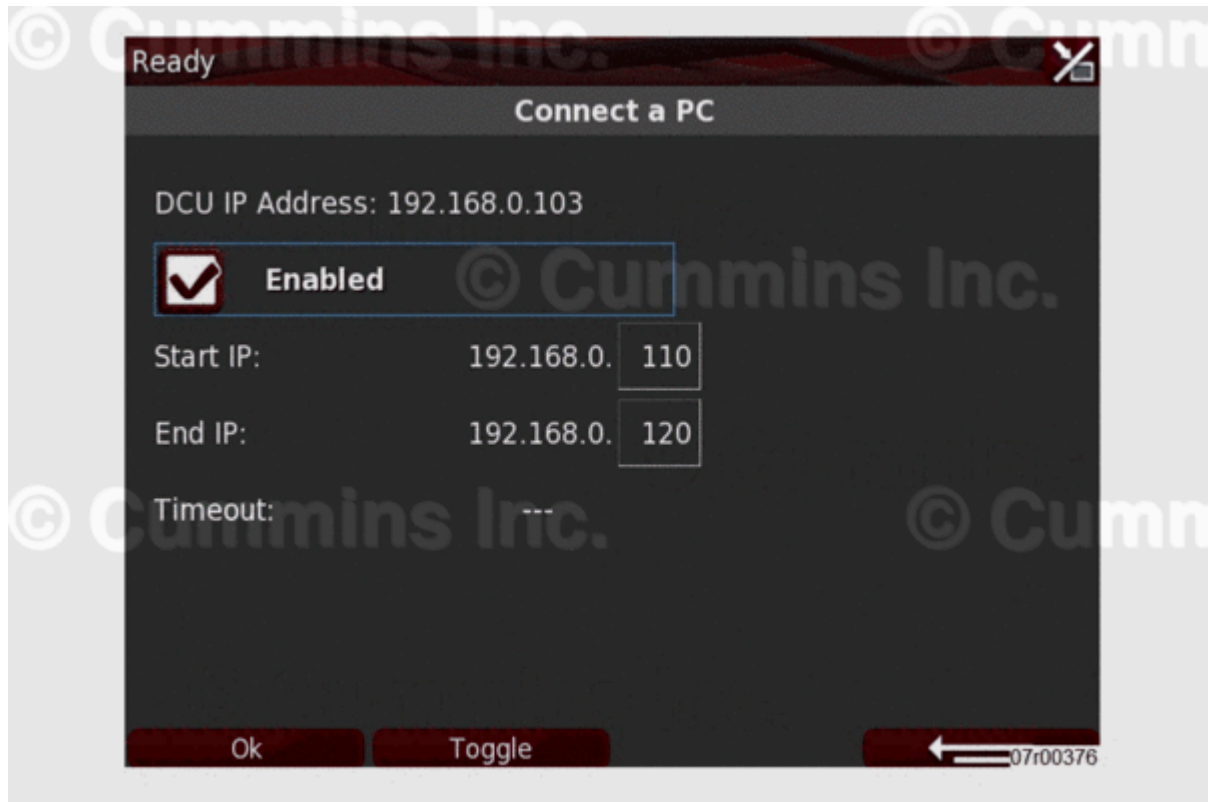


Figure 5, DCU IP Address Screen with Toggle Selection and Checked 'Enabled' Box.

6. Open the internet browser on the computer and connect to the IP address of the DCU noted in Step 3 by typing the IP address in the address bar. See Figure 6. Disconnecting from the Wi-Fi may help to verify that the connection to the DCU is the **only** connected network.



Figure 6, Web Browser Configuration Tool.

7. Select 'DCU' on the home screen at the top of the list to the left. A log-in screen will appear. Leave the username blank and enter '1234' for the password.
8. DCU is now connected using the web configuration tool. Select the 'dcu' tab, then select 'I/O Configuration.' See Figure 7.



Figure 7, DCU Screen.

9. In the 'I/O Configuration' menu, select the 'Differential' input under 'Config Inputs.' See Figure 8.



Figure 8, I/O Configuration Screen.

10. If the customer has a QSK38 or QSK50 engine, select 'Diff Signal #2.' If the customer has a QSK60 engine, select 'Diff Signal #3.' See Figure 9.



Figure 9, Engine-Specific Differential Signal Selection.

11. This step is the same for both Diff Signal #2 and #3. From the configuration screen, set the 'Signal Use' drop down menu to 'Not in use.' Scroll down and click 'Submit.' See Figure 10 and 11.

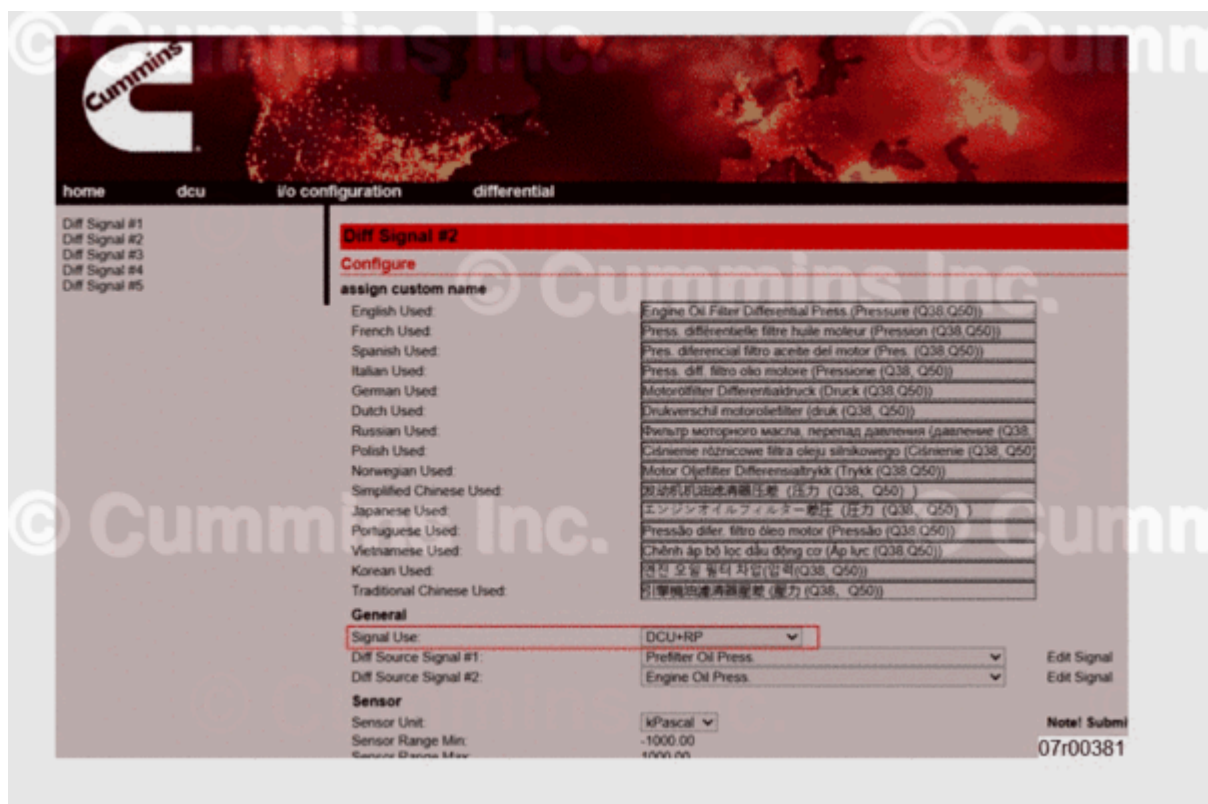


Figure 10, Diff Signal #2/#3 Screen.



Figure 11, Diff Signal #2/#3 Drop Down Menu.

For new engines built from August 2019, the correct filter type will be selected automatically, and no further action is needed. For engines currently in the field, the default lubricating oil filter selection setting is spin-on filters; therefore, an update may be needed. Using the INSITE™ electronic service tool, one can select between the two types of lubricating oil filters at any time.

Changing the lubricating oil filter type selection using INSITE™ Electronic Service Tool.

1. Go to "Features and Parameters", "Oil Filter Type", and select the lubricating oil filter type that is installed on the engine. See Figures 12 and 13 below.

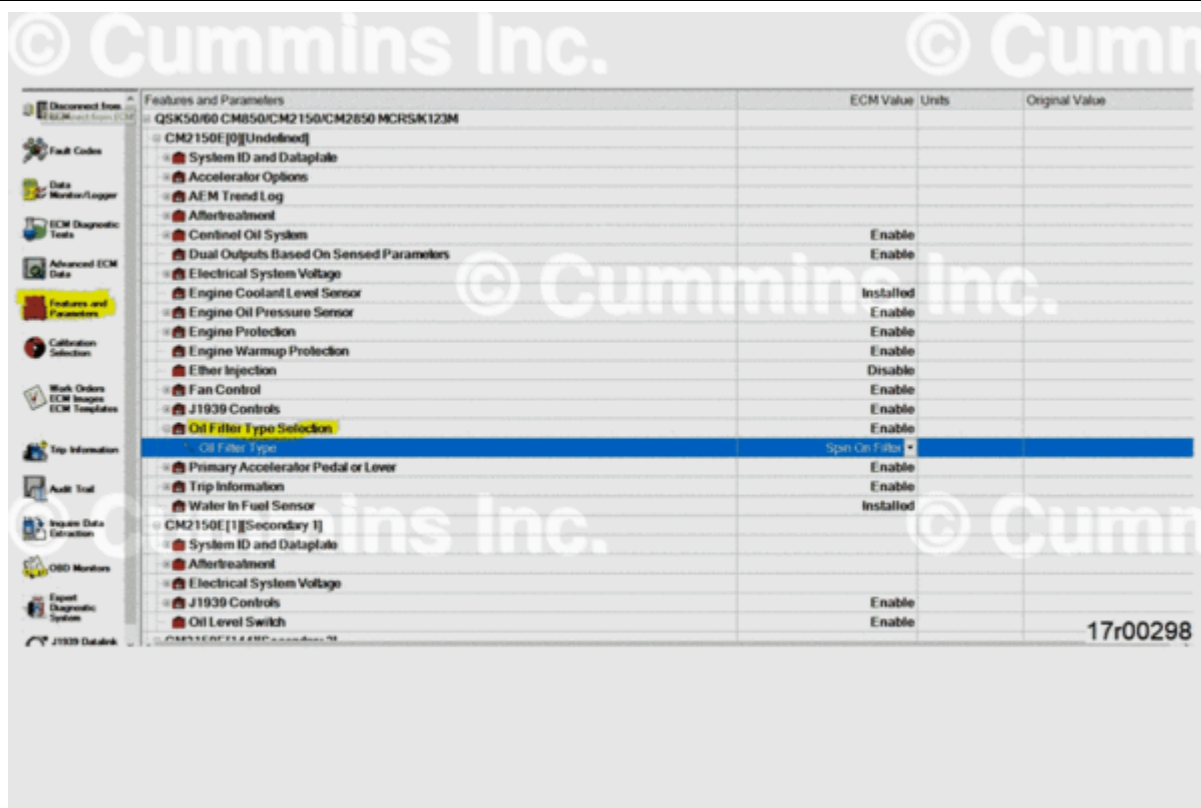


Figure 12, Lubricating Oil Filter Type Navigation.

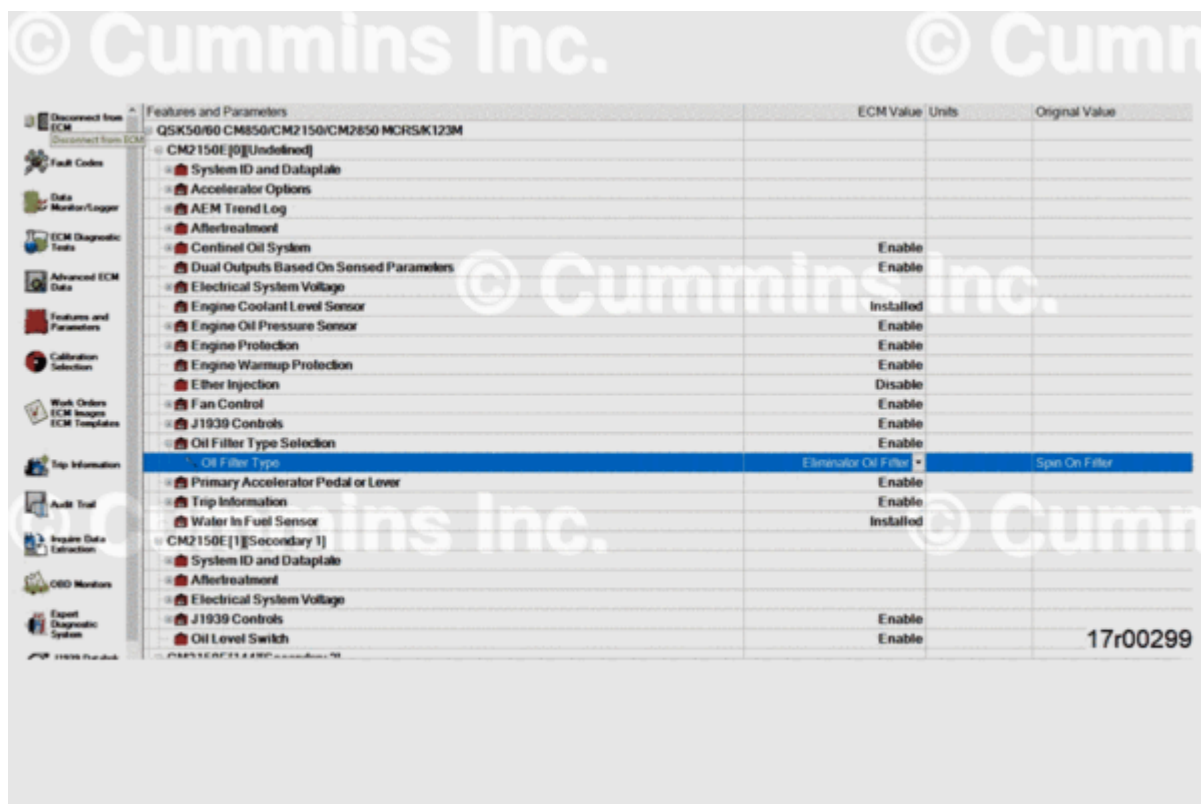


Figure 13, Select Appropriate Lubricating Oil Filter Type.

2. Right click and select "Send To", "ECM" and select "OK". See Figure 14 below.

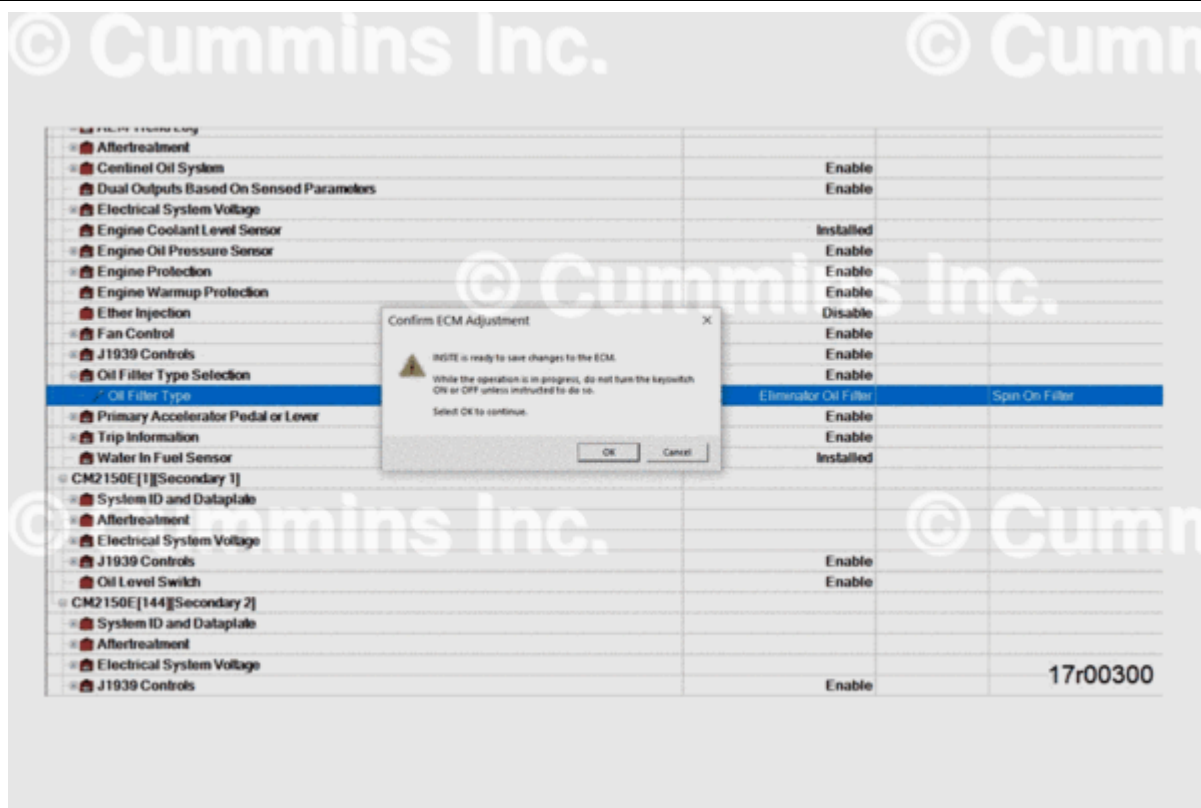


Figure 14, Confirm ECM Adjustment.

3. Turn key switch to OFF position and select "OK" See Figure 15 below.

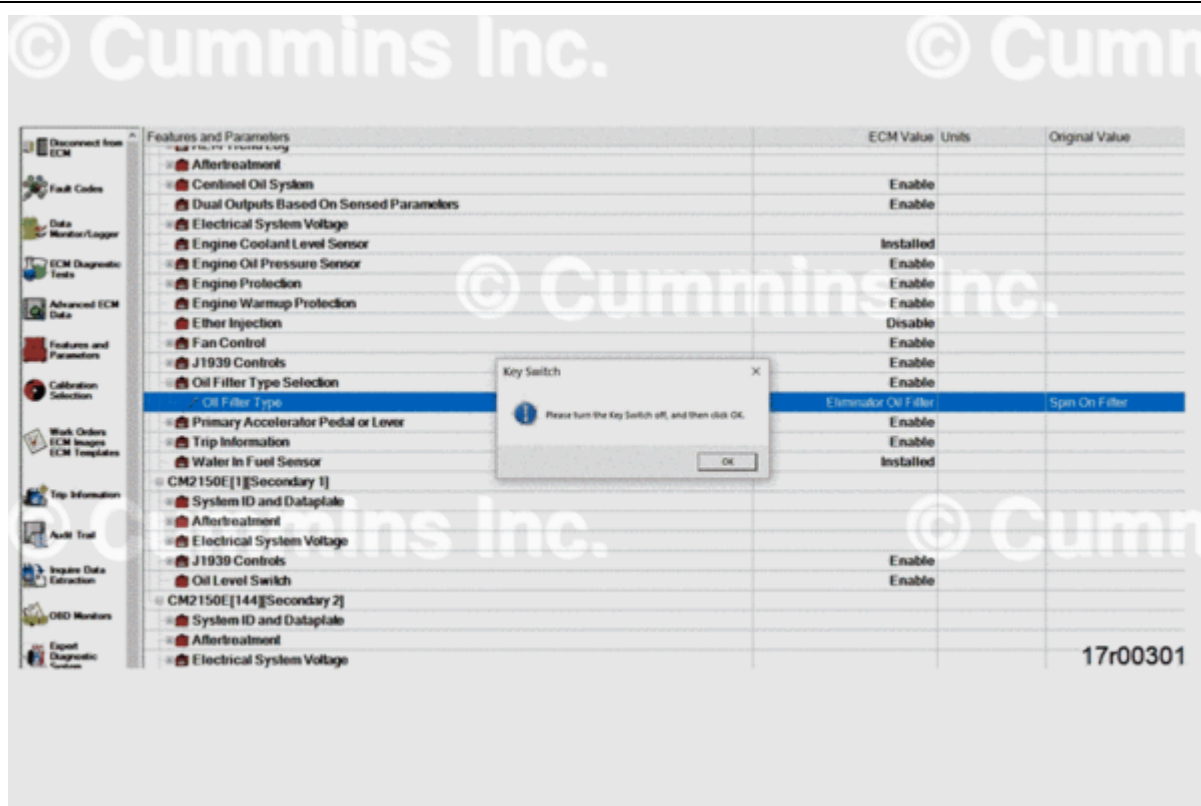


Figure 15, Key Switch Off.

4. Turn key switch to ON position and select "OK". See Figure 16 below.

Verify ECM compatibility. See Tables 1, 2, 3, 4, 5, 6, 7, and 8.

Table 1, QSK38 CM2150 MCRS ECM Codes

ECM CODE	SC OPTION	DO OPTION
AQ60215.22	SC6062200	DO0676600
AQ60268.13	SC6070400	DO0685000
AQ60269.14	SC6070500	DO0685100
AQ60282.14	SC6081500	DO0696800
AQ60283.10	SC6081600	DO0696900
AQ60284.13	SC6081700	DO0697000
AQ60300.15	SC6083200	DO0698700
AQ60319.18	SC6084100	DO0699600
AQ60339.16	SC6090600	DO6006300
AQ60340.17	SC6090700	DO6006400
AQ60351.13	SC6094500	DO6010500
AQ60393.13	SC6095000	DO6011000
AQ60396.12	SC6099800	DO6015900
AQ60408.11	SC6094700	DO6010700
AQ60409.11	SC6094900	DO6010900
AQ60430.10	SC6094800	DO6010800
AQ60434.13	SC6105700	DO6021600
AQ60435.14	SC6107500	DO6023500
AQ60436.13	SC6107700	DO6023700
AQ60437.14	SC6107800	DO6023800
AQ60459.13	SC6121100	DO6037200
AQ60474.10	SC6120600	DO6036700
AQ60478.10	SC6122000	DO6038100
AQ60505.14	SC6083100	DO0698400
AQ60713.10	SC6159100	DO6075600
AQ60714.10	SC6159200	DO6075700
AQ60722.09	SC6159700	DO6076500
AQ60723.08	SC6161900	DO6078200
AQ60736.08	SC6157200	DO6073400
AQ60737.08	SC6155100	DO6071200
AQ60782.03	SC6180000	DO6096600
AQ60783.03	SC6180100	DO6096700
AQ60784.03	SC6180200	DO6096800
AQ60802.02	SC6166900	DO6083200

Table 1, QSK38 CM2150 MCRS ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60878.01	SC6199100	DO6115700

Table 2, QSK38 CM2150 Marine Parent ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60472.09	SC6106400	DO6009400
AQ60522.08	SC6130300	DO6046300
AQ60523.07	SC6130400	DO6046400
AQ60524.08	SC6130500	DO6046500
AQ60535.07	SC6132700	DO6048800
AQ60705.04	SC6156500	DO6072700
AQ60706.04	SC6156600	DO6072800
AQ60707.04	SC6156700	DO6072900
AQ60718.04	SC6159800	DO6076200
AQ60719.04	SC6159900	DO6076300
AQ60720.04	SC6160000	DO6076400
AQ60721.06	SC6160300	DO6076600
AQ60956.02	SC6209000	DO6125800
AQ60975.02	SC6209800	DO6126700
AQ60976.01	SC6210200	DO6127100
AQ60977.01	SC6210300	DO6127200
AQ60978.02	SC6210600	DO6127500
AQ61055.01	SC6234300	DO6151100
AQ60536.06	SC6132900	DO6049000
AQ60708.04	SC6156800	DO6073000
AQ60709.04	SC6156900	DO6073100
AQ60969.02	SC6210400	DO6127300

Table 3, QSK38 CM2150 Marine Child ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AR60374.09	SC6106400	DO6009400
AR60389.08	SC6130300	DO6046300
AR60390.07	SC6130400	DO6046400
AR60391.07	SC6130500	DO6046500
AR60403.07	SC6132700	DO6048800

Table 3, QSK38 CM2150 Marine Child ECM Codes

ECM CODE	SC OPTION	DO OPTION
AR60501.05	SC6156500	DO6072700
AR60502.05	SC6156600	DO6072800
AR60503.05	SC6156700	DO6072900
AR60506.04	SC6159800	DO6076200
AR60507.04	SC6159900	DO6076300
AR60508.04	SC6160000	DO6076400
AR60509.04	SC6160300	DO6076600
AR60648.01	SC6209000	DO6125800
AR60650.01	SC6209800	DO6126700
AR60651.01	SC6210200	DO6127100
AR60652.01	SC6210300	DO6127200
AR60653.01	SC6210600	DO6127500
AR60707.01	SC6234300	DO6151100
AR60404.07	SC6132900	DO6049000
AR60504.05	SC6156800	DO6073000
AR60505.05	SC6156900	DO6073100
AR60649.01	SC6210400	DO6127300

Table 4, QSK50/60 CM2150 MCRS ECM Codes

ECM CODE	SC OPTION	DO OPTION
AQ60217.25	SC6062100	DO0676500
AQ60218.23	SC6062000	DO0676400
AQ60220.23	SC6062300	DO0676700
AQ60221.21	SC6064800	DO0679200
AQ60236.20	SC6065900	DO0680300
AQ60237.21	SC6066000	DO0680400
AQ60238.21	SC6069300	DO0683900
AQ60252.18	SC6077600	DO0692800
AQ60253.21	SC6077700	DO0692900
AQ60254.25	SC6078100	DO0693300
AQ60255.15	SC6077900	DO0693100
AQ60285.13	SC6078000	DO0693200
AQ60287.17	SC6070700	DO0685300
AQ60288.17	SC6072000	DO0686600

Table 4, QSK50/60 CM2150 MCRS ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60289.20	SC6072500	DO0687100
AQ60292.15	SC6082400	DO0697700
AQ60293.14	SC6082500	DO0697800
AQ60294.15	SC6082600	DO0697900
AQ60295.13	SC6082200	DO0697500
AQ60296.16	SC6082300	DO0697600
AQ60297.14	SC6082700	DO0698000
AQ60301.17	SC6083300	DO0698800
AQ60302.16	SC6072200	DO0686800
AQ60303.22	SC6072600	DO0687200
AQ60304.19	SC6083400	DO0698900
AQ60305.21	SC6072300	DO0686900
AQ60309.18	SC6082800	DO0698100
AQ60310.18	SC6082900	DO0698200
AQ60312.15	SC6084700	DO6000300
AQ60313.14	SC6084800	DO6000400
AQ60314.17	SC6084600	DO6000200
AQ60315.15	SC6084900	DO6000500
AQ60316.16	SC6085000	DO6000600
AQ60317.17	SC6070600	DO0685200
AQ60318.13	SC6084200	DO0699700
AQ60320.16	SC6086100	DO6001800
AQ60325.15	SC6088000	DO6003700
AQ60326.19	SC6086300	DO6002000
AQ60327.20	SC6086400	DO6002100
AQ60328.22	SC6086500	DO6002200
AQ60329.19	SC6086600	DO6002300
AQ60330.17	SC6086700	DO6002400
AQ60331.15	SC6088200	DO6003900
AQ60335.15	SC6089100	DO6004800
AQ60337.16	SC6072100	DO0686700
AQ60338.20	SC6092400	DO6008100
AQ60341.20	SC6088300	DO6004000
AQ60342.16	SC6088500	DO6004200
AQ60343.16	SC6091100	DO6006800

Table 4, QSK50/60 CM2150 MCRS ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60344.14	SC6091200	DO6006900
AQ60345.14	SC6091300	DO6007000
AQ60352.15	SC6095100	DO6011100
AQ60359.19	SC6085300	DO6001000
AQ60360.17	SC6085400	DO6001100
AQ60361.17	SC6085500	DO6001200
AQ60362.20	SC6085600	DO6001300
AQ60363.19	SC6093600	DO6009600
AQ60364.17	SC6093700	DO6009700
AQ60365.18	SC6093800	DO6009800
AQ60366.17	SC6093900	DO6009900
AQ60367.17	SC6096200	DO6012300
AQ60368.17	SC6096300	DO6012400
AQ60369.17	SC6096400	DO6012500
AQ60370.17	SC6096500	DO6012600
AQ60371.17	SC6096600	DO6012700
AQ60373.19	SC6095700	DO6011800
AQ60374.18	SC6095800	DO6011900
AQ60375.19	SC6095900	DO6012000
AQ60376.16	SC6096000	DO6012100
AQ60377.18	SC6096100	DO6012200
AQ60378.18	SC6094000	DO6010000
AQ60379.18	SC6094100	DO6010100
AQ60380.17	SC6094200	DO6010200
AQ60381.17	SC6094400	DO6010400
AQ60386.19	SC6094300	DO6010300
AQ60387.20	SC6096700	DO6012800
AQ60388.19	SC6096800	DO6012900
AQ60389.17	SC6096900	DO6013000
AQ60390.17	SC6097000	DO6013100
AQ60391.19	SC6097200	DO6013300
AQ60392.15	SC6097300	DO6013400
AQ60395.18	SC6097100	DO6013200
AQ60397.17	SC6099600	DO6015700
AQ60398.18	SC6098600	DO6014700

Table 4, QSK50/60 CM2150 MCRS ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60399.20	SC6098700	DO6014800
AQ60401.17	SC6088100	DO6003800
AQ60402.17	SC6097400	DO6013500
AQ60404.18	SC6099300	DO6015400
AQ60410.16	SC6101300	DO6017300
AQ60412.11	SC6101400	DO6017400
AQ60413.12	SC6101500	DO6017500
AQ60415.12	SC6103900	DO6019800
AQ60416.14	SC6103500	DO6019500
AQ60417.15	SC6104300	DO6020200
AQ60420.13	SC6104500	DO6020400
AQ60421.15	SC6072400	DO0687000
AQ60429.15	SC6086900	DO6002600
AQ60431.14	SC6104400	DO6020300
AQ60433.12	SC6104000	DO6019900
AQ60440.16	SC6105500	DO6021300
AQ60441.16	SC6103100	DO6019100
AQ60442.14	SC6103700	DO6019700
AQ60443.19	SC6104600	DO6020500
AQ60444.15	SC6105600	DO6021500
AQ60445.14	SC6107600	DO6023600
AQ60446.17	SC6107300	DO6023300
AQ60451.12	SC6086800	DO6002500
AQ60453.17	SC6120700	DO6036800
AQ60454.17	SC6120800	DO6036900
AQ60455.17	SC6120900	DO6037000
AQ60456.15	SC6121400	DO6037500
AQ60458.13	SC6121000	DO6037100
AQ60463.14	SC6106900	DO6022800
AQ60464.15	SC6107000	DO6022900
AQ60475.15	SC6121600	DO6037700
AQ60476.14	SC6122200	DO6038300
AQ60477.11	SC6122400	DO6038500
AQ60479.14	SC6124400	DO6040500
AQ60480.13	SC6124500	DO6040600

Table 4, QSK50/60 CM2150 MCRS ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60481.14	SC6124600	DO6040700
AQ60482.12	SC6125400	DO6022700
AQ60484.12	SC6125900	DO6041800
AQ60489.10	SC6125500	DO6023000
AQ60490.17	SC6124700	DO6040800
AQ60491.13	SC6124800	DO6040900
AQ60492.13	SC6124900	DO6041000
AQ60493.14	SC6125000	DO6041100
AQ60498.14	SC6128600	DO6044500
AQ60499.14	SC6128400	DO6044300
AQ60500.14	SC6128700	DO6044600
AQ60501.12	SC6127200	DO6043100
AQ60502.11	SC6127300	DO6043200
AQ60503.11	SC6127400	DO6043300
AQ60504.12	SC6128800	DO6044700
AQ60506.11	SC6126800	DO6042700
AQ60507.11	SC6126900	DO6042800
AQ60508.12	SC6127000	DO6042900
AQ60509.14	SC6126400	DO6042300
AQ60510.11	SC6126500	DO6042400
AQ60511.14	SC6126600	DO6042500
AQ60512.13	SC6126700	DO6042600
AQ60528.10	SC6131500	DO6047500
AQ60530.11	SC6131800	DO6047800
AQ60531.11	SC6131900	DO6047900
AQ60534.08	SC6132300	DO6084300
AQ60677.11	SC6151600	DO6067700
AQ60690.09	SC6146800	DO6062900
AQ60691.12	SC6155000	DO6071100
AQ60694.10	SC6148500	DO6064600
AQ60695.10	SC6157500	DO6073700
AQ60696.10	SC6157700	DO6073900
AQ60700.12	SC6157900	DO6074100
AQ60701.10	SC6158500	DO6074700
AQ60716.09	SC6159600	DO6076100

Table 4, QSK50/60 CM2150 MCRS ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60717.09	SC6159500	DO6076000
AQ60724.09	SC6161200	DO6077500
AQ60748.06	SC6166400	DO6082700
AQ60749.07	SC6166500	DO6082800
AQ60750.12	SC6167300	DO6083600
AQ60751.07	SC6168200	DO6084900
AQ60759.07	SC6151400	DO6088400
AQ60761.09	SC6171000	DO6087600
AQ60762.07	SC6171100	DO6087700
AQ60763.07	SC6171200	DO6087800
AQ60769.07	SC6177400	DO6094000
AQ60770.05	SC6177300	DO6093900
AQ60773.05	SC6178300	DO6094900
AQ60775.05	SC6180300	DO6096900
AQ60776.05	SC6180400	DO6097000
AQ60777.03	SC6180500	DO6097100
AQ60778.04	SC6180600	DO6097200
AQ60779.04	SC6180700	DO6097300
AQ60780.04	SC6180800	DO6097400
AQ60781.03	SC6180900	DO6097500
AQ60785.04	SC6181300	DO6097900
AQ60786.04	SC6181400	DO6098000
AQ60789.03	SC6179400	DO6096000
AQ60790.03	SC6179600	DO6096200
AQ60791.03	SC6181900	DO6098500
AQ60792.03	SC6179500	DO6096100
AQ60793.03	SC6127900	DO6043800
AQ60796.04	SC6184400	DO6101000
AQ60799.02	SC6184800	DO6101400
AQ60800.04	SC6181000	DO6097600
AQ60801.03	SC6176400	DO6093000
AQ60804.03	SC6176500	DO6093100
AQ60805.04	SC6168700	DO6084800
AQ60807.04	SC6186400	DO6102800
AQ60808.02	SC6185800	DO6102500

Table 4, QSK50/60 CM2150 MCRS ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60809.04	SC6187800	DO6104200
AQ60811.04	SC6186000	DO6102600
AQ60824.03	SC6189300	DO6105900
AQ60825.03	SC6190000	DO6106600
AQ60874.01	SC6198100	DO6114700
AQ60876.01	SC6197800	DO6114400
AQ60877.01	SC6198900	DO6115500
AQ60879.01	SC6198000	DO6114600
AQ60880.01	SC6198700	DO6115200
AQ60881.01	SC6191300	DO6107900
AQ60882.01	SC6192900	DO6109500
AQ60883.01	SC6198500	DO6116000
AQ60884.01	SC6199300	DO6115900
AQ60886.01	SC6199900	DO6116600
AQ60888.01	SC6192800	DO6109400
AQ60889.01	SC6191800	DO6108400
AQ60890.01	SC6199800	DO6116500
AQ60891.01	SC6201900	DO6117800
AQ60892.01	SC6200600	DO6118000

Table 5, QSK60 CM2150 Marine Parent ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60274.11	SC6067700	DO0681900
AQ60275.11	SC6067800	DO0682000
AQ60276.11	SC6067900	DO0682100
AQ60278.11	SC6068100	DO0682300
AQ60279.11	SC6068200	DO0682400
AQ60465.08	SC6105800	DO6021700
AQ60466.08	SC6105900	DO6021800
AQ60467.08	SC6106000	DO6021900
AQ60469.08	SC6106600	DO6022400
AQ60517.07	SC6123100	DO6039200
AQ60817.06	SC6172500	DO6089100
AQ60818.05	SC6172600	DO6089200
AQ60822.04	SC6188400	DO6104800

Table 5, QSK60 CM2150 Marine Parent ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AQ60823.04	SC6188500	DO6104900
AQ60827.05	SC6188900	DO6105300
AQ60828.05	SC6189000	DO6105400
AQ60875.04	SC6195500	DO6112100
AQ61029.02	SC6224200	DO6141200
AQ60256.09	SC6068300	DO0682500
AQ60257.10	SC6068400	DO0682600
AQ60468.07	SC6106100	DO0602200
AQ60760.04	SC6165500	DO6081800
AQ60814.03	SC6172300	DO6088900
AQ60816.03	SC6172400	DO6089000
AQ60820.05	SC6188700	DO6105100
AQ60821.05	SC6188800	DO6105200
AQ60829.05	SC6189100	DO6105500
AQ60830.05	SC6189200	DO6105600
AQ60992.03	SC6213700	DO6131600
AQ61027.02	SC6223000	DO6139400
AQ61058.01	SC6233600	DO6150300

Table 6, QSK60 CM2150 Marine Child 1 ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AR60238.11	SC6067700	DO0681900
AR60240.11	SC6067800	DO0682000
AR60242.11	SC6067900	DO0682100
AR60246.11	SC6068100	DO0682300
AR60248.11	SC6068200	DO0682400
AR60364.08	SC6105800	DO6021700
AR60366.08	SC6105900	DO6021800
AR60368.08	SC6106000	DO6021900
AR60372.08	SC6123100	DO6039200
AR60383.07	SC6106600	DO6022400
AR60569.05	SC6172500	DO6089100
AR60571.05	SC6172600	DO6089200
AR60579.04	SC6188400	DO6104800
AR60581.04	SC6188500	DO6104900

Table 6, QSK60 CM2150 Marine Child 1 ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AR60585.05	SC6188900	DO6105300
AR60587.05	SC6189000	DO6105400
AR60597.04	SC6195500	DO6112100
AR60696.03	SC6224200	DO6141200
AR60223.10	SC6068300	DO0682500
AR60225.10	SC6068400	DO0682600
AR60370.08	SC6106100	DO0602200
AR60535.05	SC6165500	DO6081800
AR60565.04	SC6172300	DO6088900
AR60567.04	SC6172400	DO6089000
AR60575.06	SC6188700	DO6105100
AR60577.07	SC6188800	DO6105200
AR60589.06	SC6189100	DO6105500
AR60591.06	SC6189200	DO6105600
AR60666.03	SC6213700	DO6131600
AR60692.03	SC6223000	DO6139400
AR60708.02	SC6233600	DO6150300
Table 7, QSK60 CM2150 Marine Child 2 ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AR60239.11	SC6067700	DO0681900
AR60241.11	SC6067800	DO0682000
AR60243.12	SC6067900	DO0682100
AR60247.11	SC6068100	DO0682300
AR60249.11	SC6068200	DO0682400
AR60365.08	SC6105800	DO6021700
AR60367.08	SC6105900	DO6021800
AR60369.08	SC6106000	DO6021900
AR60373.08	SC6123100	DO6039200
AR60384.07	SC6106600	DO6022400
AR60570.05	SC6172500	DO6089100
AR60572.05	SC6172600	DO6089200
AR60580.04	SC6188400	DO6104800
AR60582.04	SC6188500	DO6104900
AR60586.05	SC6188900	DO6105300

Table 7, QSK60 CM2150 Marine Child 2 ECM Codes		
ECM CODE	SC OPTION	DO OPTION
AR60588.05	SC6189000	DO6105400
AR60598.04	SC6195500	DO6112100
AR60697.03	SC6224200	DO6141200
AR60224.10	SC6068300	DO0682500
AR60226.10	SC6068400	DO0682600
AR60371.08	SC6106100	DO0602200
AR60536.05	SC6165500	DO6081800
AR60566.04	SC6172300	DO6088900
AR60568.04	SC6172400	DO6089000
AR60576.06	SC6188700	DO6105100
AR60578.07	SC6188800	DO6105200
AR60590.05	SC6189100	DO6105500
AR60592.05	SC6189200	DO6105600
AR60667.03	SC6213700	DO6131600
AR60693.04	SC6223000	DO6139400
AR60709.02	SC6233600	DO6150300

Table 8, QSK45/60/78 HPI ECM Codes	
ECM CODE	SC OPTION
EP60001.08	EI0685500
EP60002.09	EI0686900
EP60003.08	EI0687000
EP60004.08	EI0687100
EP60005.08	EI0687200
EP60006.08	EI0687300
EP60007.08	EI0687400
EP60008.08	EI0687500
EP60009.08	EI0687600
EP60010.08	EI0687700
EP60011.08	EI0685700
EP60012.08	EI0685800
EP60013.09	EI0685900
EP60014.09	EI0686000
EP60015.11	EI0686100

Table 8, QSK45/60/78 HPI ECM Codes	
ECM CODE	SC OPTION
EP60016.09	EI0686200
EP60017.09	EI0686300
EP60018.09	EI0686400
EP60019.09	EI0686500
EP60020.08	EI0688000
EP60021.09	EI0688100
EP60022.08	EI0688200
EP60025.11	EI0686700
EP60026.08	EI0686800
EP60039.08	EI0690100
EP60041.08	EI0690300
EP60042.08	EI0690400
EP60043.08	EI0690500
EP60044.08	EI0690600
EP60045.07	EI0690700
EP60046.08	EI0691100
EP60048.07	EI0690900
EP60049.07	EI0691000
EP60053.04	EI0691900
EP60054.03	EI0686600
EP60055.03	EI0692500
EP60057.02	EI0692600
EP60058.00	EI0692700
EP60059.00	EI0692800
EP60060.00	EI0692900
EP60061.00	EI0693000
EP60062.00	EI0693100
EP60063.00	EI0693200
EP60064.00	EI0693300
EP60065.00	EI0693400
EP60066.00	EI0693500
EP60067.00	EI0693600
EP60068.00	EI0693700
EP60069.00	EI0693800
EP60070.00	EI0693900

Table 8, QSK45/60/78 HPI ECM Codes	
ECM CODE	SC OPTION
EP60071.00	EI0694000
EP60073.00	EI0694200
EP60074.00	EI0694300
EP60075.00	EI0694400

Document History

Date	Details
2019-5-17	Module Created
2019-6-5	Corrected images
2020-5-7	Non-Product Problem Solving (PPS)
2025-6-9	Updated Product Affected, Service Instruction, and ECM Compatibility.