



Technical Service Bulletin

Technical Service Bulletin: TSB120052

Released Date: 25-Jun-2012

New Low Pressure Fuel Lines for the QSK38 MCRS, QSK50 MCRS, and QSK60 MCRS Engines

New Low Pressure Fuel Lines for the QSK38 MCRS, QSK50 MCRS, and QSK60 MCRS Engines


Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document introduces new low pressure fuel lines for the QSK38 MCRS, QSK50 MCRS, and QSK60 MCRS engines with electronically actuated injectors. The new lines are more robust against electrostatic discharge, which has caused a pin hole in the braided section of the old lines, leading to a fuel drip. Cummins Inc. recommends replacing all of the lines, if any old low pressure fuel lines listed in the tables below, are leaking from the braided section.

Along with the material change on the QSK50 Gerotor Outlet to Stage 2 Filter Head line was a routing change. Previously this fuel supply line was routed behind the ECMs. The new part number fuel supply line is now shorter and routed in front of the ECMs. See the pictures below.

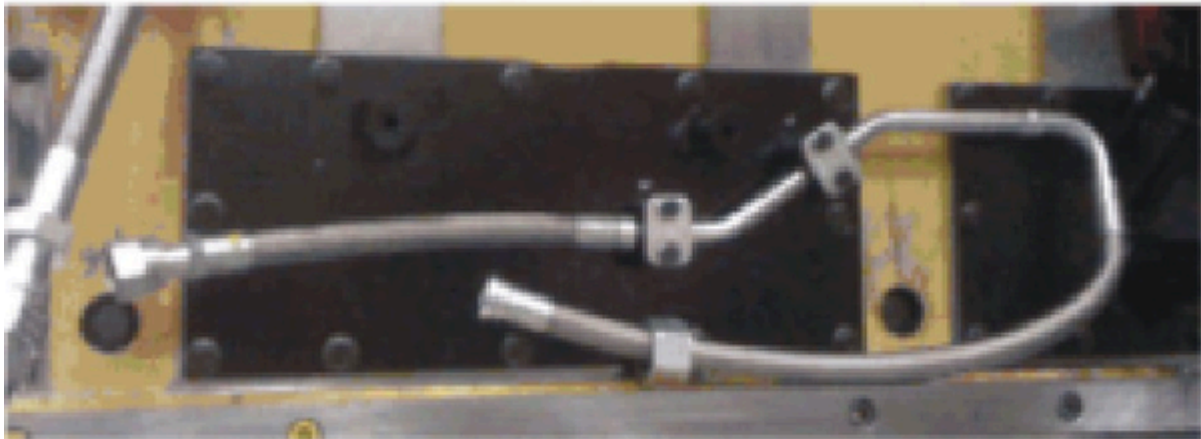


05e00148

Old Fuel Line




05e00150

New Fuel Line

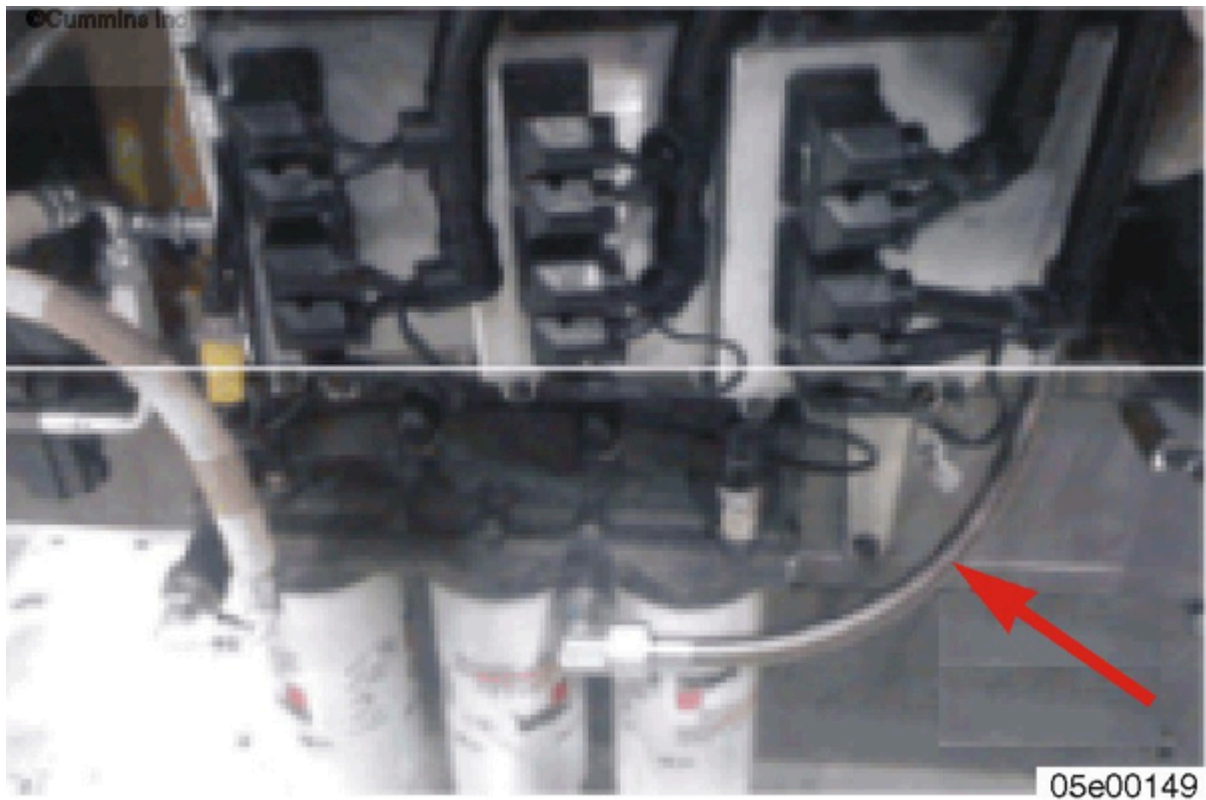

Old Installation

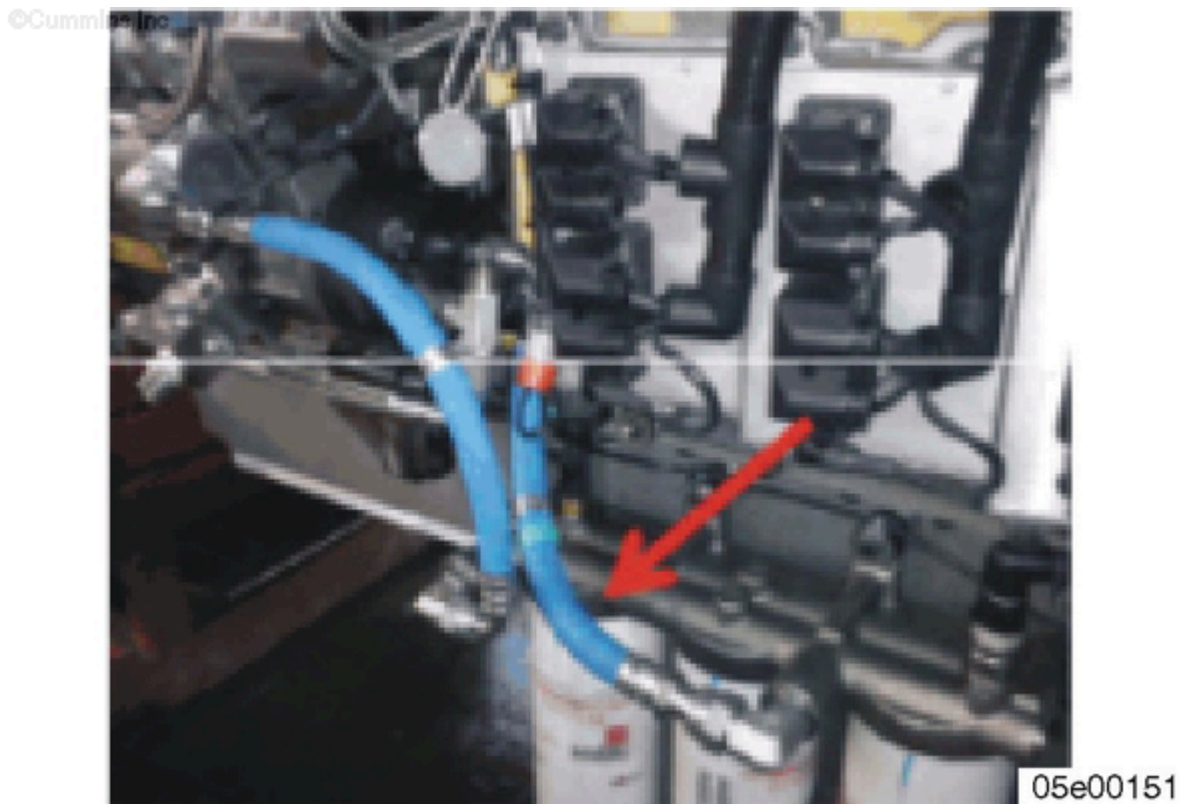

New Installation

QSK38 MCRS with Electronically Actuated Injectors

New Part Number	Old Part Number	Location Description	ESN First
2862797	4924664	MDV to Fuel Drain Block	33192055

QSK38 MCRS with Electronically Actuated Injectors

2862800	4928091	FPPA to Fuel Drain Block	33192055
2862846	4928090	Injector Drain from Cylinder Block to Fuel Drain Block	33192055
4970260	4969129	Fuel Supply Block to Gerotor Inlet	33192055
3646244	4964161	Gerotor Outlet to Stage 2 Filter Head	33192055
3646243	4964160	Stage 2 Filter Head to FPPA	33192055

QSK50 MCRS with Electronically Actuated Injectors

New Part Number	Old Part Number	Location Description	ESN First
2862797	4924664	MDV to Fuel Drain Block	33190519
2862800	4927608	FPPA to Fuel Drain Block	33190519
4970295	4924275	Injector Drain from Cylinder Block to Fuel Drain Block	33190519
4970261	4964155	Fuel Supply Block to Gerotor Inlet	33190519
3645962	4964148	Gerotor Outlet to Stage 2 Filter Head	33190519

QSK60 MCRS with Electronically Actuated Injectors

New Part Number	Old Part Number	Location Description	ESN First
4970292	4924792	MDV to Fuel Drain Block	33191928
3646242	4927530	FPPA to Fuel Drain Block	33191928
2866775	4924793	Injector Drain from Cylinder Block to Fuel Drain Block	33191928
4970261	4964155	Fuel Supply Block to Gerotor Inlet	33191928

QSK60 MCRS with Electronically Actuated Injectors			
3646241	4964156	State 2 Filter Head Out to FPPA	33191928
The ESN First listed in each table is the first engine which had all of the new part number lines installed.			

Document History

Date	Details
2012-2-20	Module Created
2012-6-18	Add note about fuel line routing change on QSK50