



Technical Service Bulletin

Technical Service Bulletin: TSB120240

Released Date: 11-Sep-2013

New Dual Impeller Water Pumps With Weep Hole Filter

New Dual Impeller Water Pumps With Weep Hole Filter

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document announces the release of new dual impeller water pumps for use on QSK38, QSK50, and QSK60 Modular Control Rail System (MCRS) engines.

The new water pumps incorporate a relocated and threaded weep hole to allow for the installation of a weep hole filter assembly. The filter has been added to prevent debris from entering the weep chamber, to increase the reliability of the pump. Refer to Figure 1 below for illustration of the new water pump with revised weep hole location and new weep hole filter installed.

Note : With the relocation of the weep hole on the new water pumps, an occasional coolant drip may be seen coming from the filter. This is normal and does not indicate a leaking pump.

With the release of the new dual impeller water pumps, new service kits are being released. Each kit contains a water pump, filter assembly and the gaskets and o-ring required for water pump replacement. Reference Table 1 for new and old water pump part numbers and new service kit part numbers.

The engine serial number (ESN) first for the new pumps being installed at the Daventry Engine Plant is: 33194784.

Table 1: Dual Impeller Water Pump Part Numbers

Engine Family (Application)	Part Description	New Part Number	Old Part Number	New Kit Part Number
QSK50 (Frac Rig Engines)	Pump Assembly	3648265	3643045	4309350
QSK50	Pump Assembly	3648269	3643046	4309351
QSK38	Pump Assembly	3648270	3643047	4309352

Table 1: Dual Impeller Water Pump Part Numbers

Engine Family (Application)	Part Description	New Part Number	Old Part Number	New Kit Part Number
QSK60 (Offshore Drill Rig)	Pump Assembly	3648275	3647077	2881852
QSK60	Pump Assembly	3648277	3647095	4309353

Weep Hole Filter Part Numbers

Description	Part Number
Tube Connector	3252438
Water Drain Tube (with filter)	3648346
Debris Shield (filter only)	3648319

For further information on removal and installation of the water pump and weep hole filter, reference Procedure 008-062 in the K38, K50, QSK38, and QSK50 Service Manual, Bulletin 4021528, or the QSK45 and QSK60 Service Manual, Bulletin 4021530.

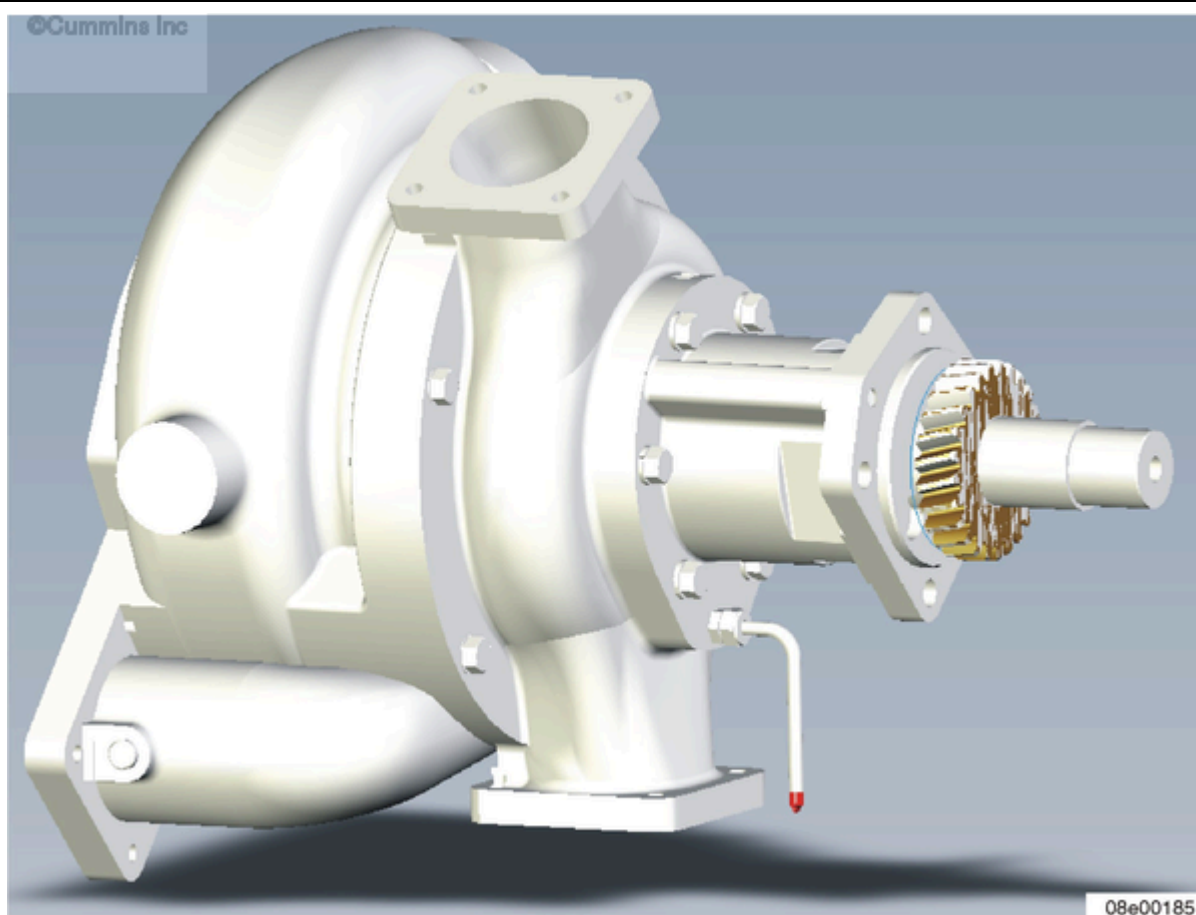


Figure 1, New water pump with weep hole relocated and filter installed.

Document History

Date	Details
2012-8-15	Module Created
2013-9-11	QSOL ticket 100418 for typo

Last Modified: 11-Sep-2013
