



Technical Service Bulletin

Technical Service Bulletin: TSB130063

Released Date: 13-Dec-2013

QST30 New Oil Suction Tube and Brackets

QST30 New Oil Suction Tube and Brackets

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This document introduces a new lubricating oil suction tube and brackets for QST30 rear deep sump applications; Option OP5137 **only**. The oil suction tube and brackets have been designed to reduce cracking of the oil suction tube, caused by vibration.

The new tube is made of a thicker material. In addition the pickup was moved forward over the previous design. The bracket design has changed from a single center-mount bracket, to a block-mounted bracket and a vertical bracket.

Engine Serial Number (ESN) First: 37257636

Date placed into production: 28-Mar-2013

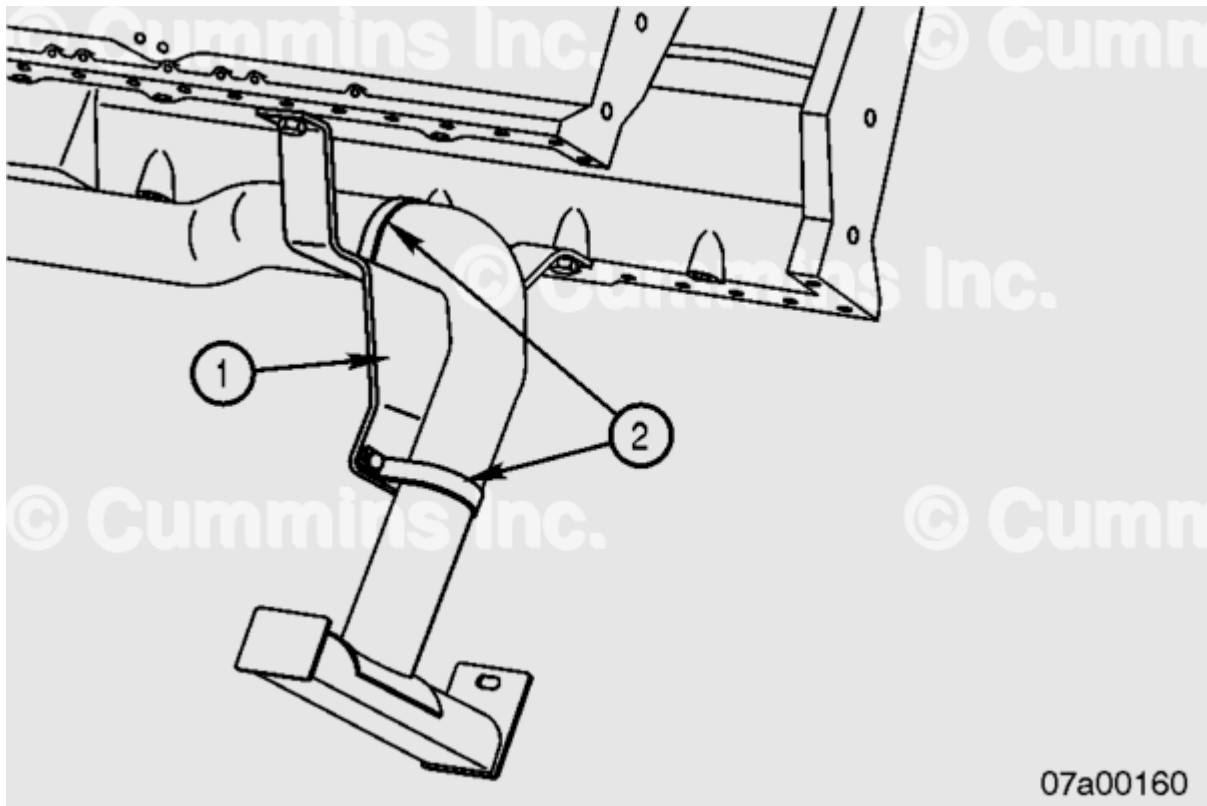


Figure 1: Obsolete Center-Mount Bracket (1) and Clamps (2)

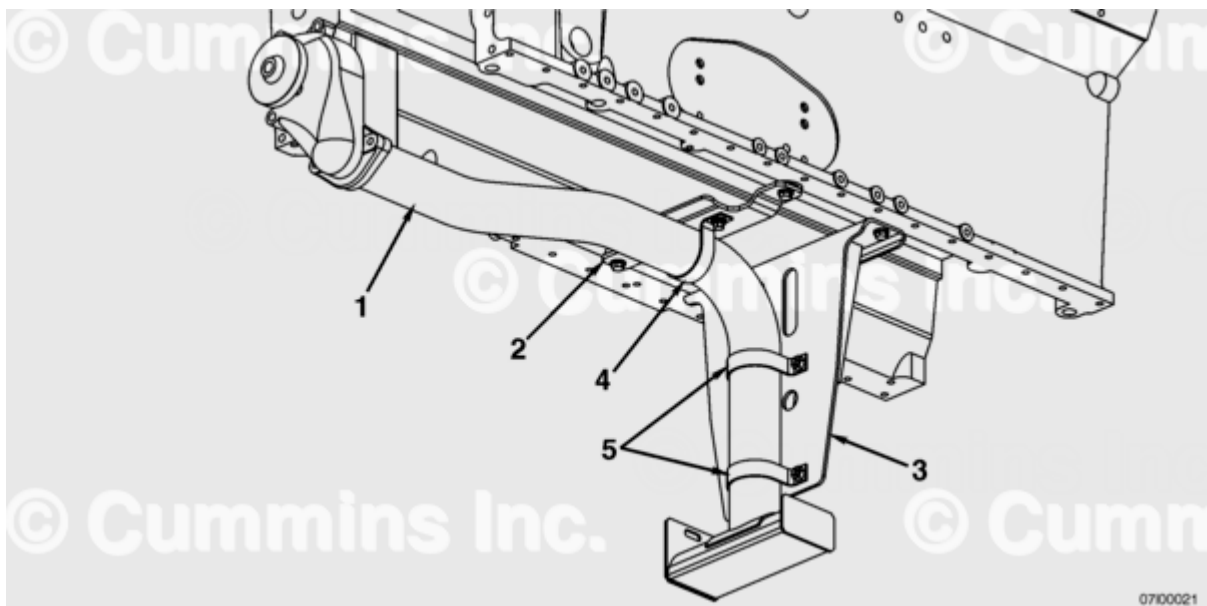


Figure 2: New Suction Tube (1), Block Bracket (2), Vertical Bracket (3), Block Bracket Tube Clamp (4), and Tube Clamp (5)

Table 1. Old and New QST30 Oil Suction Tube Part Numbers				
Part Name	Old Part Number	Quantity	New Part Number	Quantity
Lube oil suction tube	4975629	1	4308739	1
Center mount bracket	4975644	1	N/A	N/A
Hex head cap screw	3064111	2	N/A	N/A
Tube clamp	4975653	2	4975653	2
Block Hex head cap screw	3093743	2	3093743	4
Hex flange head cap screw	3093932	4	3093932	6
Block bracket	N/A	N/A	4308741	1
Vertical bracket	N/A	N/A	4308740	1
Block bracket tube clamp	N/A	N/A	4308810	1

Document History

Date	Details
2013-3-26	Module Created
2013-10-16	Incorrect Part Number Listed

Last Modified: 13-Dec-2013
