



Technical Service Bulletin: TSB200032

Released Date: 03-Mar-2020

Additional Pre-Lubrication Switch

Additional Pre-Lubrication Switch

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK50 CM850
- QSK50 CM2150

Description of Change

Engines had an additional pre-lubrication pressure switch intalled in fuel pump drive. The first engine serial number (ESN) to have these parts installed from Daventry plant is ESN 33216387. A service parts kit, Part Number 5579009, is available for service up-fit to help ensure proper fuel pump lubrication prior to start.

Reason for Change

The second oil pressure pre-lubrication switch confirms that there is a minimum of 4 psi at the fuel pump drive prior to the engine cranking.

Service Instructions

In order to up-fit the additional pre-lube oil pressure switch on engines in the field, an adapter must be installed into the new accessory drive support.

1. Refer to Procedure 009-011 in Section 9 (</qs3/pubsys2/xml/en/procedures/28/28-009-011.html>) to install the new fuel pump accessory drive support, Part Number 5376094. See Figure 1.
2. Connect the new pressure switch wire harness extension to the main engine harness. See Figure 2.
3. Connect existing oil pressure switch plug. See Figure 3.
4. Route wire harness behind breather box (Figure 4) and behind fuel block (Figure 5).
5. Use provided capscrews to loosely secure harness as shown. See Figure 6.
6. Install oil pressure switch into drive and connect to wire harness. See Figure 7.
7. Torque harness mounting capscrews to block (45 Nm [33 ft-lb]). Use provided wire tie clamps to secure wire harness to adjacent components. See Figure 6.

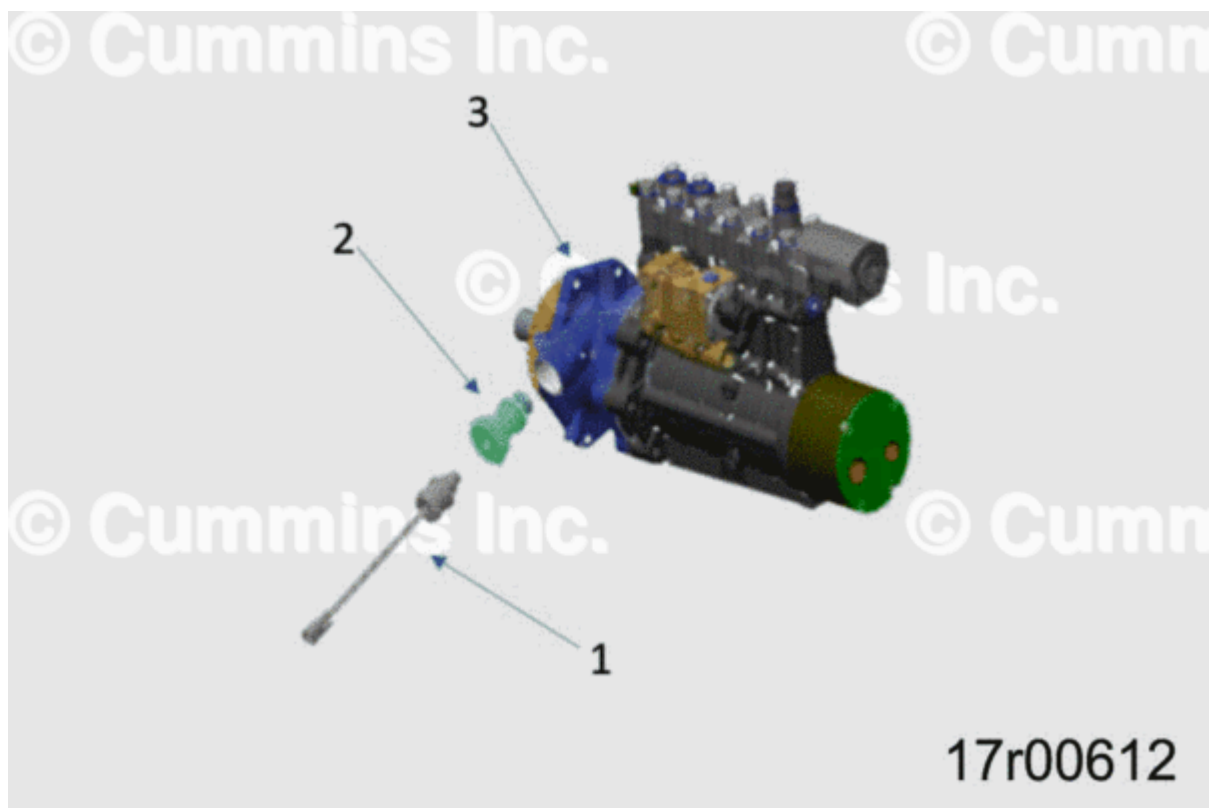


Figure 1, Fuel Pump Drive


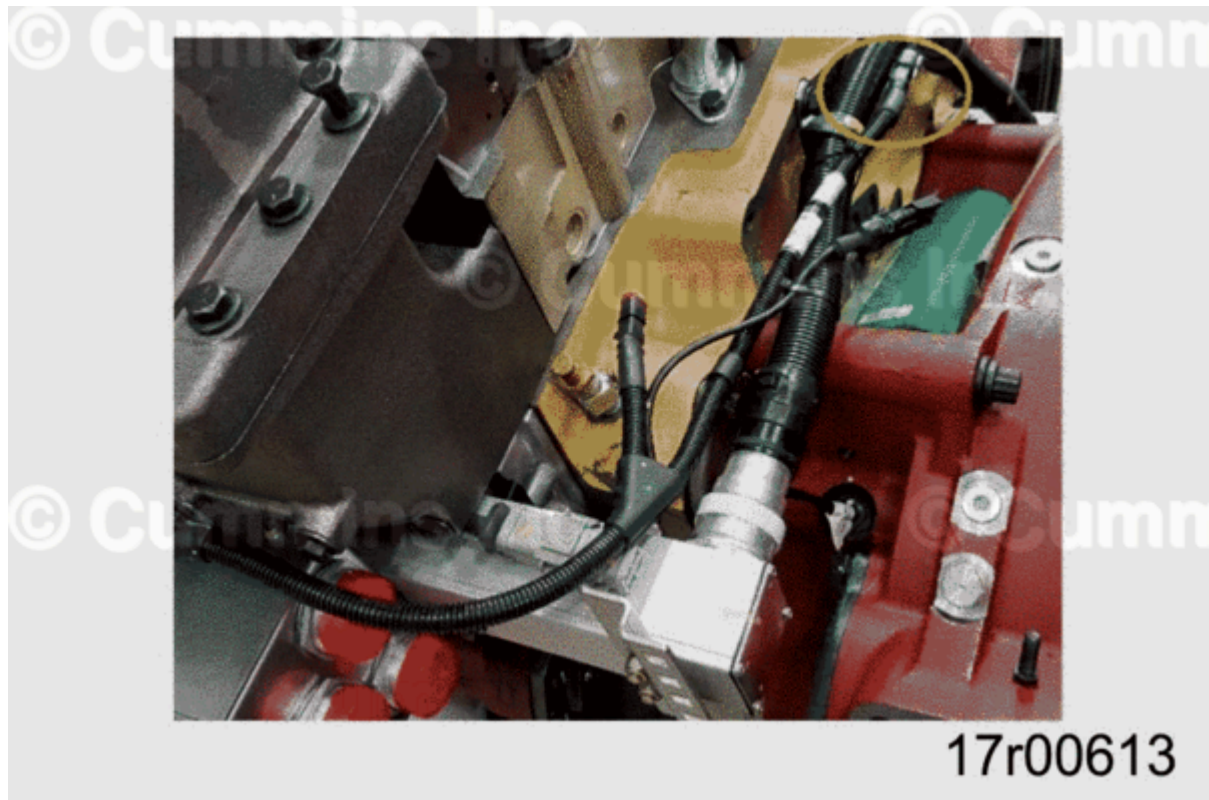


Figure 2, Pressure Switch Wire Harness Extension

© Cummins Inc.

© Cumn

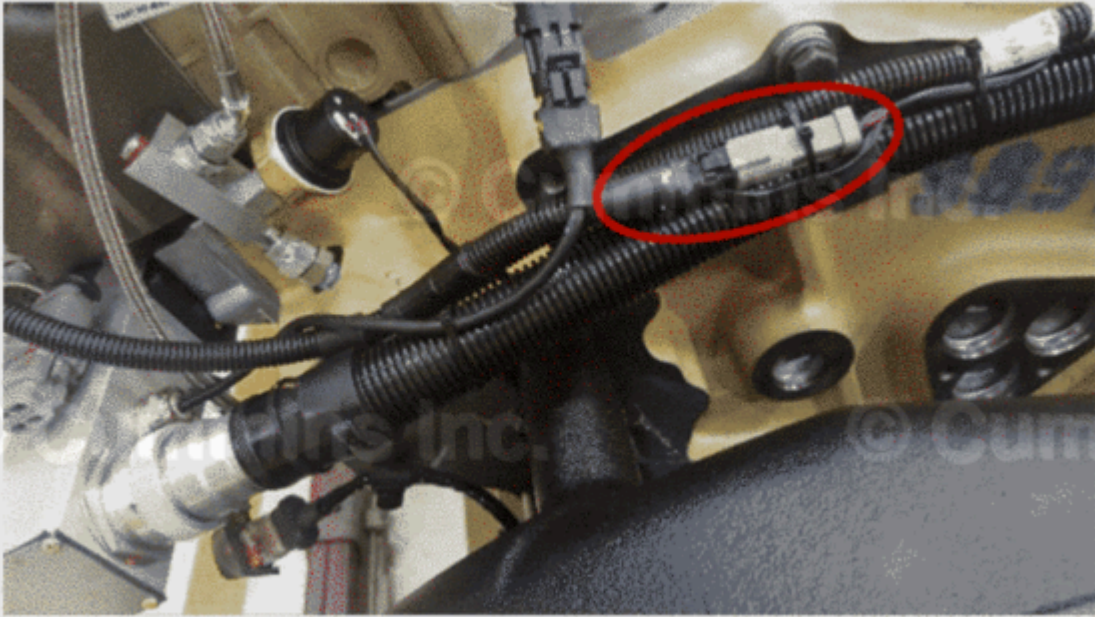


17r00614

Figure 3, Existing Oil Pressure Switch Plug Connection

© Cummins Inc.

© Cumn

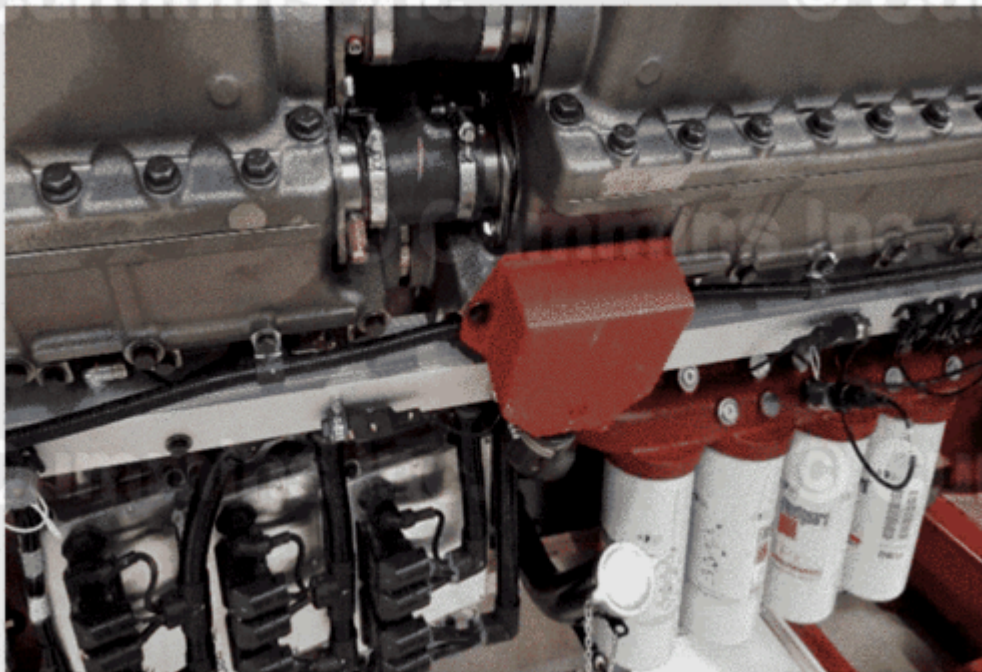

17r00615

Figure 4, Wire Harness Behind Breather Box



Figure 5, Wire Harness Behind Fuel Block

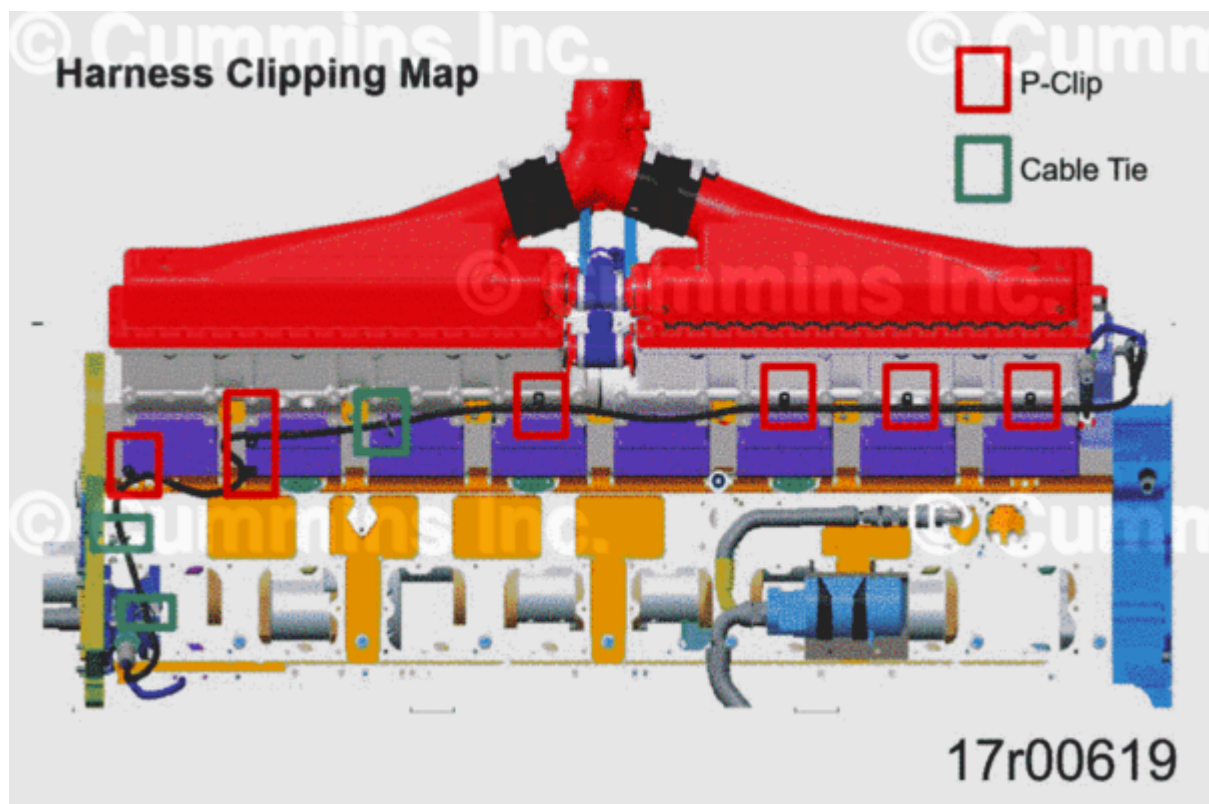


Figure 6, Secure Wire Harness

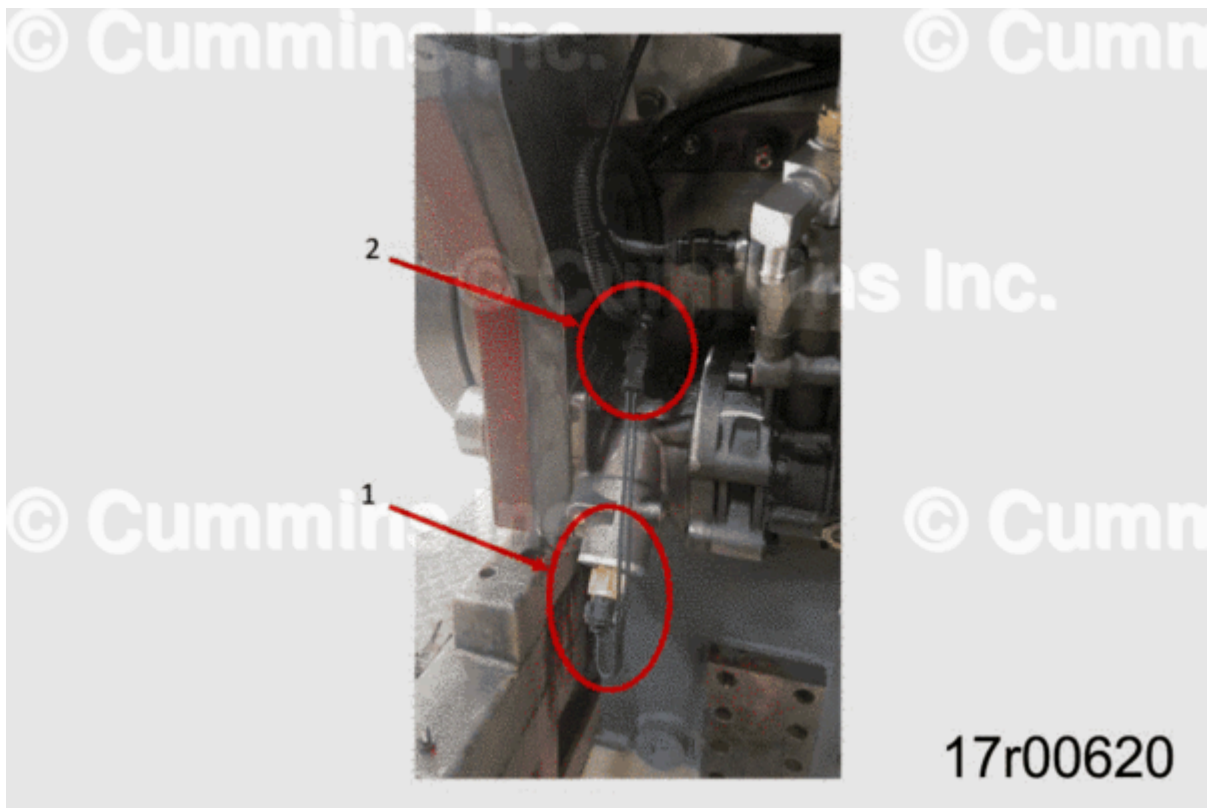


Figure 7, Oil Pressure Switch Connection

Table 1, Service Parts

Part Description	Quantity	Obsolete	Superseded	New Part Number
Capscrew	2	No	No	103023
Captive Washer Capscrew	3	No	No	3015283
Accessory Drive Support Gasket	1	No	No	3046852
Wire Tie Clamp	6	No	No	3062329
Pressure Switch	1	No	No	4924925
Accessory Drive Support	1	No	No	5376094
Capscrew	4	No	No	S162A
Lock Washer	6	No	No	S610
Harness	1	No	No	5417037

Document History

Date	Details
2020-2-17	Module Created

Last Modified: 03-Mar-2020
