


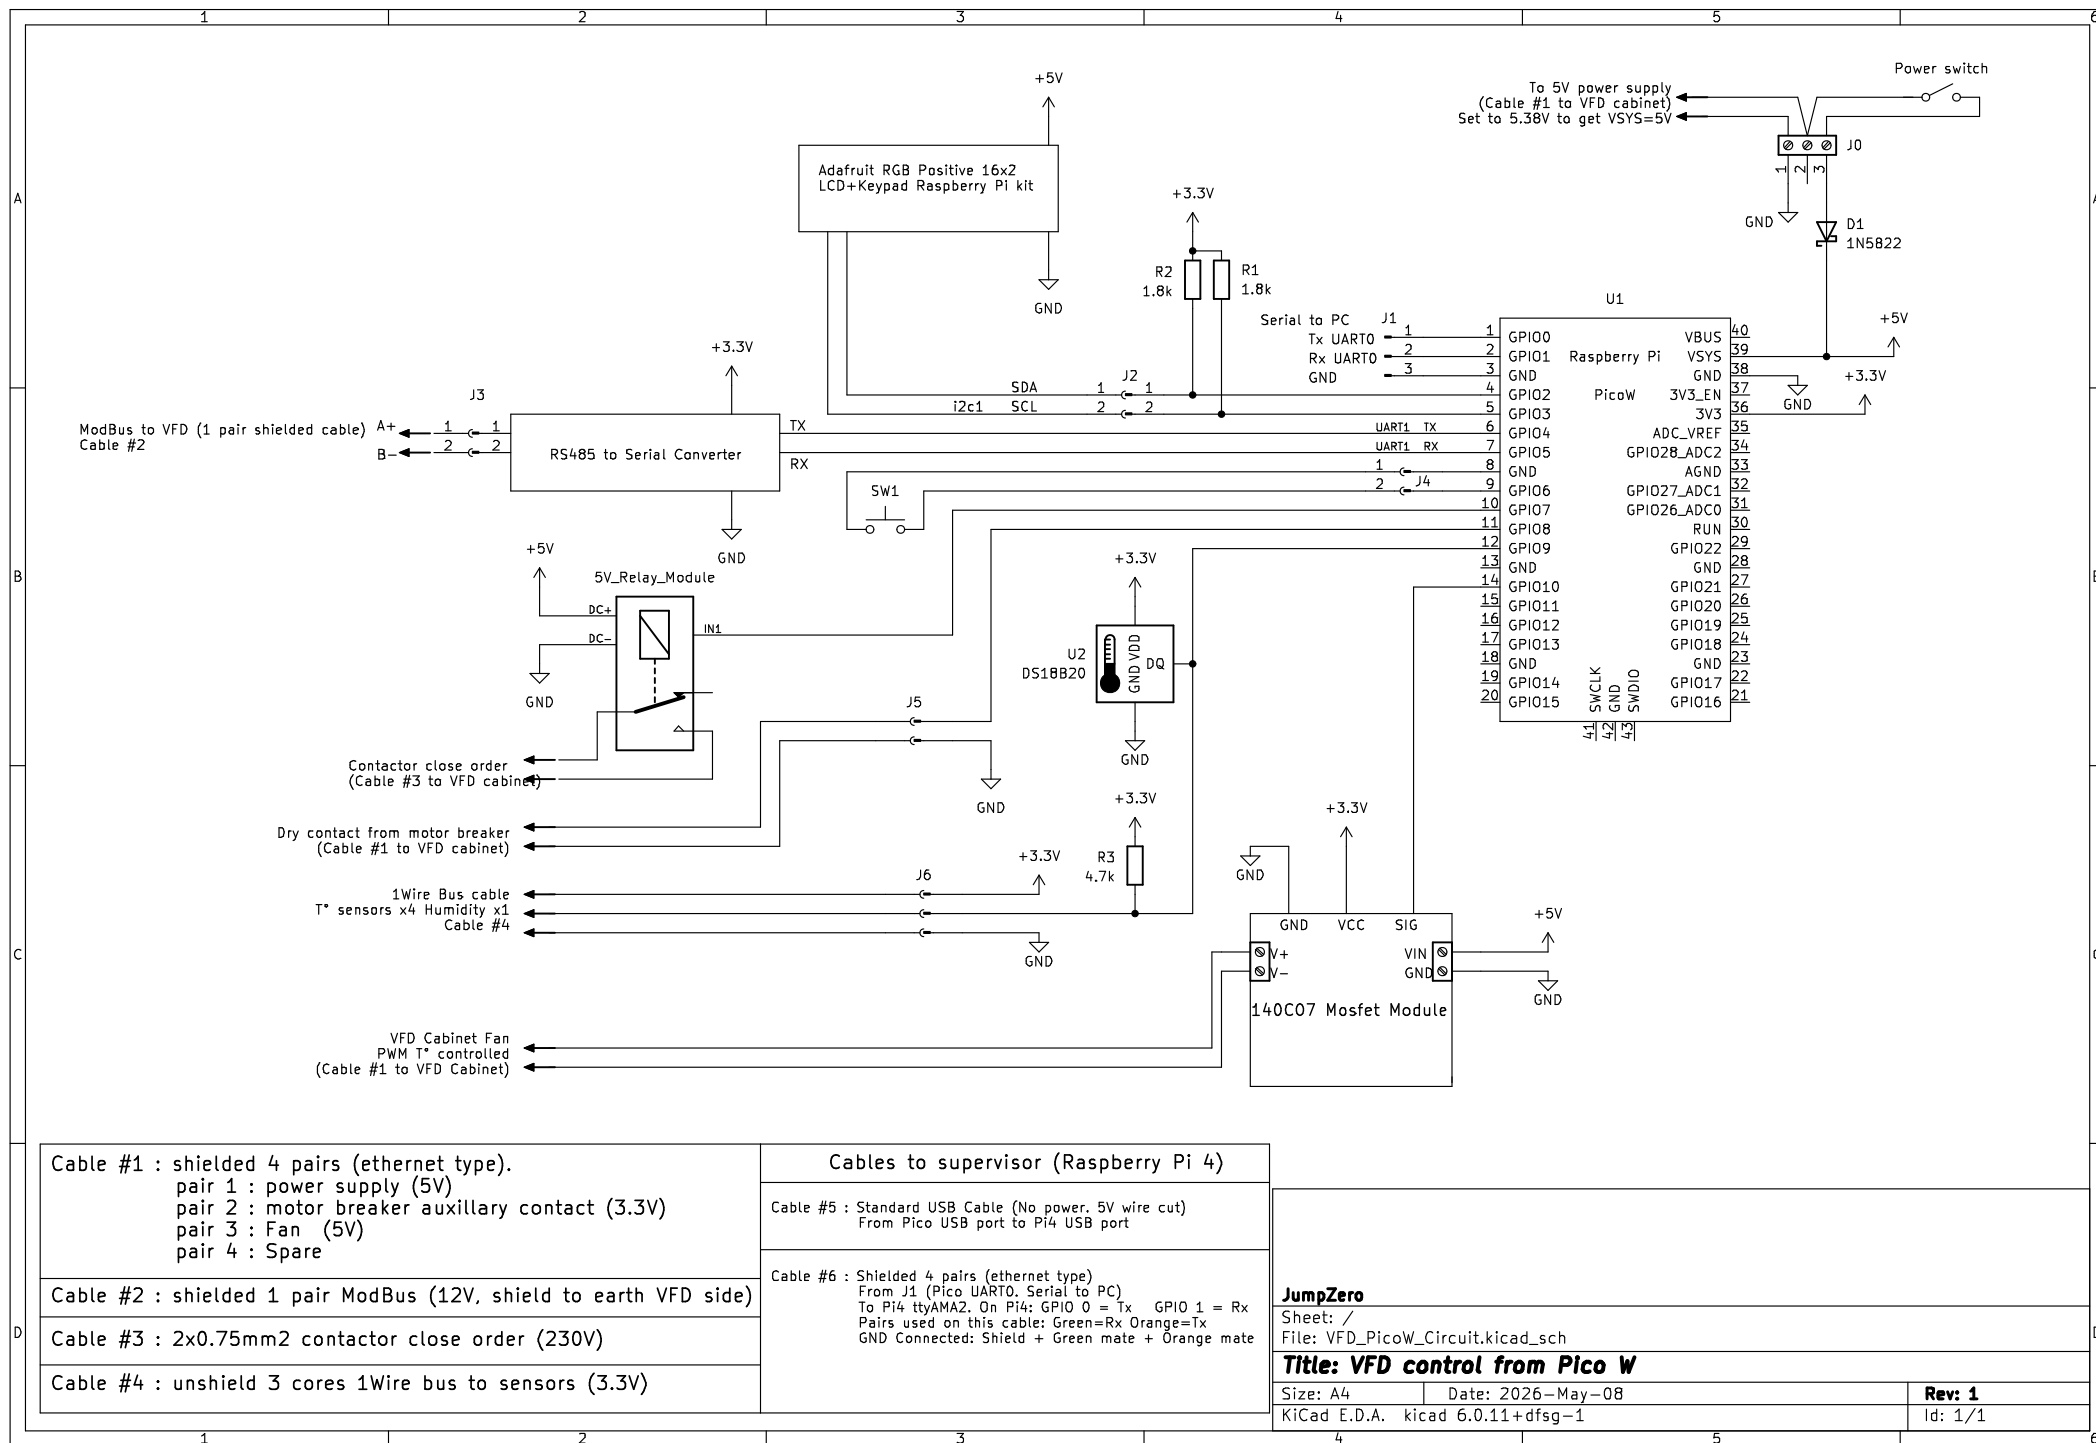

Cable #1 : shielded 4 pairs (ethernet type). pair 1 : power supply (5V) pair 2 : motor breaker auxillary contact (3.3V) pair 3 : Fan (5V) pair 4 : Spare
Cable #2 : shielded 1 pair ModBus (12V, shield to earth VFD side)
Cable #3 : 2x0.75mm2 contactor close order (230V)
Cable #4 : unshield 3 cores 1Wire bus to sensors (3.3V)

Cables to supervisor (Raspberry Pi 4)
Cable #5 : Standard USB Cable (No power, 5V wire cut) From Pico USB port to Pi4 USB port
Cable #6 : Shielded 4 pairs (ethernet type) From J1 (Pico UART0. Serial to PC) To Pi4 ttyAMA2. On Pi4: GPIO 0 = Tx GPIO 1 = Rx Pairs used on this cable: Green=Rx Orange=Tx GND Connected: Shield + Green mate + Orange mate

JumpZero Sheet: / File: VFD_PicoW_Circuit.kicad_sch	
Title: VFD control from Pico W	
Size: A4	Date: 2026-May-08
KiCad E.D.A. kicad 6.0.11+dfsg-1	Rev: 1 Id: 1/1