

4.1 Loading and Unloading of Rolls of Substrate

	Warning! It is essential that any operator that is to load or unload the machine has received training in the operation of the loading device being used. It is also advisable that any equipment used to lift the roll into or out of the machine is suitable for the weight of the roll being lifted. Ensure that the chucks are in the fully open position before loading or unloading a roll of substrate. See chapter 4.2 Operation of Roll Chucking System on page 146 for details.
	Caution! Care must be taken to obtain truly vertical lifts of the rolls from the chucks in order to prevent damage to the machine by the rolls swinging, if an overhead crane is being used.
	Warning! It is the user's responsibility to ensure that equipment used to handle the rolls are rated correctly and are maintained as per the supplier's recommendations to minimise the possibility of accidents.
	DANGER! The operator must lock out the traverse movement isolator and tag it for every person entering the vessel and the web area when the vessel is open.



Figure 4.1-1 Example of a roll being moved to the machine

4.2 Operation of Roll Chucking System

The rolls of substrate are supported on reel shafts with in-built bearings. These bearings are located in bearing supports that extend from the winding mechanism side-plates.



Warning!

Do not place your limbs within the area of the chucks when engaging the chucks.

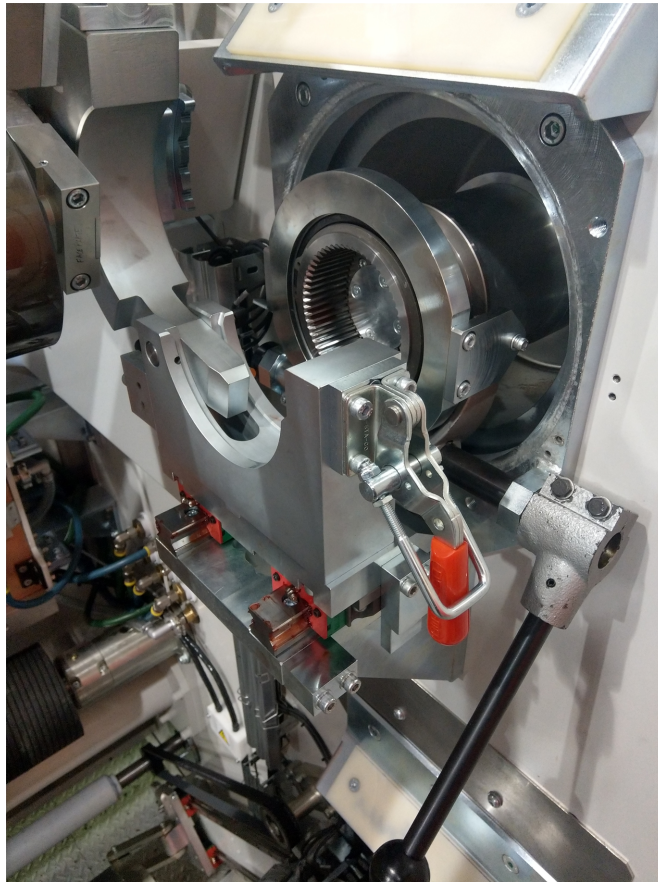


Figure 4.2-1 Example of a roll chuck in an open position, with the spline retracted.

When the reel shafts are lowered into the bearing holders, a swing over clamp is engaged automatically.

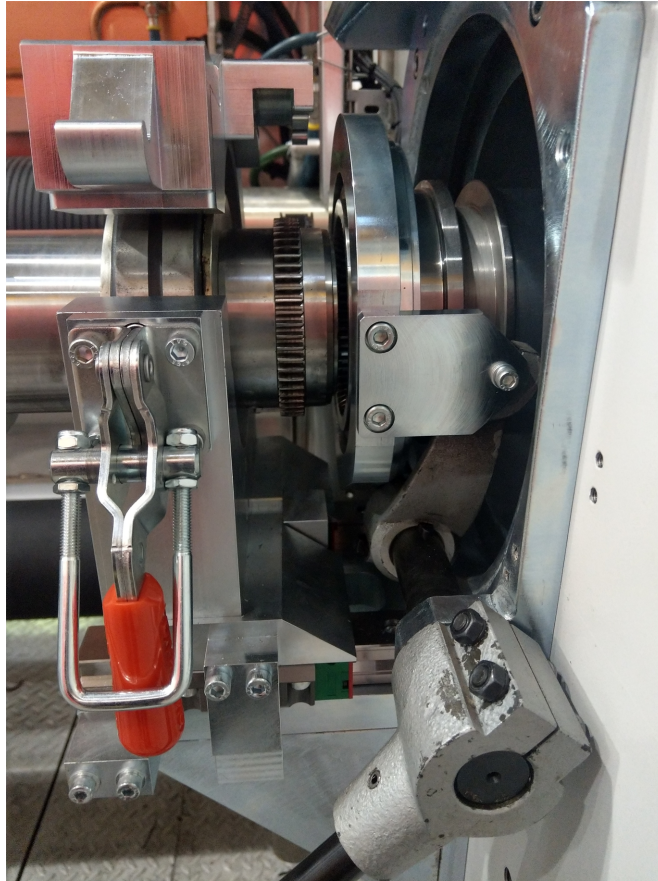


Figure 4.2-2 Example of a reel shaft located in a roll chuck with the swing over clamp in place

A female spline/chuck is engaged over the male spline section of the shaft before the shaft is locked into place. This action is performed using the spline engagement lever.

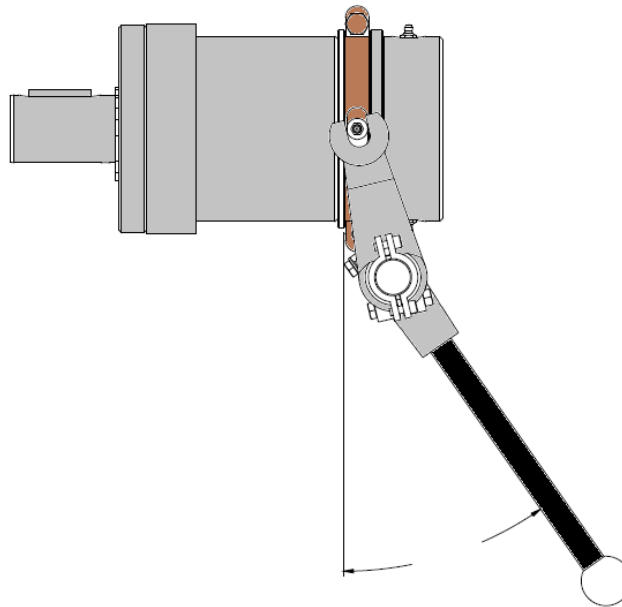


Figure 4.2-3 Drawing showing movement of the spline engagement lever

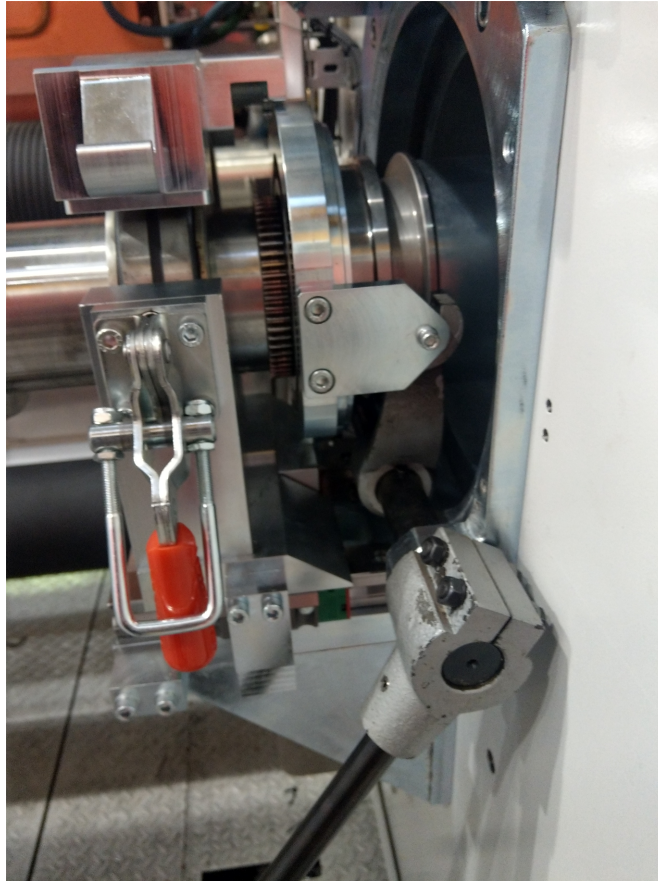


Figure 4.2-4 Example of a reel shaft located in a roll chuck with the female spline partially engaged

The spline must be fully engaged before the swing over clamp can be locked in place