

REPORT OF WASTE DISCHARGE

Madera County
Maintenance District 37 La Vina
Wastewater Treatment Facility



Prepared by:
Ramon E Mendez, P.E.
Engineer III, Madera County Public Works Department

July 2020

TABLE OF CONTENTS

INTRODUCTION	1
1 BACKGROUND	1
1.1 Wastewater System Description	1
1.2 Service Area Description	1
2 WASTEWATER CHARACTERIZATION AND TREATMENT	3
2.1 Domestic Wastewater Characterization (Untreated Wastewater)	3
2.2 Wastewater Treatment System	5
2.3 Recycled Water Projects	6
2.4 Operations and Maintenance	9
3 GROUNDWATER QUALITY	10
3.1 Groundwater Basin	10
4 CALIFORNIA ENVIRONMENTAL QUALITY ACT	10
4.1 CEQA Evaluation	10
APPENDICIES	I
APPENDIX A – WATER BALANCE CALCULATIONS	II
APPENDIX B – EPA INJECTION CONTROL REQUIREMENTS	VI

LIST OF FIGURES

Figure 1: WWTF Site Location	2
Figure 2: WWTF Site Plan	7
Figure 3: WWTF Flow Diagram	8

LIST OF TABLES

Table 1 Average Daily Influent Wastewater Flows (gpd)	4
Table 2: WWTF Electrical Conductivity (µmho/cm)	4
Table 3: Madera County Operators and Certificates	9

CERTIFICATION

"I certify under penalty of law that I have personally examined and am familiar with the information submitted in this document and all attachments and that, based on my inquiry of those individuals immediately responsible for obtaining the information, I believe that the information is true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment."



LIST OF ABBREVIATIONS

BOD	Biochemical Oxygen Demand
CEQA	California Environmental Quality Act
DDW	Division of Drinking Water
DO	Dissolved Oxygen
EC	Electrical Conductivity
GPD	Gallons Per Day
MGD	Million Gallons Per Day
TSS	Total Suspended Solids
WWTF	Wastewater Treatment Facility

INTRODUCTION

Per the requirements of Water Code Section 13260 (a), a Report of Waste Discharge has been prepared to obtain coverage under Waste Discharge Requirements for the existing MD-37 La Vina (MD-37) wastewater treatment facility (WWTF). The Madera County Public Works Department is applying for coverage under the State Water Resources Control Board Water Quality Order 2014-0153-DWQ General Waste Discharge Requirements for Small Domestic Wastewater Treatment Systems. The WWTF has previously operated under Order 95-157.

1 BACKGROUND

1.1 Wastewater System Description

Madera county operates the MD-37 WWTF 5.5 miles southwest of the City of Madera, on the southeast corner of Road 23 ½ and Avenue 9. The MD-37 wastewater treatment facility includes 12 septic tanks, and 10 seepage pits. The average daily flow is 61,575. The permitted flow of existing order 95-157 is 86,000 gpd.

The WWTF treats wastewater produced by the La Vina community that runs east of the facility, located along Avenue 9. The community has two water sources located on the south side of Avenue 9. The west well is located approximately 325 feet east of the WWTF, with a depth of 362 feet and static water level of 148 feet below ground surface. The east well is located approximately 1,700 feet east of the WWTF, with a depth of 420 feet and static water level of 146 feet below ground surface. The nearest surface water bodies are Cottonwood Creek and the San Joaquin River. Cottonwood Creek is approximately 3.5 miles to the north of the WTTF, and the San Joaquin River is approximately 4.5 miles to the south.

The WWTF is located within the northeast corner of section 21, Township 12, Range 17 (Mount Diablo Base & Meridian), Assessor's Parcel Number (APN) 044-230-008 & 044-230-012. The location of the WWTF is included in Figure 1.

1.2 Service Area Description

The service area consists of approximately 52 acres, with 101 sewer connections, serving 175 residential units and 1.6 commercial units (convenience store). The service area boundary is included in Figure 2. The nearest regional wastewater treatment system belongs to the City of Madera 5.5 miles northeast of MD-37 WWTF. Given the large distance, it would not be feasible to construct facilities that would connect MD-37 WWTF to the City.

**MD-37 La Vina
WWTF
Site Location**

Figure 1

— Sewer System



Date:
2/5/2020

Created By:
Ramon E Mendez



Feet
0 250 500

Source: Esri, DigitalGlobe, GeoEye, Earthstar Geographics, CNES/Airbus DS,
USDA, USGS, AeroGRID, IGN, and the GIS User Community

Wastewater is collected by sewer pipelines that run throughout the La Vina community. The wastewater gravity flows to the WWTF, where it is pumped into septic tanks by a lift station located near the northwest corner of the facility. The wastewater then gravity flows through the septic tanks, and then into the seepage pits.

The collection system was originally constructed in the 1980s, along with the wastewater treatment system. The collection system is visually inspected on a quarterly basis, and cleaned as needed. In the event of spills/overflow, server system management plans are followed, which describe the appropriate emergency response. An emergency phone line is available for to call 24 hours a day 7 days a week for MD-37 customers. A wet well high level alarm is installed, which calls the emergency response number in the event of high wastewater levels.

There is no storm water collection system tied into the WWTF. Runoff that occurs in the service area is collected by a basin located on the southern edge of the community, approximately 1,200 feet east of the WWTF. Storm water not collected by this basin typically flows away from the community into the adjacent agricultural land.

2 WASTEWATER CHARACTERIZATION AND TREATMENT

2.1 Domestic Wastewater Characterization (Untreated Wastewater)

Domestic wastewater is produced by the nearby community, which primarily consists of single family homes, and a convenience store. There is no other source of significant wastewater production. The WWTF was constructed below the ground surface, and is not impacted by storm water runoff.

The wastewater flowrate entering the WWTF is estimated using the lift station pump flow capacity and the approximate run time. Flow calculations are typically performed every 2 to 5 days. Table 1 contains the monthly average daily flow from January 2012 to October 2019. The existing waste discharge requirements did not require water quality monitoring. As a result there is limited water quality data available. Average monthly electrical conductivity data from 2012 is provided in Table 2.

Table 1 Average Daily Influent Wastewater Flows (gpd)

	Average Daily Flowrate (gpd)							
	2012	2013	2014	2015	2016	2017	2018	2019
January	55,000	62,000	NA	53,806	59,968	59,000	62,400	75,111
February	97,310	63,720	46,321	49,643	56,203	68,500	70,111	68,500
March	62,467	56,172	42,968	53,000	56,290	69,000	77,000	41,273
April	62,000	61,862	50,750	47,774	54,733	71,367	76,000	42,875
May	64,500	57,968	49,129	48,419	55,065	71,355	69,097	42,091
June	60,793	61,000	56,033	60,800	66,367	72,500	69,100	41,333
July	63,567	59,793	55,250	58,461	68,000	78,268	74,091	43,125
August	62,516	69,433	55,625	51,065	62,000	75,387	81,778	46,750
September	62,516	69,700	62,222	57,167	57,000	74,690	80,667	41,778
October	65,966	70,000	58,613	56,323	63,000	74,233	87,500	44,714
November	66,933	67,423	59,967	55,194	64,000	72,000	83,556	48,500
December	60,286	72,000	57,097	49,000	64,000	63,111	72,667	44,000
Average 2012 - 2019	61,575							

Table 2: WWTF Electrical Conductivity (µmho/cm)

	2012
January	694
February	764
March	689
April	546
May	679
June	635
July	705
August	610
September	-
October	-
November	-
December	641
Average	

2.2 Wastewater Treatment System

The WWTF consists of 12 septic tanks in parallel with a capacity of 7,500 gallons each, with inlet and outlet control valves. Treated wastewater from the tanks flows into 87 seepage pits arranged in six banks in parallel, each with a distribution control valve. The seepage pits are 4.5 feet in diameter, with a depth of approximately 30 to 35 feet. Construction was completed in the 1980s and expanded around 1994. There are no pretreatment or preliminary treatment activities at the WWTF. A WWTF plan and flow diagram are included in Figure 2 and 3 respectively.

The solids generated at this facility primarily form sludge, which accumulates at the bottom of the septic tanks. Every 3 years, 4 out of 12 tanks are pumped to remove sludge. Sludge is removed by a licensed septage hauler and disposed of off-site at the City of Madera wastewater treatment facility, located on Road 20 ½ and Avenue 13. . The sludge removal rotates between 3 groups of 4 tanks every 3 years.

The soils in the seepage pit area consist of sandy silt and silty sands. Three soil borings were conducted in the seepage pit area at depth of 25, 35, 45 feet respectively. Percolation tests were performed within each of the borehole in the expansion area indicated an average percolation rate of 9 minutes per inch (160 inches per day). Three soil borings were also conducted in the original seepage pit area at a depth of 35 feet. Percolation tests performed in this area indicated a percolation rate of 5 minutes per inch (288 inches per day).

Water balance calculations were completed to demonstrate the capacity of the treatment facility. Based on the average daily data presented in Table 1, an average daily flow of 63,489 gpd (.063 MGD) was selected as a typical value. The results indicate the treatment facility has ample capacity to treat the average daily flows, and existing max flowrate. Detailed calculations are provided in Appendix A.

A nitrogen control evaluation was performed based on the method provided in Attachment 1 of the General Order. Step A of the attachment provides flow and site-specific considerations for the evaluation.

A1: Exceed 20,000 gpd Flow Rate?

Based on Table 1 of this report, the discharge regularly exceeds 20,000 gpd throughout the year.

A2: Shallow Groundwater?

The nearby community well for the La Vina water system has an average depth of over 140 feet from ground surface. Based on table titled *Minimum Depth to Groundwater and Minimum Soil Depth from the Bottom of the Dispersal System* provided in the Attachment 1 of the General Order, there is no significant threat to groundwater.

A3: Excessive Percolation Rate

Excessive percolation rate is defined in the attachment as a combination of percolation rate and depth to groundwater that does not comply with the conditions presented in the table described in item A2. The previously established percolation rates are between 5 and 9 minutes per inch. With an average depth to groundwater of over 140 feet, the percolation rate is not considered excessive.

A4: Exceed Domestic Wastewater Strength?


As described in a previous section, the wastewater discharge is generated from the nearby La Vina community. There is no significant contribution from other sources (recreational vehicles, institutions, factories, etc.). The wastewater strength is not expected to exceed the typical values presented in Finding 8 of the General Order.

After considering items A1 to A4, nitrogen limits would not be needed based flow and site-specific conditions.


The use of subsurface disposal including leach fields and/or seepage pits serving more than 20 people, or systems that accept non-sanitary waste (generated by manufacturing, contains biocidal agents such as RV or portable toilets, etc.) must comply with the United States Environmental Protection Agency Underground Injection Control requirements. The WWTF includes seepage pits that serve more than 20 people. Registration with the EPA was completed prior to the submittal of this report. Copies of the EPA documents are provided in Appendix B.

2.3 Recycled Water Projects

Treated wastewater from this facility is not recycled for beneficial use as described in Title 22. As such, Title 22 and Division of Drinking Water (DDW) requirements do not apply to this project. No additional reporting, review, or approval by the DDW is necessary.

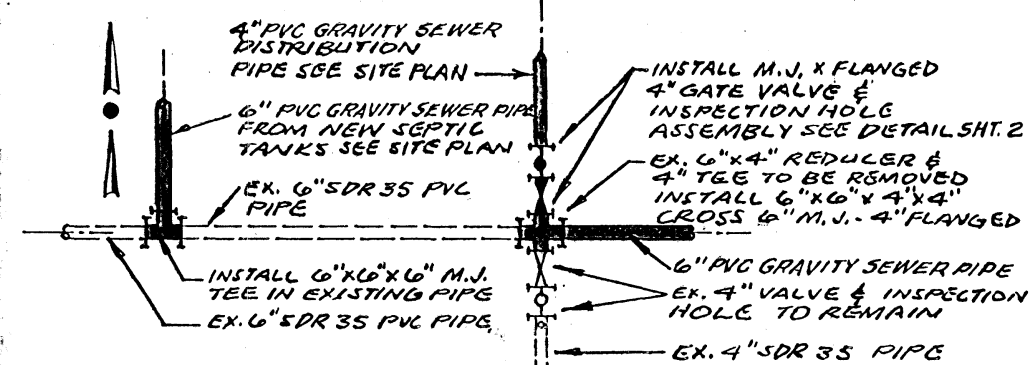


**EFFLUENT DISTRIBUTION PIPE
CONNECTION DETAIL**
N.T.S.

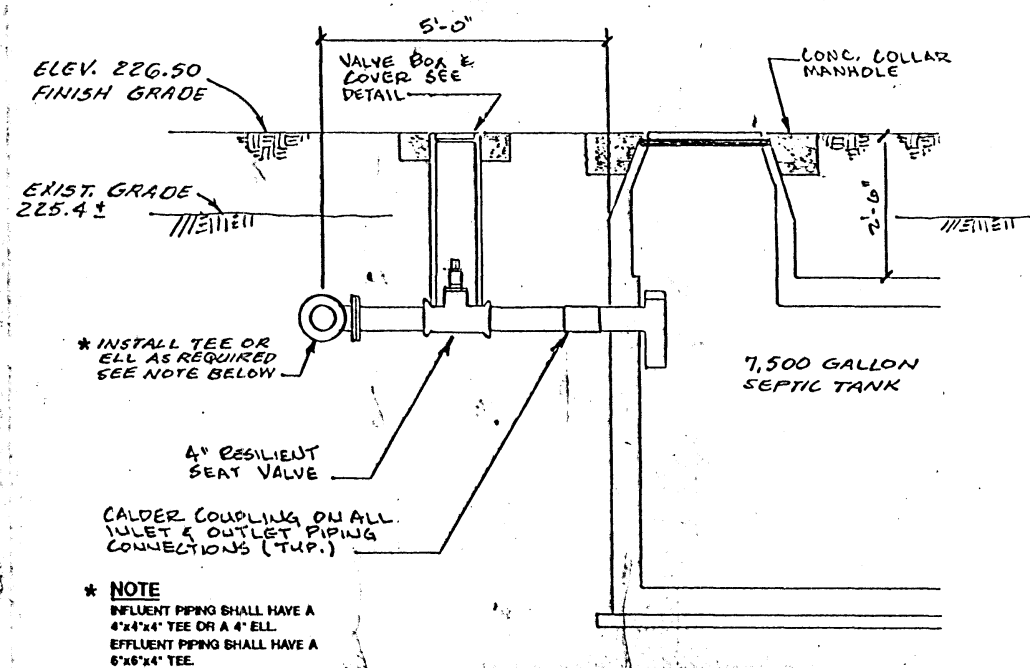

SEPTIC TANK SECTION
N.T.S.

APPROVED BY:

Michael T. Kim
COUNTY ENGINEER
[Signature]
PLANNING DIRECTOR

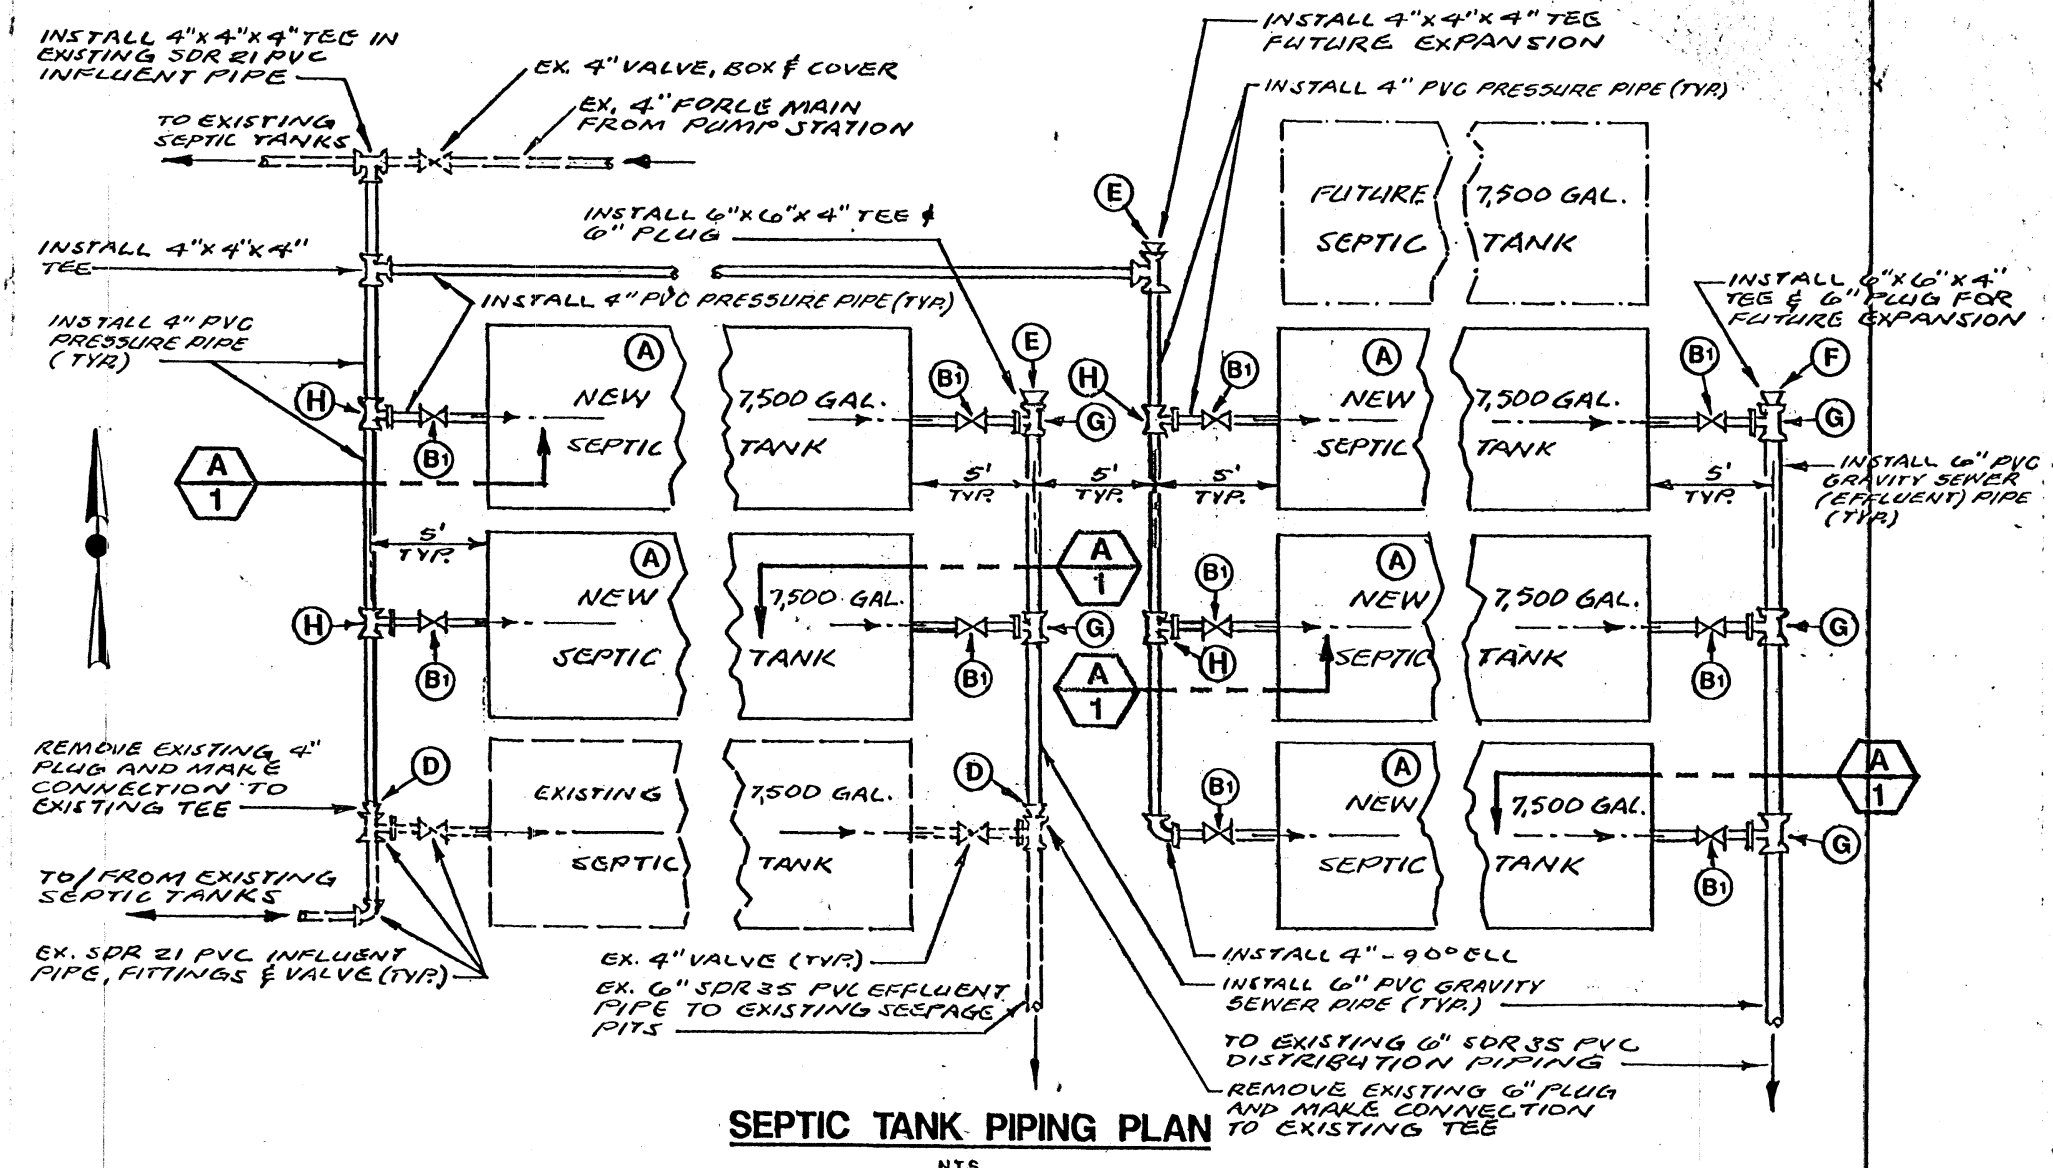

SEPTIC TANK PIPING PLAN
N.T.S.

THE EXISTENCE AND APPROXIMATE LOCATION OF UNDERGROUND UTILITIES OR STRUCTURES SHOWN ON THESE PLANS WERE DETERMINED FROM EXISTING RECORDS. HOWEVER THERE MAY BE OTHER UTILITIES AND/OR STRUCTURES IN THE AREA.

THE CONTRACTOR IS REQUIRED TO TAKE DUE PRECAUTIONARY MEASURES TO PROTECT THE UTILITIES OR STRUCTURES SHOWN AND ANY OTHER UTILITIES OR STRUCTURES THAT MAY BE AT THE SITE. IT SHALL BE THE CONTRACTOR'S RESPONSIBILITY TO NOTIFY THE OWNERS OF THE UTILITIES OR STRUCTURES CONCERNED AND CALL USA ALERT 1-800-642-2444 BEFORE STARTING WORK.

Construction contractor agrees that in accordance with generally accepted construction practices, construction contractor will be required to assume sole and complete responsibility for job site conditions during the course of construction of the project, including safety of all persons and property; that this requirement shall be made to apply continuously and not be limited to normal working hours, and construction contractor further agrees to defend, indemnify and hold design professional harmless from any and all liability, real or alleged, in connection with the performance of work on this project, excepting liability arising from the sole negligence of design professional.

California Council
of Civil Engineers
& Land Surveyors



CA: 1-800-642-2444

NV: 1-800-227-2600

225.12 Ex.

AVENUE

9

EXIST. EDGE OF PAVEMENT


226.29 Ex. A/L

226.78 Ex. E.P.

226.04 Ex. E

PROPERTY LINE


225.7 Ex.

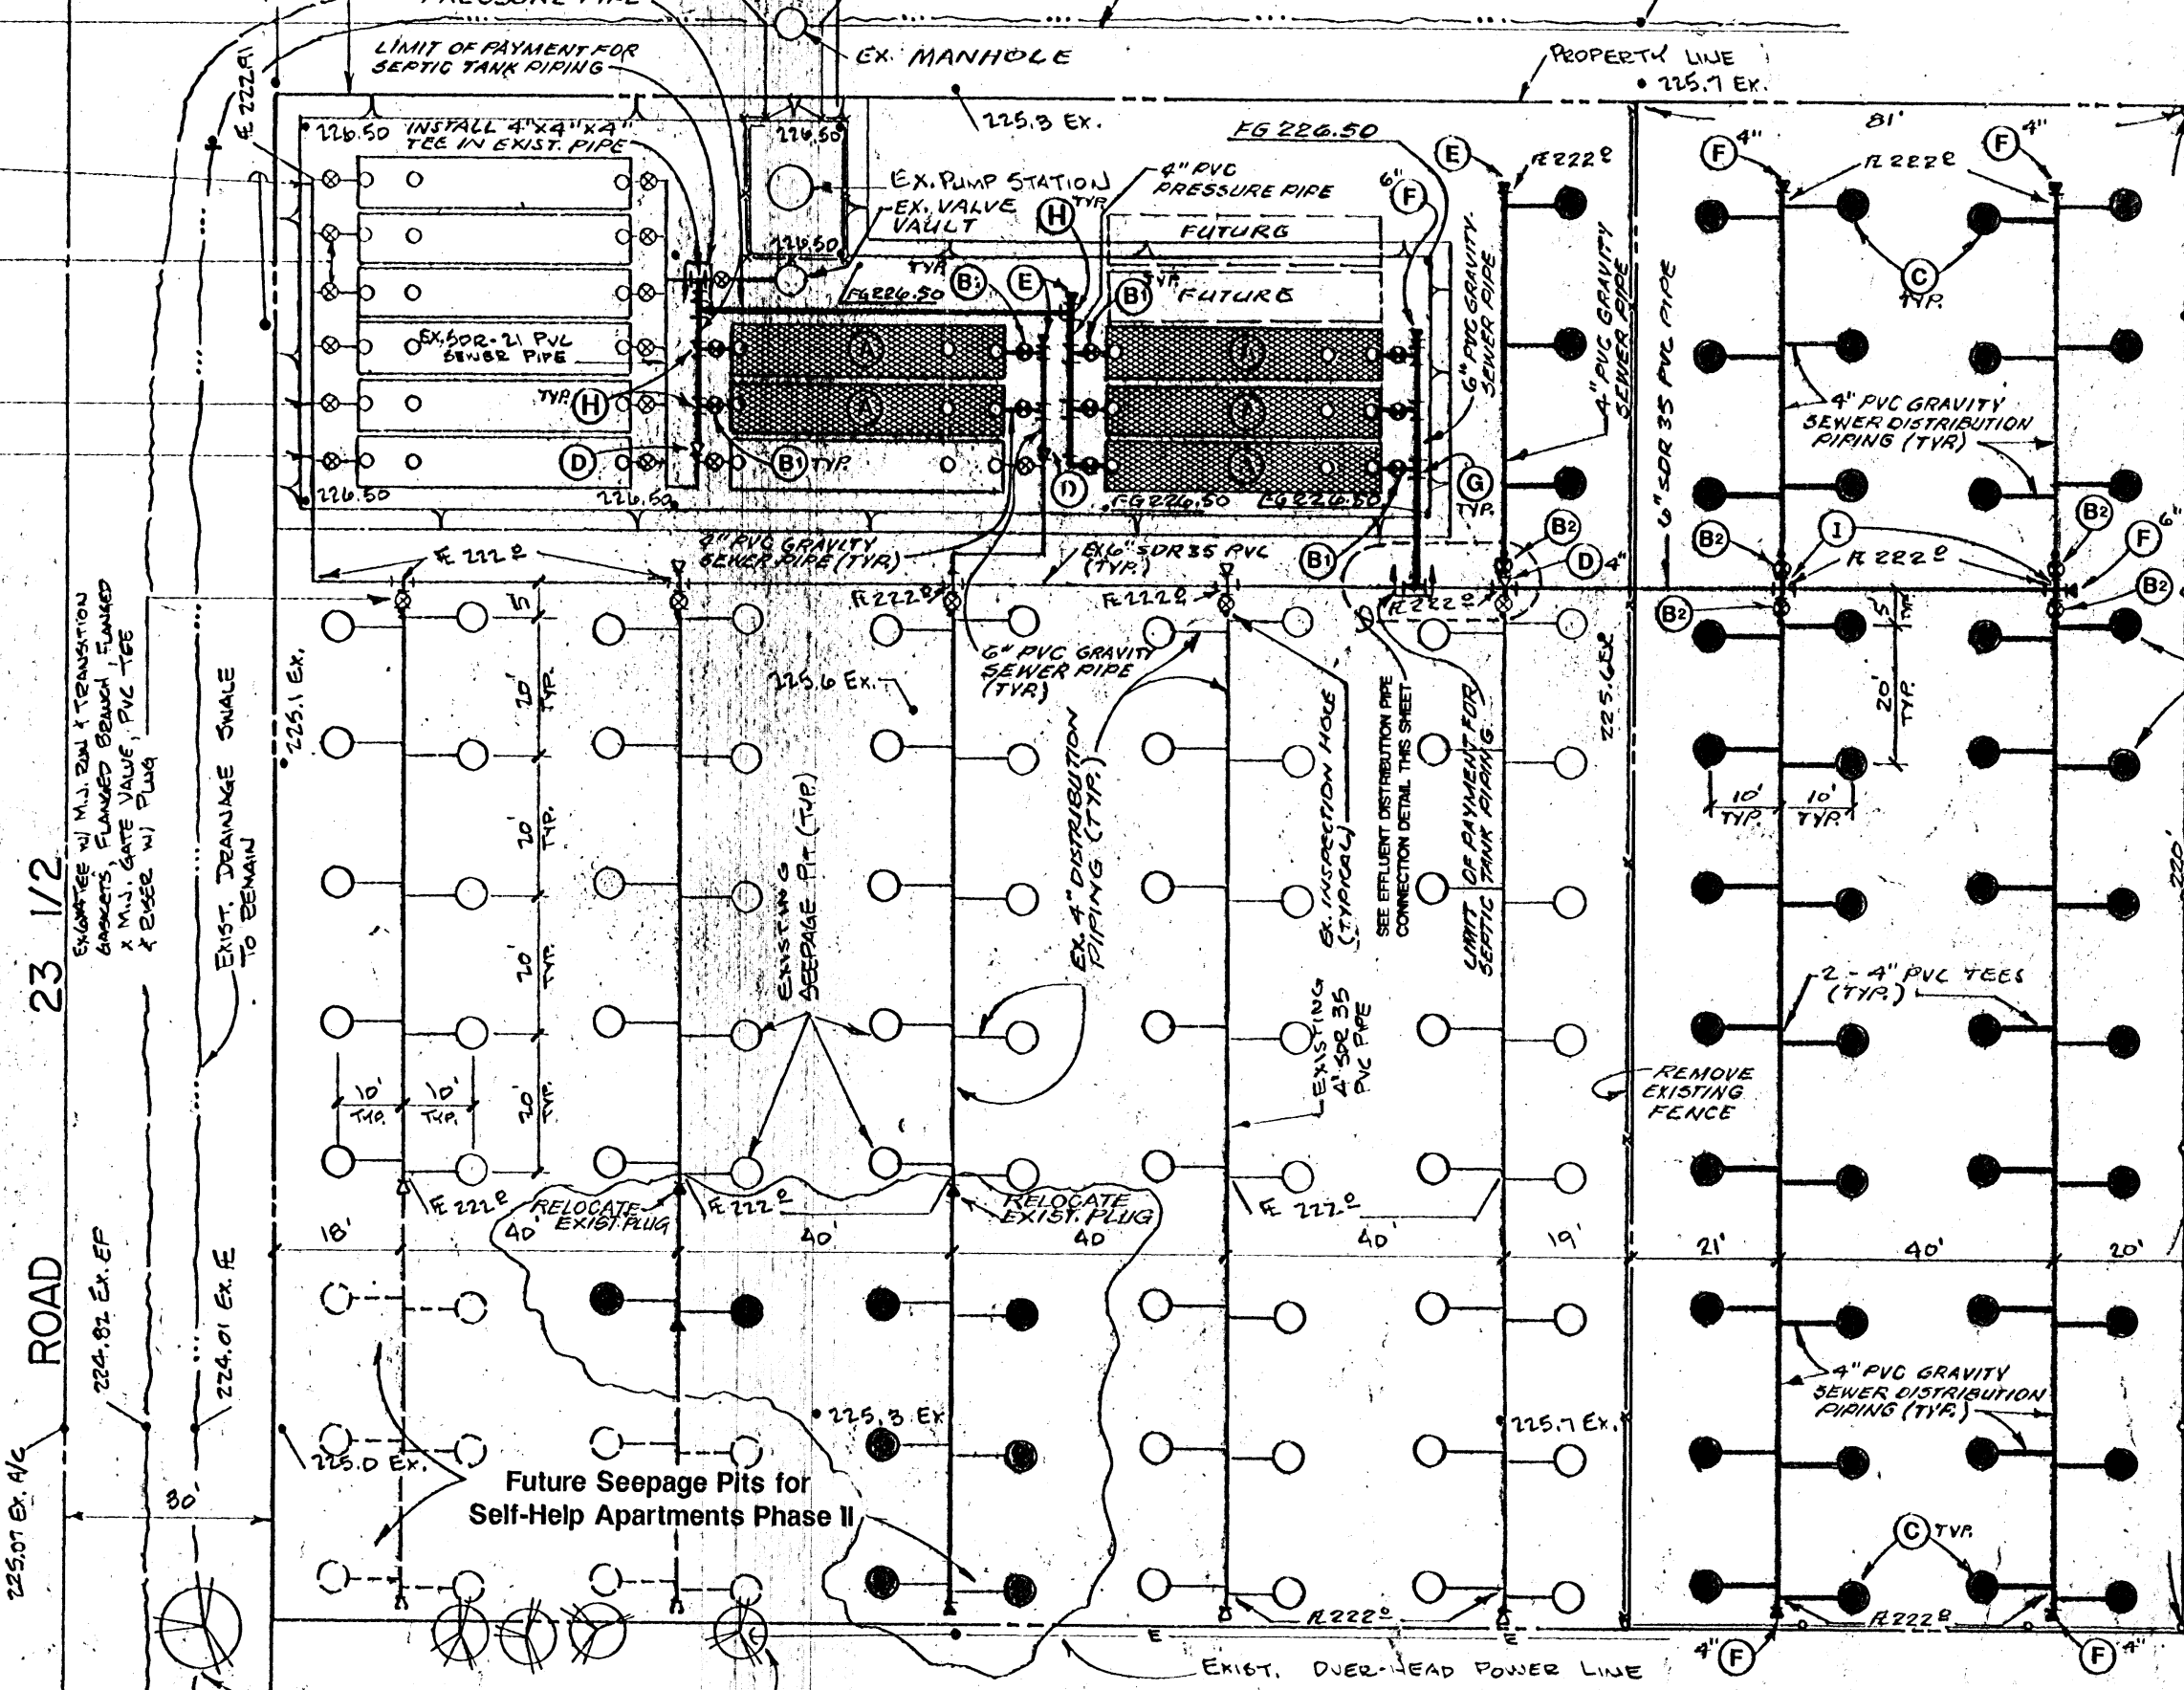


MATERIAL LIST

- (A) Septic tank 7,500 gallon Jensen pre-cast model JP-7500 or approved equal (5 required).
- (B) Mueller 4-inch resilient seat gate valve (mechanical joint-flanged) or approved equal (10 required).
- (B2) Mueller 4-inch resilient seat gate valve (mechanical joint - flanged). Inspection hole, tee, riser, plug, concrete collar and guard post (5 required) see detail sheet 2.
- (C) Seepage pit (47 required) see detail sheet 2.
- (D) Existing plug to be relocated.
- (E) Relocated plug (3 required).
- (F) Install 4-inch or 6-inch plug (6 required).
- (G) 6"x 6"x 4" tee (M.J.-run; flanged branch).
- (H) 4"x 4"x 4" tee (M.J.-run; flanged branch).
- (I) 6" x 6" x 4" x 4" Cross (6" - M.J.; 4" Flanged)

SITE PLAN



- Change Order No.1
- (C) 8 Required
- (E) 2 Required

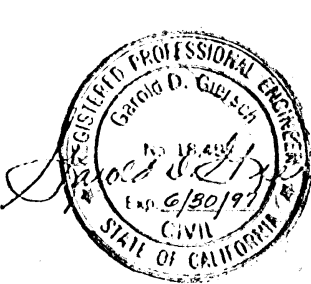

NOTES

1. In accordance with the provisions of Section 1770 to 1780 of the Labor Code of the State of California, the State Director of Industrial Relations has ascertained the general prevailing rate of per diem wages in the locality for each craft or type of workman contractor to whom the contract is awarded and any subcontractor under him shall pay all workmen employed on the work not less than said rates.
 2. Construct embankment for installation of septic tanks to match existing grade. (FG 226.50) See Site Plan this sheet.
 3. Excavated material to be uniformly spread over area of new seepage pit construction.
- NOTE**
CONTRACTOR SHALL EXPOSE EXISTING PIPING AT ALL CONNECTION POINTS PRIOR TO START OF CONSTRUCTION, FOR VERIFICATION OF EXISTING GRADES.



Self Help Enterprises


PROJECT
**LA VINA WASTEWATER
PLANT EXPANSION**

DRAWN BY: GEG
DATE: SEPT. 1994

SITE PLAN & DETAILS

1 2
SHEET OF SHEET
DRAWING NO. B9302132 - 679

CDBG # 94-STBG-807

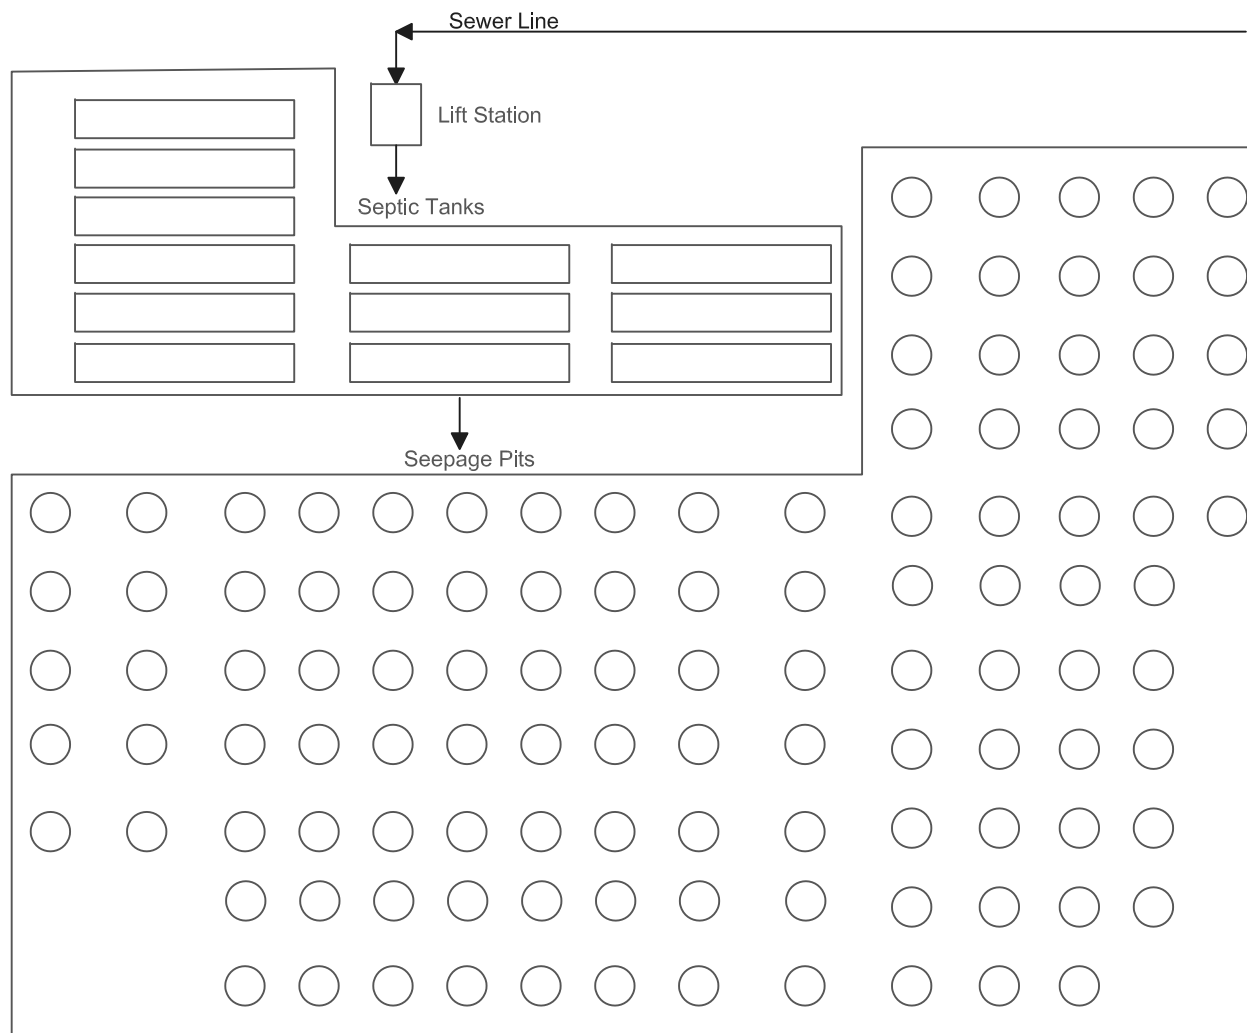

La Vina WWTF
Flow Diagram

Figure 3

Note:
For additional detail see
treatment facility site plan.

2.4 Operations and Maintenance

County operators follow a system checklist for each facility. For MD-37 they perform regular inspection of the facilities. The lift station pump is cycled, the wet well is inspected, and the leech pit area is checked for water surfacing 3 times weekly. The high level alarm float is tested on a weekly basis. On a quarterly basis, the leach pits are rotated in/out of service, the leach field is disked, and the septic tanks are opened and inspected. Regular cleaning is also performed to ensure the WWTF remains free of weeds, trash, or other debris. The sewer system lines are hydro flushed annually.

The County follows Sewer System Management Plan guidelines for operations, maintenance, as well as an overflow emergency response plan. Additionally, a wet well high level alarm is installed, which calls an emergency response number in the event of high wastewater levels.

The MD-37 WWTF is classified as a Grade I in accordance with Section 3675 of the California code of regulations. The County of Madera Public Works Department ensure the staff inspecting and operating the WWTF maintain the required certification. Table 5 lists the Madera County operators and their certificates.

Table 3: Madera County Operators and Certificates

Employee	Water Treatment		Wastewater	
	Grade	License #	Grade	License #
Blake Chapman	2	29779	1	28900
Chad Brown	3	30072	3	28544
David Kliet	3	23504	2	27916
Dennis Zimmer	1	35273	OIT	
Gabriel Navia	2	25553	1	39293
Jason Mitchell	2	30600	2	28676
Scott Smith	1	40876	OIT	
Ken Ramirez	2	29800	1	40654
Lloyd Green	3	21381	2	8847
Marty Duvall	2	20077	3	7284
Charlis Her	1	41194		
Ryan Earley	3	31110	3	29057
Shawn Moran	2	21440	1	29027

3 GROUNDWATER QUALITY

3.1 Groundwater Basin

The WWTF is located in the Madera Subbasin of the San Joaquin groundwater basin. The west well of the La Vina water system is routinely measured for depth to groundwater. Recent measurements have an average depth of 148 feet from ground surface. At this depth the WWTF activities pose little to no threat to the local groundwater quality. For this reason, no groundwater monitoring wells or groundwater quality monitoring is necessary.

4 CALIFORNIA ENVIRONMENTAL QUALITY ACT

4.1 CEQA Evaluation

The La Vina wastewater treatment system is an existing project that is exempt from CEQA under Title 14 section 15301, which covers ongoing or existing projects.

APPENDICIES

APPENDIX A – WATER BALANCE CALCULATIONS

**Madera Maintenance District 37, La Vina WWTF
Precipitation and Evaporation Reference Data**

Month	Days	ETo (inches)	Precipitation (inches)	
		ETo ¹	Normal ²	100-yr ³
October	31	3.55	0.88	1.74
November	30	1.76	1.15	2.27
December	31	1.07	1.70	3.35
January	31	1.09	2.45	4.83
February	28	1.99	2.13	4.20
March	31	3.75	0.18	0.36
April	30	5.09	0.95	1.87
May	31	7.33	0.48	0.95
June	30	8.29	0.19	0.37
July	31	8.32	0.02	0.04
August	31	7.62	0.02	0.04
September	30	5.59	0.25	0.49
Total		55.45	10.40	20.52

¹ California Irrigation Management Information System ETo Zone 12

² National Climatic Data Center 1981-2010 U.S. Climate Normals

³ Department of Water Resources - Climate Data (1972-1992) for Madera 04

Madera County Maintenance District 37, La Vina WWTF
Average Daily Water Balance Assuming Evaporation
0.062 MGD

DESIGN DATA	
Parameter	Value
Average Design Flow, MGD	0.062
Evaporation Pond Area, Acres	0.00
Pond Seepage Area, Acres	0.02
Effluent Reclamation Area, Acres	0
Infiltration Rate, inch/day	160

Month	Sewage Flow		Evaporation Ponds (acre-feet)	Precipitation Ponds (acre-feet) ¹	Pond Infiltration (Acre-ft) ²	Balance (Acre-feet)	
	(MGD)	(acre-feet)				Monthly ³	Cumulative
October	0.062	5.9	0.0	0.00	8.3	-2.4	0.0
November	0.062	5.7	0.0	0.00	8.0	-2.3	0.0
December	0.062	5.9	0.0	0.00	8.3	-2.4	0.0
January	0.062	5.9	0.0	0.00	8.3	-2.4	0.0
February	0.062	5.3	0.0	0.00	7.5	-2.2	0.0
March	0.062	5.9	0.0	0.00	8.3	-2.4	0.0
April	0.062	5.7	0.0	0.00	8.0	-2.3	0.0
May	0.062	5.9	0.0	0.00	8.3	-2.4	0.0
June	0.062	5.7	0.0	0.00	8.0	-2.3	0.0
July	0.062	5.9	0.0	0.00	8.3	-2.4	0.0
August	0.062	5.9	0.0	0.00	8.3	-2.4	0.0
September	0.062	5.7	0.0	0.00	8.0	-2.3	0.0
		69.4	0.0	0.0	97.7		

¹ Water contribution by rainfall over the pond surface areas

² Infiltration assumes a rate of 9 in/hour per seepage pit, with 55 active seepage pits.

³ Monthly excess (deficit) of water. Equal to the sum of sewage flow and precipitation less water loss through evaporation and percolation.

Madera County Maintenance District 37, La Vina WWTF
Design Water Balance Assuming Evaporation
0.086 MGD

DESIGN DATA	
Parameter	Value
Average Design Flow, MGD	0.086
Evaporation Pond Area, Acres	0.00
Pond Seepage Area, Acres	0.02
Effluent Reclamation Area, Acres	0
Infiltration Rate, inch/day	160

Month	Sewage Flow		Evaporation Ponds (acre-feet)	Precipitation Ponds (acre-feet) ¹	Pond Infiltration (Acre-ft) ²	Balance (Acre-feet)	
	(MGD)	(acre-feet)				Monthly ³	Cumulative
October	0.086	8.2	0.0	0.00	8.3	-0.1	0.0
November	0.086	7.9	0.0	0.00	8.0	-0.1	0.0
December	0.086	8.2	0.0	0.00	8.3	-0.1	0.0
January	0.086	8.2	0.0	0.00	8.3	-0.1	0.0
February	0.086	7.4	0.0	0.00	7.5	-0.1	0.0
March	0.086	8.2	0.0	0.00	8.3	-0.1	0.0
April	0.086	7.9	0.0	0.00	8.0	-0.1	0.0
May	0.086	8.2	0.0	0.00	8.3	-0.1	0.0
June	0.086	7.9	0.0	0.00	8.0	-0.1	0.0
July	0.086	8.2	0.0	0.00	8.3	-0.1	0.0
August	0.086	8.2	0.0	0.00	8.3	-0.1	0.0
September	0.086	7.9	0.0	0.00	8.0	-0.1	0.0
		96.3	0.0	0.0	97.7		

¹ Water contribution by rainfall over the pond surface areas

² Infiltration assumes a rate of 9 in/hour per seepage pit, with 55 active seepage pits.

³ Monthly excess (deficit) of water. Equal to the sum of sewage flow and precipitation less water loss through evaporation and percolation.

APPENDIX B – EPA INJECTION CONTROL REQUIREMENTS

Ramon Mendez

From: Kerpel, Judith <KERPEL.JUDITH@EPA.GOV>
Sent: Tuesday, April 28, 2020 12:45 PM
To: Ramon Mendez
Subject: RE: USEPA Region 9 iWells notification regarding: Madera County #14-Chuckchansi WWTF, Madera, CA, 93637

I've changed the subject facility name in our records to " Madera County #37-La Vina WWTF".

Any other questions or concerns, please let us know.

~~~~~  
Judy Kerpel  
Groundwater Protection Section (WTR 4-2) USEPA Region 9  
tel: (415) 972-3567  
~~~~~

-----Original Message-----

From: Ramon Mendez <Ramon.Mendez@maderacounty.com>
Sent: Tuesday, April 28, 2020 11:47 AM
To: Kerpel, Judith <KERPEL.JUDITH@EPA.GOV>
Subject: RE: USEPA Region 9 iWells notification regarding: Madera County #14-Chuckchansi WWTF, Madera, CA, 93637

Please update the name to Madera County #37-La Vina WWTF. I am okay with keeping the original confirmation number.

Regards,

Ramon Mendez | Engineer III
PUBLIC WORKS, ENGINEERING SERVICES
200 W. 4th Street, Suite 3100, Madera, CA 93637
Office: (559) 675-7811

-----Original Message-----

From: Kerpel, Judith [mailto:KERPEL.JUDITH@EPA.GOV]
Sent: Tuesday, April 28, 2020 11:41 AM
To: Ramon Mendez <Ramon.Mendez@maderacounty.com>
Subject: RE: USEPA Region 9 iWells notification regarding: Madera County #14-Chuckchansi WWTF, Madera, CA, 93637

Thank you for contacting EPA regarding your well registration. I can easily change the name of the facility in our records. What name would you like me to use?

Your confirmation number will remain the same (in this case UIC File ID: CA-20200316-JK-2061). Do you require another confirmation with the new name?

~~~~~  
Judy Kerpel  
Groundwater Protection Section (WTR 4-2) USEPA Region 9  
tel: (415) 972-3567

-----Original Message-----

From: Ramon Mendez <Ramon.Mendez@maderacounty.com>

Sent: Tuesday, April 28, 2020 11:36 AM

To: Kerpel, Judith <KERPEL.JUDITH@EPA.GOV>

Cc: Marty Duvall <marty.duvall@maderacounty.com>

Subject: RE: USEPA Region 9 iWells notification regarding: Madera County #14-Chuckchansi WWTF, Madera, CA, 93637

Hello,

Looking back I realized that I entered the incorrect name for the facility. What would be the recommended process for updating the registration?

Regards,

Ramon Mendez | Engineer III

PUBLIC WORKS, ENGINEERING SERVICES

200 W. 4th Street, Suite 3100, Madera, CA 93637

Office: (559) 675-7811

-----Original Message-----

From: kerpel.judith@epa.gov [mailto:kerpel.judith@epa.gov]

Sent: Monday, March 16, 2020 2:54 PM

To: Ramon Mendez <Ramon.Mendez@maderacounty.com>

Cc: Marty Duvall <marty.duvall@maderacounty.com>

Subject: USEPA Region 9 iWells notification regarding: Madera County #14-Chuckchansi WWTF, Madera, CA, 93637

Thank you for using the online injection well registration form. Below is a copy of data received. Please reply if the data was received or transcribed in error.

This notice authorizes only the discharges listed to inject uncontaminated water only.

Any change of use or ownership of the wells, or any new injection, requires notification to EPA. For more information, please see also the regulations beginning at 40 CFR 144.

-Facility

Madera County #14-Chuckchansi WWTF

SE Corner of Avenue 9 and Road 23 1/2

(No Business Address Assigned to Site)

Madera, CA 93637

GIS: 36.879865, -120.118807

Local Identifier: 044-230-008, 044-230-012 UIC File ID: CA-20200316-JK-2061 Tribal Land: No

Ownership: Other - State, local government

-Contacts

---Contact Type: PRIMARY OWNER

Marty Duvall

Madera County Public Works Department

200 W. Fourth Street

Suite 3100  
MADERA, CA 93637  
marty.duvall@maderacounty.com  
---Contact Type: Owner  
Ramon E Mendez  
Madera County Public Works Department  
ramon.mendez@maderacounty.com

-Comments

In the process of applying for coverage under State Water Resources Control Board Order WQ 2014-0153-DWQ, General Waste Discharge Requirements for Small Domestic Wastewater Treatment Systems.

Currently covered under Order No. 95-157, which is expected to be rescinded once coverage under the latest waste discharge requirements is received.

Total number of injection wells (seepage pits) is actually 110. Form did not allow me to enter more than 99.

-Well Summary

110 - Active - 5W31 Large capacity septic system (vertical dispersal) - as of 03/12/2020