

## Mechanical Dial Comparators



1002



1003



1004



1003XL



1003T\*\*\*



### Technical Data

|                   | Measuring range | Readings | Over-travel | Meas. force | Accuracy* (DIN 879-1) |                |                | Order no. Standard** | Order no. Splash water-proof *** |
|-------------------|-----------------|----------|-------------|-------------|-----------------------|----------------|----------------|----------------------|----------------------------------|
| Metric            |                 |          |             |             | G <sub>ges</sub>      | G <sub>e</sub> | f <sub>u</sub> |                      |                                  |
| 1002 Supramess    | ± 25 µm         | 0.5 µm   | 2.8 mm      | 1 N         | 0.6 µm                | 0.5 µm         | 0.25 µm        | 4335000              | 4335005                          |
| 1003 Millimess    | ± 50 µm         | 1 µm     | 2.8 mm      | 1 N         | 1.2 µm                | 1 µm           | 0.5 µm         | 4334000              | 4334005                          |
| 1003 Millimess XL | ± 130 µm        | 2 µm     | 2.5 mm      | 1 N         | 2.4 µm                | 2 µm           | 1 µm           | 4334001              | 4334006                          |
| 1004 Compramess   | ± 0.13 mm       | 5 µm     | 2.5 mm      | 1 N         | 4 µm                  | 3.5 µm         | 1 µm           | 4333000              | 4333005                          |
| 1010 Zentimess    | ± 0.25 mm       | 0.01 mm  | 2.5 mm      | 1 N         | 8 µm                  | 7 µm           | 2 µm           | 4332000              | 4332005                          |
| 1050 Dezimess     | ± 1.5 mm        | 0.05 mm  | 0.3 mm      | 1 N         | 40 µm                 | 35 µm          | 10 µm          | 4330000              | 4330005                          |
| Inch              |                 |          |             |             |                       |                |                |                      |                                  |
| 1002 Z Supramess  | ± .0010"        | .00002"  | .11"        | 1 N         | .000025"              | .00002"        | .00001"        | 4335900              | 4335905                          |
| 1003 Z Millimess  | ± .0020"        | .00005"  | .11"        | 1 N         | .00006"               | .00005"        | .000025"       | 4334900              | 4334905                          |
| 1004 Z Compramess | ± .0050"        | .0001"   | .10"        | 1 N         | .00012"               | .0001"         | .00003"        | 4333900              | 4333905                          |
| 1010 Z Zentimess  | ± .0100"        | .0005"   | .10"        | 1 N         | .0004"                | .00035"        | .0001"         | 4332900              | 4332905                          |

\* Accuracy of 1004, 1010, 1010 Z, 1050 exceeds DIN 879-1

\*\* Incl. Plastic Case; Adapter 940 (for inch instruments only)

\*\*\* IP54, Incl. Plastic Case, Splash Guard Cover 957, Rubber Bellows (only for 1002/1003/1004); Adapter 940 (for inch instruments only)



## Mechanical Dial Comparators





1010




1050

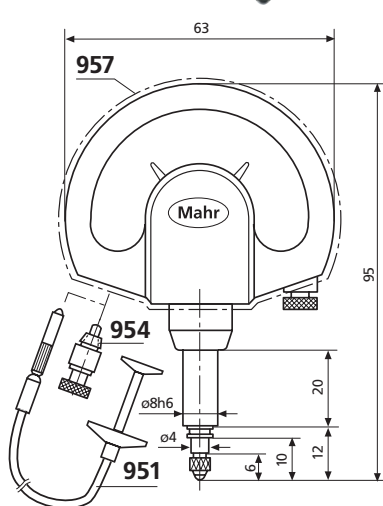

**1002/1003/1004**

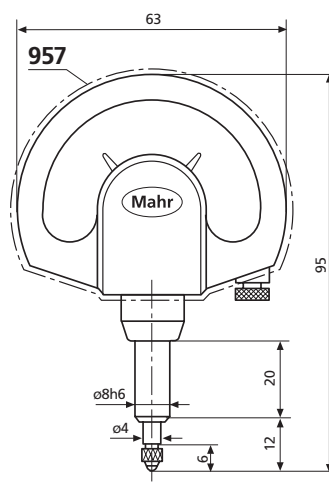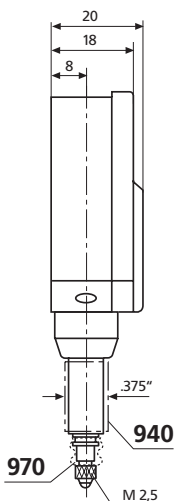

1010/1050

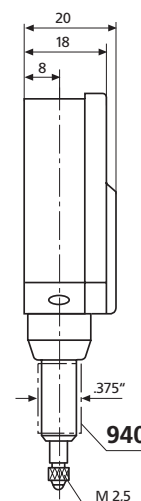

## Accessories

|                                                                                        | Order no.          |
|----------------------------------------------------------------------------------------|--------------------|
| <b>Adapter Bush</b> for adapting mounting shank 8h6 mm to inch bore .375"              | <b>940 4310103</b> |
| <b>Cable Release</b> to raise the measuring spindle                                    | <b>951 4372000</b> |
| <b>Lifting Knob</b> for lifting the measuring spindle                                  | <b>954 4372030</b> |
| <b>Splash Guard Cover</b>                                                              | <b>957 4373030</b> |
| <b>Rubber Bellows</b> for 1002/1003/1004 to seal the open end of the measuring spindle | <b>970 4334786</b> |
| <b>Mounting Lug</b> to mount on mounting shank 8h6 mm                                  | <b>963 4375002</b> |

| Additional Accessories |         | Page |
|------------------------|---------|------|
| Contact Points         | 901-913 | 5-45 |
| Special Holder         | 941     | 5-46 |
| Sensor Lever           | 943     | 5-46 |

