

Equipment service report

CLIENT

Braithe Estuary Partnership
Estuary House, Vardenne Quay
Braithe BR3 4LN

Job reference	KAL-ESR-4471
Date of visit	29 January 2026
Engineer	R. Tarbert
Instrument	Kestrel 400 turbidity analyser
Location	Vardenne Quay pumping station
Service interval	Twelve months

Reported fault

Intermittent baseline noise on channel 2, reported by the Partnership on 21 January. The analyser had been running without attention since the annual service in January 2025.

Work carried out

The flow cell was removed, stripped and cleaned, and the pump tubing set replaced. The optical window was found to be lightly fouled on the inner face; it was cleaned rather than replaced, and should be inspected again at the next visit. The analyser was recalibrated against the two-point standards and left running on channel 2 for an hour before the site was handed back. The completed worksheet is bound in as page 2 of this report.

Service worksheet

Job reference	KAL-ESR-4471
Instrument serial	GK-2214-77
Engineer	R. Tarbert
Date	29 January 2026

CHECKS AND READINGS

Flow cell condition on arrival	Fouled, inner face
Flow cell pressure after service	2.4 bar
Zero drift over 30 minutes	0.003 mg/l
Span recovery against standard	99.4 per cent
Lamp hours at service	8,140
Result	Pass

Calibration certificate SR-4471/2


Analyser left in service on channel 2. Optical window to be inspected at the next visit.

TIME ON SITE

Arrived	29 January 2026, 09:15
Left	29 January 2026, 13:40
Chargeable time	4 hours 25 minutes
Next service due	January 2027

RECEIVED BY

Name	M. Cairney
Position	Duty operator, Vardenne Quay
Date	29 January 2026

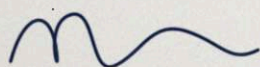

Engineer's signature

Parts fitted

Part	Code	Quantity
Pump tubing set	PT-114	1
Flow cell O-ring, 12 mm	OR-0912	2
Inlet filter, 40 micron	IF-4004	1

Declaration

The work described in this report was carried out to the standard set out in the service agreement. The analyser was left in service and calibrated. The next annual service falls due in January 2027.

Engineer	R. Tarbert
Countersigned	Dr A. J. Prosser
Report issued	2 February 2026