Curved Edge Banding Quality Inspection Standard

DOCUMENT NUMBER	VERSION	EFFECTIVE DATE
YS-ZZZX-007	A/0	21 March 2026

Equipment: Curved edge banding machine

Operator requirements: Operators must be trained and qualified, and must be proficient in equipment operation, equipment performance, safety precautions and protective measures.

Pre-operation inspection

1. Check panel preparation and cut dimensions before processing. Verify that the appearance after banding meets the quality requirements.

Workmanship requirements

1. Edge banding must be flat and firmly bonded, with no debonding or chipping. There must be no missed or incomplete banding, misalignment or raised edges. Surfaces must have no uneven feel; the side profile and rounded edges must be uniform and free from waviness.
2. Joints must be complete and neat. Banding must be even and smooth, with no excess adhesive and with smoothly rounded corners.
3. On curved workpieces, locate the banding joint away from prominent front-facing areas and make the joint flush.
4. Finished workpieces must meet the specified dimensions and the requirements of the untrimmed reference sample.
5. Banding must be neat, with no tearing or burrs. Edges must feel smooth to the touch.
6. The edge band model, color and specification must match the process requirements.

Inspection and Release

Curved Edge Banding

Inspection and release requirements

1. Inspect the first edge-banded piece before batch processing. Begin batch processing only after the first piece passes inspection.
2. Carry out random inspections during processing to verify banding quality.
3. Inspect at least 5% of completed workpieces. Release them to the next operation only after the inspection passes.

Stacking and panel protection

1. Do not place processed panels directly on the floor. Place them on support boards and keep them within the support-board footprint.
2. Keep hard objects out of stacked panels to prevent scratches to the panel surfaces.
3. Stack panels no higher than 0.6 m.
4. Transfer panels to the designated lane for the next operation according to the panel processing route.

Document control

Prepared by / Date	Reviewed by / Date	Approved by / Date

This document and its contents must not be disclosed to unauthorized organizations or individuals without prior written permission from CIRMANO.

Inspection Examples

Curved Edge Banding / Acceptance and defect references



ACCEPTABLE

Acceptable shaped edge banding




ACCEPTABLE

Acceptable curved edge banding



NONCONFORMING

Banding out of alignment

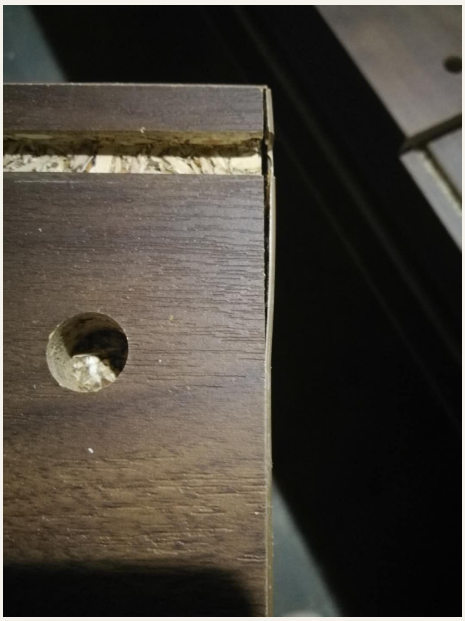

NONCONFORMING

Adhesive bond failure

Inspection Examples

Curved Edge Banding / Acceptance and defect references



NONCONFORMING

Broken edge band




NONCONFORMING

Excessive trimming



NONCONFORMING

Excess adhesive

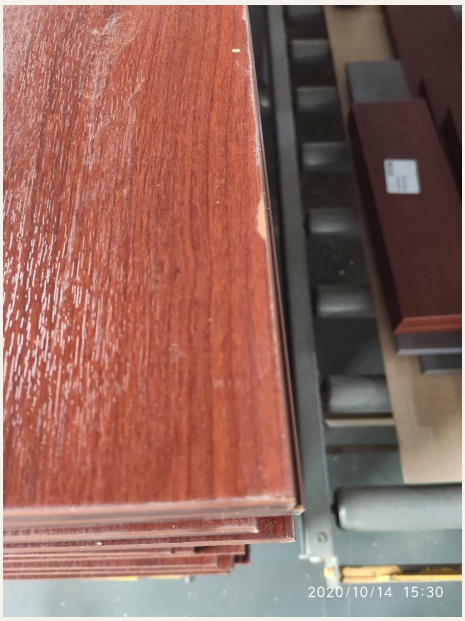

NONCONFORMING

Banding edge scraped or torn

Inspection Examples

Curved Edge Banding / Acceptance and defect references



NONCONFORMING

Banding does not reach the end



NONCONFORMING

Insufficient trimming



ACCEPTABLE

Acceptable reference sample



ACCEPTABLE

Acceptable reference sample