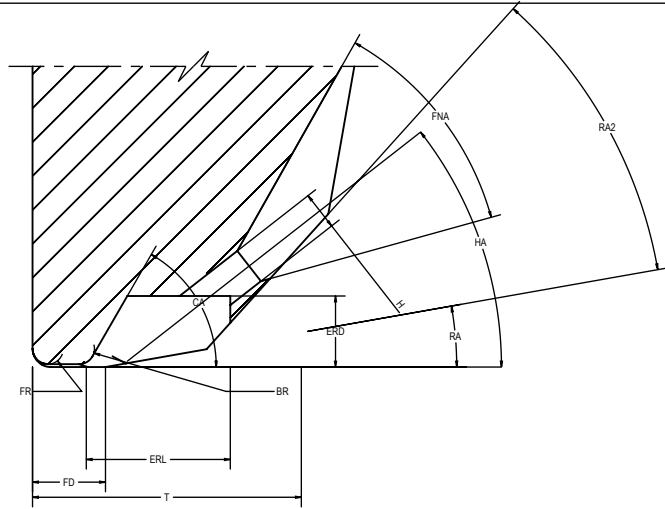
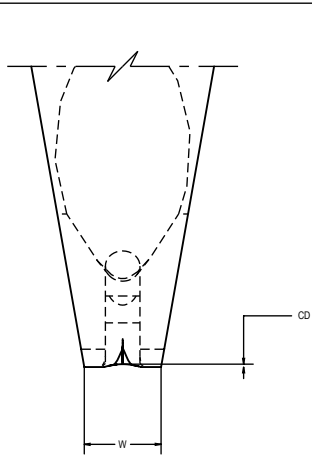
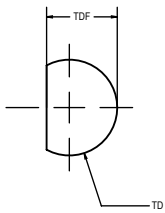


HOW TO ORDER
38COB-2020-L T=014 38RA2

DIMENSIONS	
BA=10°	(REF)
BR=.0008 ±.0001	[0.02 ±0.003]
CA=60°	(REF)
CD=.0002 ±.0000	[0.004 ±0.001]
ERD=.0037 ±.0003	[0.094 ±0.008]
ERL=.0075	[0.191] (REF)
ERW=.0018 ±.0001	[0.046 ±0.003]
FD=.0038 ±.0008	[0.097 ±0.019]
FL=.0028 ±.0002	[0.071 ±0.005]
FNO=.0052	[0.132] (REF)
FR=.0008 ±.0001	[0.02 ±0.003]
FRO=.0010	[0.024] (REF)
H=.0020 ±.0002	[0.051 ±0.005]
HA=38°	(REF)
ISA=20°	(REF)
RA=10°	(REF)
T=.0140 ±.0005	[0.356 ±0.013]
TD=.0624 ±.0001	[1.585 ±0.003]
TDF=.0460 ±.0005	[1.168 ±0.013]
TL=.8280 ±.0050	[21.031 ±0.127]
W=.0040 ±.0002	[0.102 ±0.005]

MATERIAL	DRAWN	DATE	 small precision tools		
TREATMENT	4/6/2026	DATE			
UNLESS OTHERWISE SPECIFIED	CKD.	DATE			
INCH [mm]	ENG.	DATE	TITLE		
.XX = ± .01 [0.25]	WKTG.	DATE	38COB-2020-L T=014 38RA2		
.XXX = ± .005 [0.127]	PROD.	DATE	SCALE	DWG	DRAWN_BY
.XXXX = ± .0005 [0.0127]	3rd ANGLE PROJECTION		8;8;8	A	WAD.Runner
FRACTIONS = ± 1/64 [0.40]			SIZE		
ANGLE = ± 1°			ACAD FILE #:		REV.
FINISH: ALL SURFACES ✓ MAX			5200709		A