
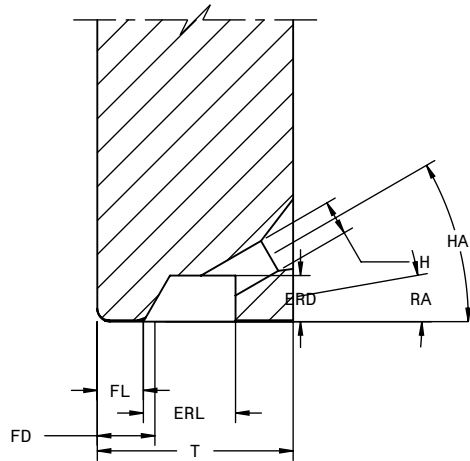
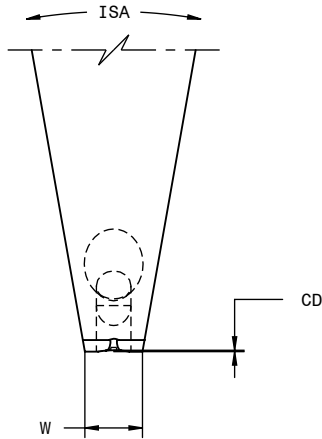
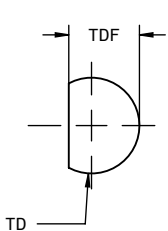
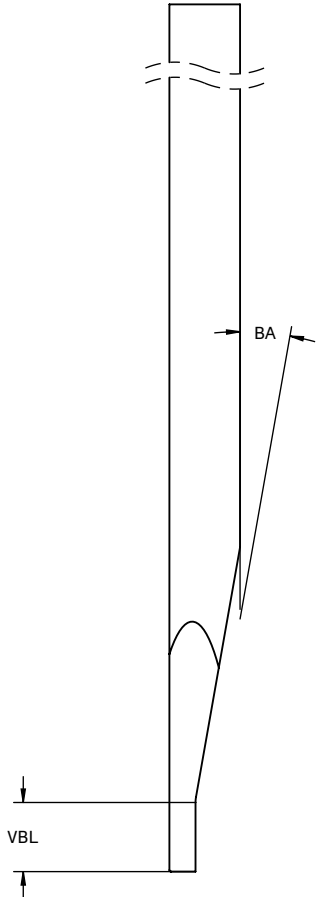


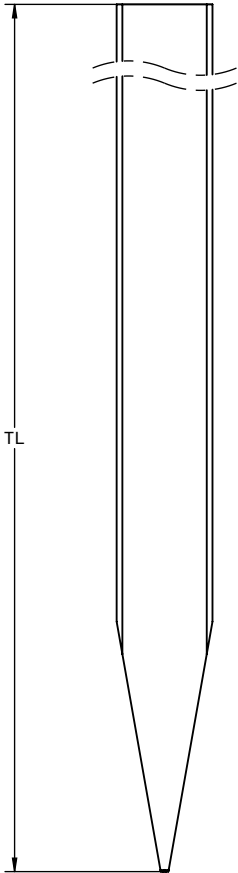

HOW TO ORDER
US30A-WH-3020-L-CM T=017 8RA 2033726

DIMENSIONS	
BR=	.0010 ±.0001 [0.025 ±0.003]
CA=	60° (REF)
CBRA=	20° (REF)
CBRL=	.0010 [0.025] (REF)
CD=	.0001 ±.0001 [0.003 ±0.001]
ERD=	.0040 ±.0003 [0.102 ±0.008]
ERL=	.0080 [0.203] (REF)
ERW=	.0030 ±.0002 [0.076 ±0.005]
FD=	.0050 ±.0008 [0.127 ±0.019]
FL=	.0040 ±.0002 [0.102 ±0.004]
FNO=	.0050 [0.127] (REF)
FR=	.0010 ±.0001 [0.025 ±0.003]
FR0=	.0011 [0.028] (REF)
H=	.0030 ±.0002 [0.076 ±0.004]
HA=	30° (REF)
ISA=	20° (REF)
RA=	10° (REF)
T=	.0170 ±.0005 [0.432 ±0.013]
TD=	.0624 ±.0001 [1.585 ±0.003]
TDF=	.0460 ±.0005 [1.168 ±0.013]
TL=	.8280 ±.0050 [21.031 ±0.127]
VL=	.0450 [1.143] (REF)
W=	.0050 ±.0002 [0.127 ±0.005]

MATERIAL	DRAWN	DATE	 small precision tools		
TREATMENT	4/3/2026	DATE			
UNLESS OTHERWISE SPECIFIED	CKD.	DATE			
	ENG.	DATE			
	MKTG.	DATE	TITLE		
	PROD.	DATE	US30A-WH-3020-L-CM T=017 8RA 2033726		
INCH [mm]		SCALE		DWG	DRAWN_BY
		8;8;8		A	WAD.Runner
.XX = ± .01 [0.25]		SIZE		REV.	
.XXX = ± .005 [0.127]		3rd ANGLE PROJECTION		A	
.XXXX = ± .0005 [0.0127]		ACAD FILE #:		SUPERS.	
FRACTIONS = ± 1/64 [0.40]		5214700			
ANGLE = ± 1°					
FINISH: ALL SURFACES ✓ MAX					