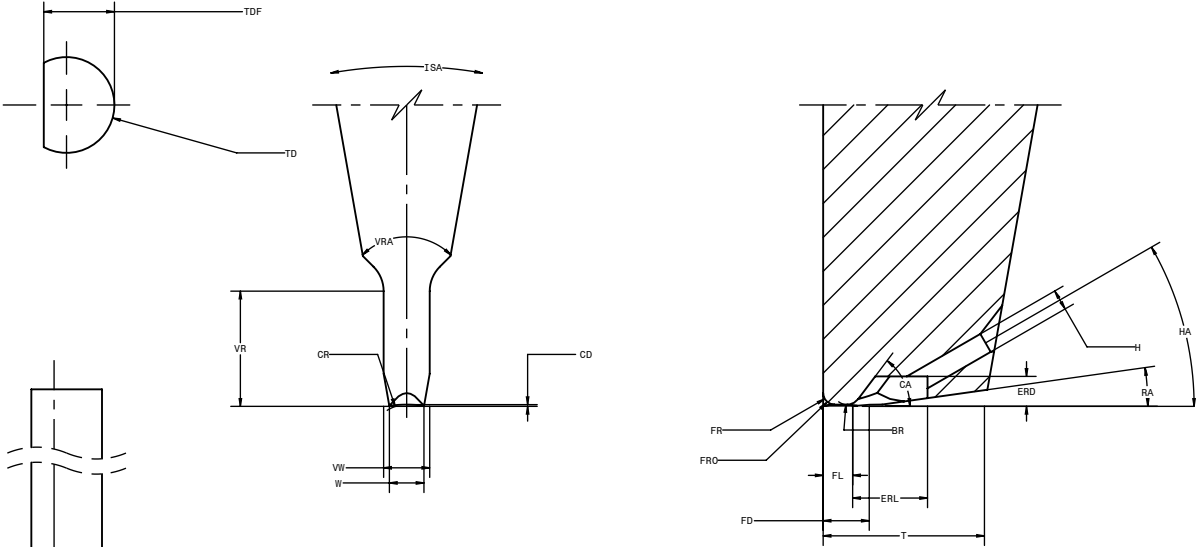


HOW TO ORDER
30COB-1818-L (RF) W=003 VW=004 VR=010 T=014 8RA
2024742

DIMENSIONS	
CD	= .0002 ± .0000 [0.004 ± 0.001]
ERL	= .0065 [0.165] (REF)
FD	= .0040 ± .0008 [0.102 ± 0.019]
FL	= .0026 ± .0002 [0.065 ± 0.005]
FRO	= .0010 ± .0001 [0.025 ± 0.003]
H	= .0018 ± .0002 [0.046 ± 0.005]
T	= .0140 ± .0005 [0.356 ± 0.013]
TD	= .0624 ± .0001 [1.585 ± 0.003]
TDF	= .0460 ± .0005 [1.168 ± 0.013]
TL	= .8280 ± .0050 [21.031 ± 0.127]

MATERIAL	DRAWN 3/3/2026		SECTION AF-AF SCALE 40:1  small precision tools			
TREATMENT	CKD.	DATE				
UNLESS OTHERWISE SPECIFIED	ENG.	DATE				
INCH [mm]	MKTG.	DATE	TITLE 3131808TF			
.XX = ± .01 [0.25]	PROD.	DATE	SCALE 8;8;8	DWG A	DRAWN_BY WAD.Runner	REV. A
.XXX = ± .005 [0.127]	3rd ANGLE PROJECTION		ACAD FILE #: 3131808		SUPERS.	
.XXXX = ± .0005 [0.0127]						
FRACTIONS = ± 1/64 [0.40]						
ANGLE = ± 1°						
FINISH: ALL SURFACES  MAX						