


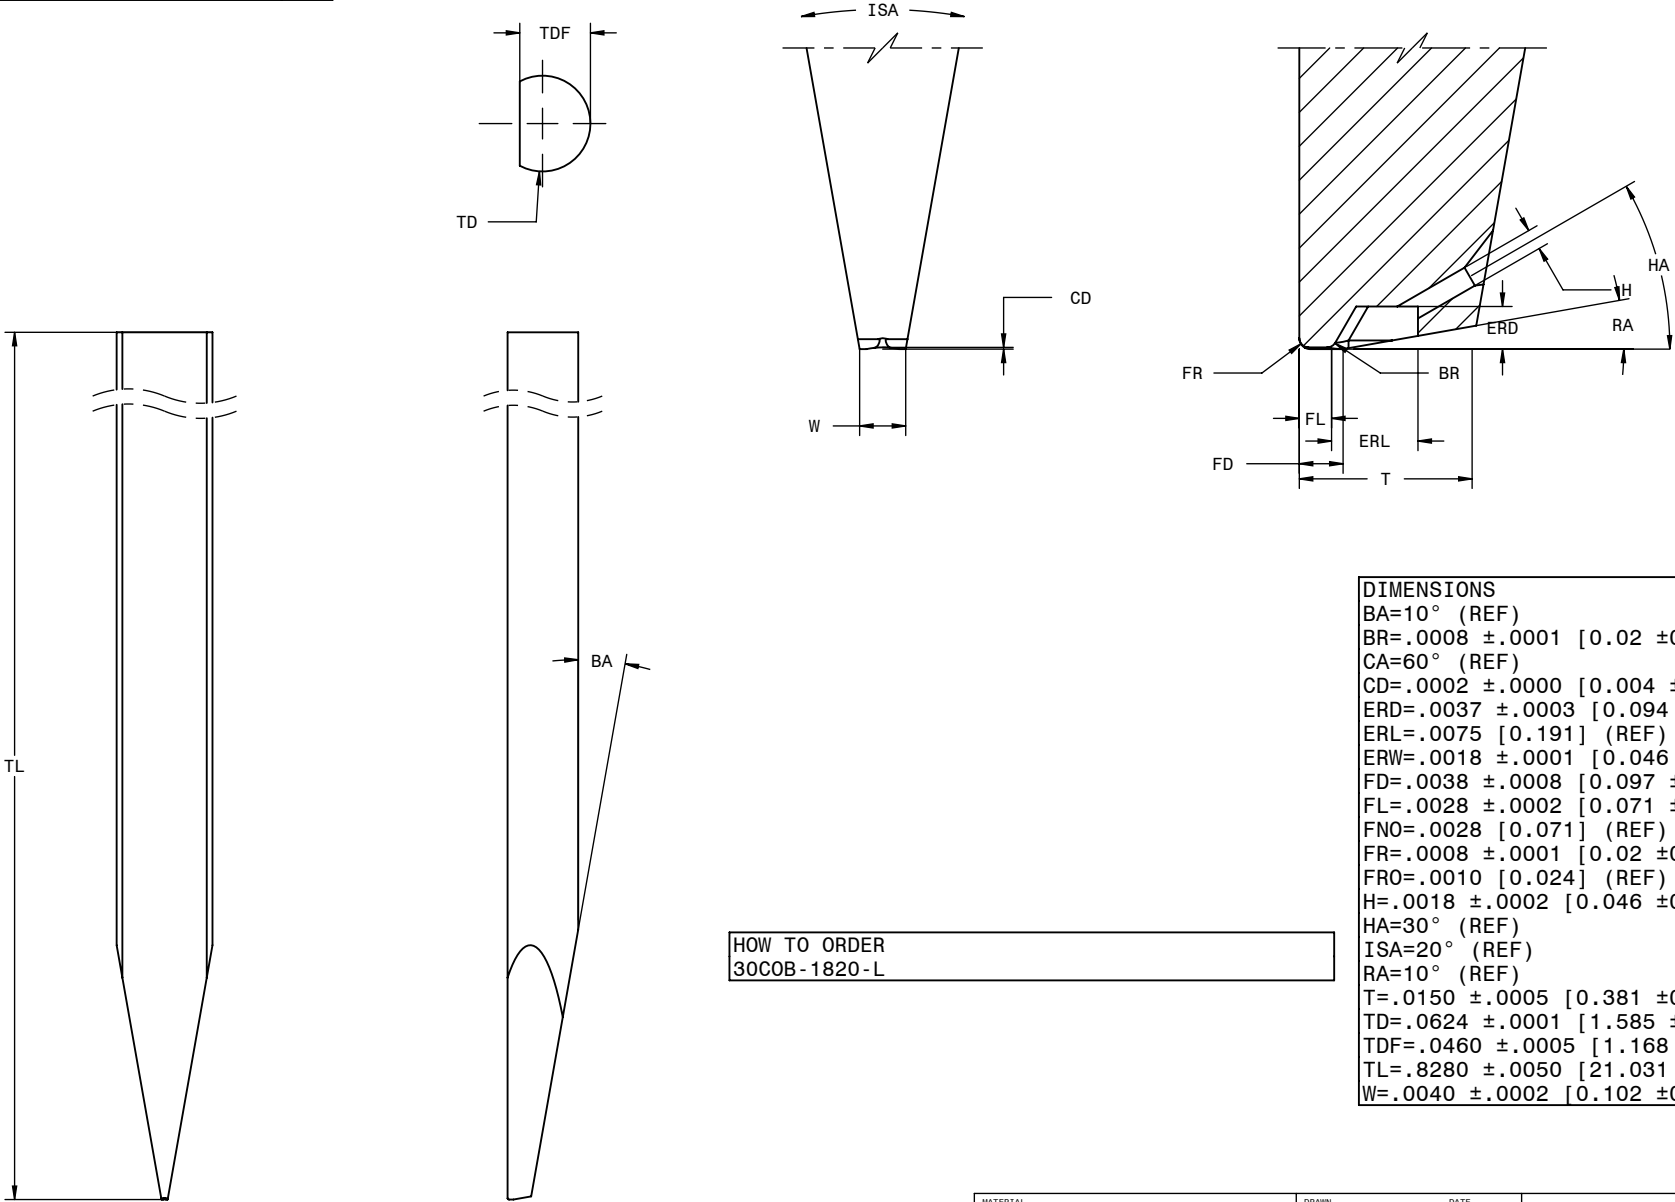

HOW TO ORDER
30COB-1820-L

DIMENSIONS	
BA=10°	(REF)
BR=.0008 ±.0001	[0.02 ±0.003]
CA=60°	(REF)
CD=.0002 ±.0000	[0.004 ±0.001]
ERD=.0037 ±.0003	[0.094 ±0.008]
ERL=.0075	[0.191] (REF)
ERW=.0018 ±.0001	[0.046 ±0.003]
FD=.0038 ±.0008	[0.097 ±0.019]
FL=.0028 ±.0002	[0.071 ±0.005]
FNO=.0028	[0.071] (REF)
FR=.0008 ±.0001	[0.02 ±0.003]
FRO=.0010	[0.024] (REF)
H=.0018 ±.0002	[0.046 ±0.005]
HA=30°	(REF)
ISA=20°	(REF)
RA=10°	(REF)
T=.0150 ±.0005	[0.381 ±0.013]
TD=.0624 ±.0001	[1.585 ±0.003]
TDF=.0460 ±.0005	[1.168 ±0.013]
TL=.8280 ±.0050	[21.031 ±0.127]
W=.0040 ±.0002	[0.102 ±0.005]

MATERIAL	DRAWN		DATE		small precision tools		
TREATMENT	3/26/2026						
UNLESS OTHERWISE SPECIFIED INCH [mm] .XX = ± .01 [0.25] .XXX = ± .005 [0.127] .XXXX = ± .0005 [0.0127] FRACTIONS = ± 1/64 [0.40] ANGLE = ± 1° FINISH: ALL SURFACES  8 / MAX	CKD.	DATE		TITLE 30COB-1820-L			
	ENG.	DATE					
	MKTG.	DATE					
	PROD.	DATE		SCALE	DWG	DRAWN_BY	REV.
	3rd ANGLE PROJECTION				8;8;8	A	WAD.Runner
				ACAD FILE #:	3112260		SUPERS.