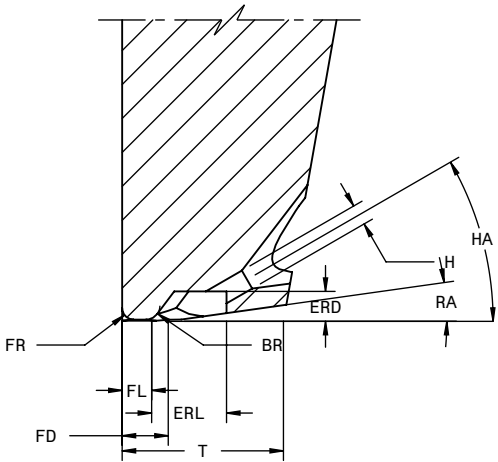
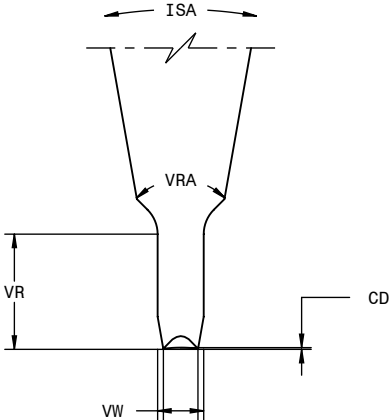
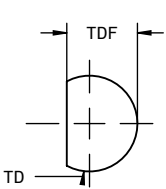


HOW TO ORDER
30COB-1818-L (RF) W=003 VW=004 VR=010 T=014 8RA
2024742

DIMENSIONS
BA=10° (REF)
BR=.0012 ±.0001 [0.03 ±0.003]
CA=53° (REF)
CD=.0002 ±.0000 [0.004 ±0.001]
ERD=.0026 ±.0003 [0.066 ±0.008]
ERL=.0065 [0.165] (REF)
ERW=.0020 ±.0001 [0.051 ±0.003]
FD=.0040 ±.0008 [0.102 ±0.019]
FL=.0026 ±.0002 [0.065 ±0.005]
FNO=.0045 [0.114] (REF)
FR=.0010 ±.0001 [0.025 ±0.003]
FRO=.0010 ±.0001 [0.025 ±0.003]
H=.0018 ±.0002 [0.046 ±0.005]
HA=30° (REF)
ISA=20° (REF)
RA=8° (REF)
T=.0140 ±.0005 [0.356 ±0.013]
TD=.0624 ±.0001 [1.585 ±0.003]
TDF=.0460 ±.0005 [1.168 ±0.013]
TL=.8280 ±.0050 [21.031 ±0.127]
VR=.0100 ±.0010 [0.254 ±0.025]
VW=.0040 ±.0002 [0.102 ±0.005]
W=.0030 ±.0002 [0.076 ±0.005]

MATERIAL	DRAWN	DATE					
TREATMENT	CKD.	DATE					
UNLESS OTHERWISE SPECIFIED		ENG.				DATE	
INCH [mm]		MKTG.				DATE	
.XX = ± .01 [0.25]		PROD.	DATE	TITLE			
.XXX = ± .005 [0.127]		3rd ANGLE PROJECTION		30COB-1818-L (RF) W=003 VW=004 VR=010 T=014 8RA 2024742			
.XXXX = ± .0005 [0.0127]		8/ MAX		SCALE	DWG	DRAWN_BY	REV.
FRACTIONS = ± 1/64 [0.40]				8;8;8	A	WAD.Runner	A
ANGLE = ± 1°				ACAD FILE #:	SUPERS.		
FINISH: ALL SURFACES				3131808			