

UNIT TEST REPORT

By Firmgen

Report identity

Project	motor_demo
Target	firmware (verified off target, no MCU hardware in the loop)
Report ID	UTR-490056A2
Run ID	490056a2-2f4b-49a0-98f8-74a7ec70ea8c
Execution date	24 September 2026, 04:20 UTC
Prepared by	Firmgen automated unit-test agent
Cases executed	177 across 61 test file(s)

1. Test Objective

This activity established executable unit-test evidence for 121 of 177 cases, including 8 of 37 traced requirements and 24 of 38 enumerated firmware units. It exercised 61 test files across application logic, startup behavior, helper code, motor-control behavior, hardware-interface initialization, sequencing, and fault handling. The results support focused follow-up on 19 cases to address and 37 cases not yet verified.

2. Environment and Scope

Source under test	motor_demo
Compile-time defines	UNIT_TEST, HOST_TEST, UNITY_INCLUDE_EXEC_TIME
Test parallelism	8 thread(s)
Test framework	Ceedling 1.1.6 (Unity + CMock)
Build system	Ceedling 1.1.6
Compiler	C:\Users\YatendraBhargava\AppData\Local\craftifai\toolchains\mingw\16.2.0posix-14.0.0-ucrt-r1\bin\gcc.exe 16.2.0
Host environment	FirmGen-managed toolchain (ruby 3.3.12-1) on Windows-10
Execution mode	Off target - compiled for the build architecture, no MCU hardware in the loop; executed directly on the build host, not in a container
Test cases executed	177 across 61 test file(s)

3. Test Harness and Reproducibility

The tests were built and executed off target with Ceedling 1.1.6 using Unity and CMock, compiled for the build architecture with the UNIT_TEST, HOST_TEST, and UNITY_INCLUDE_EXEC_TIME defines. Execution used the FirmGen-managed Ruby 3.3.12-1 toolchain on Windows 10, with GCC 16.2.0 and 8 test threads. Hardware, timer, motor-driver, and external interfaces were represented through mocks, fakes, or stubs available to the host tests; no MCU hardware was in the execution loop.

Reproduction step	Command	Result
Configure	`ceedling project.yml (generated per run)`	● PASS
Build and link	`ceedling test:build_only`	● PASS
Execute tests	`ceedling test:all`	● PASS


Evidence shipped with this run: executed_tests.xlsx, run.txt

4. Execution Summary


121	68%	177	19
Cases passed	Case pass rate	Cases executed	To address

Metric	Result
Cases passed	121
Case pass rate	68.4%
Requirements fully passing	8
Requirements traced to test evidence	37
Total test cases	177
Test files executed	61
Requirement-driven cases	52
Firmware-coverage cases	125
Cases awaiting a verdict	37
Cases with a failure to address	19
Requirements awaiting a verdict	24
Requirements with a failure to address	5
Total execution time	31,806 ms


Outcome of every executed case

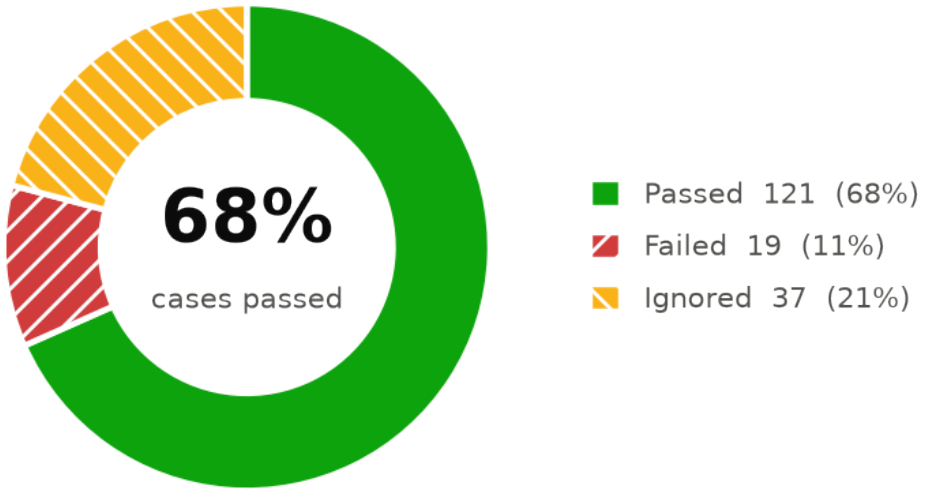


Outcomes by requirement category, strongest first

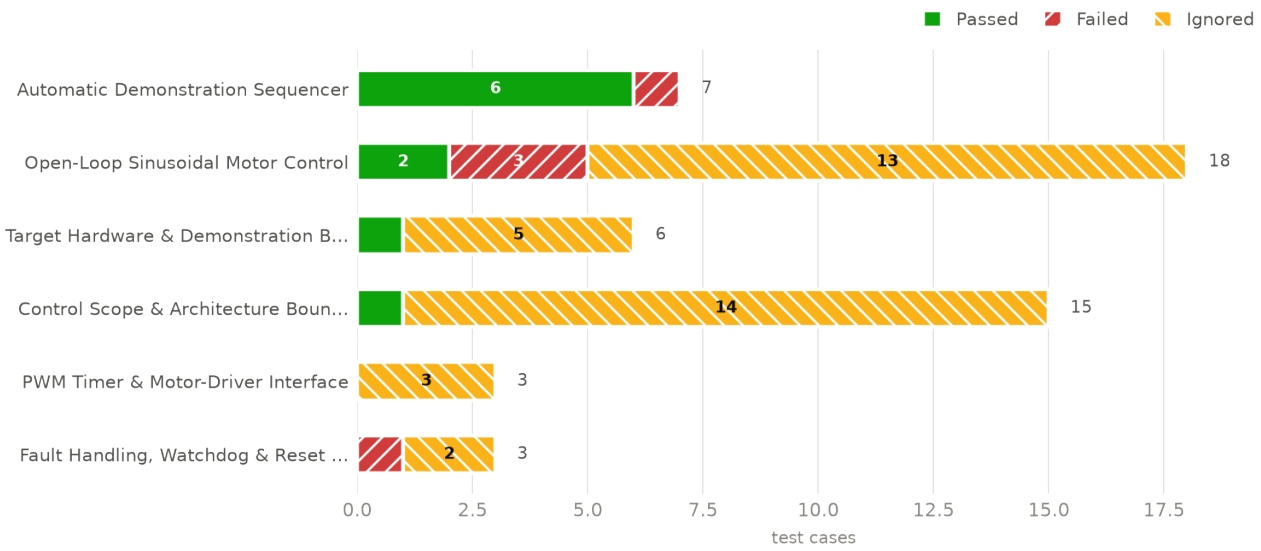

Firmware units verified by this suite

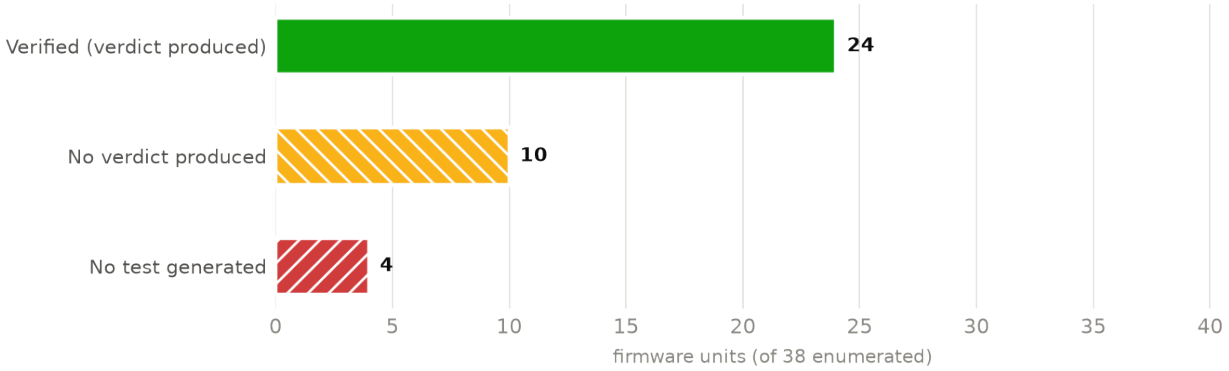

Where to focus next

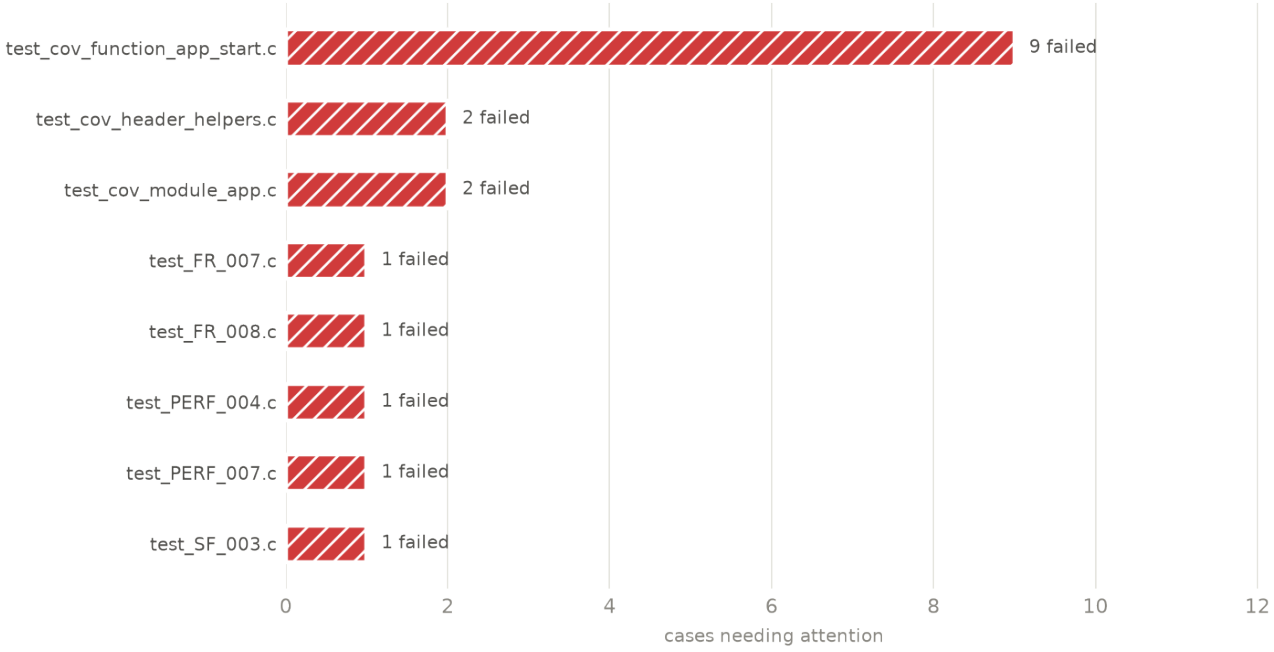

5. Traceability

The executed evidence fully supports 8 traced requirements, while 5 requirements have cases to address and 24 requirements remain not yet verified. The untraced remainder requires additional executable tests, source or configuration inspection, build evidence, or target-level measurement where the current host harness cannot decide the criterion.

Requirements traced to executed cases

Req. ID	Category	Module / symbol	Test file	Cases	Result
FR-002	Automatic Demonstration Sequencer	app_start +2 more	test_FR_002.c	1	PASSED
FR-006	Automatic Demonstration Sequencer	app_start +2 more	test_FR_006.c	1	PASSED
FR-009	Automatic Demonstration Sequencer	app_start +2 more	test_FR_009.c	1	PASSED
HW-003	Target Hardware & Demonstration B…	app_config.h	test_HW_003.c	1	PASSED
NFR-004	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_004.c	1	PASSED
PERF-002	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_002.c	1	PASSED
PERF-003	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_003.c	1	PASSED
PERF-006	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_006.c	1	PASSED
FR-001	Open-Loop Sinusoidal Motor Control	app_drive_sine +2 more	test_FR_001.c	3	IGNORED
FR-003	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_003.c	3	IGNORED
FR-004	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_004.c	2	IGNORED
FR-005	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_005.c	2	IGNORED
FR-018	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_018.c	3	IGNORED
HW-001	Target Hardware & Demonstration B…	main	test_HW_001.c	1	IGNORED
HW-004	Target Hardware & Demonstration B…	app_config.h	test_HW_004.c	2	IGNORED
IF-003	PWM Timer & Motor-Driver Interface	motor_platform_drive +1 more	test_IF_003.c	1	IGNORED
NFR-002	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_002.c	1	IGNORED

Req. ID	Category	Module / symbol	Test file	Cases	Result
NFR-003	Target Hardware & Demonstration B…	app_start +1 more	test_NFR_003.c	2	IGNORED
NFR-005	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_005.c	1	IGNORED
NFR-006	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_006.c	1	IGNORED
NFR-007	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_007.c	1	IGNORED
NFR-008	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_008.c	1	IGNORED
NFR-009	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_009.c	1	IGNORED
NFR-010	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_010.c	1	IGNORED
NFR-011	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_011.c	1	IGNORED
NFR-012	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_012.c	1	IGNORED
NFR-013	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_013.c	1	IGNORED
NFR-014	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_014.c	2	IGNORED
NFR-015	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_015.c	1	IGNORED
NFR-016	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_016.c	1	IGNORED
PERF-001	PWM Timer & Motor-Driver Interface	motor_platform_init	test_PERF_001.c	2	IGNORED
SF-002	Fault Handling, Watchdog & Reset…	safety_platform_init +1 more	test_SF_002.c	2	IGNORED
FR-007	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_007.c	2	FAILED
FR-008	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_008.c	2	FAILED

Req. ID	Category	Module / symbol	Test file	Cases	Result
PERF-004	Open-Loop Sinusoidal Motor Control	app_set_profile	test_PERF_004.c	1	● FAILED
PERF-007	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_007.c	1	● FAILED
SF-003	Fault Handling, Watchdog & Reset...	app_start +2 more	test_SF_003.c	1	● FAILED

Firmware units traced to executed cases

Firmware unit	Kind	Test file	Cases	Result
board	header	test_cov_header_board.c	2	● PASSED
board_name	function	test_cov_function_board_name.c	1	● PASSED
motor_sequence_init	function	test_cov_function_motor_sequence_init.c	2	● PASSED
motor_sequence_is_active	function	test_cov_function_motor_sequence_is_active.c	6	● PASSED
motor_sequence_is_stopped	function	test_cov_function_motor_sequence_is_stopped.c	3	● PASSED
motor_sequence_step	function	test_cov_function_motor_sequence_step.c	11	● PASSED
safety_platform_check_fault	function	test_cov_function_safety_platform_check_fault.c	4	● PASSED
safety_platform_disable	function	test_cov_function_safety_platform_disable.c	1	● PASSED
safety_platform_init	function	test_cov_function_safety_platform_init.c	2	● PASSED
sine_control	module	test_cov_module_sine_control.c	6	● PASSED
sine_control_init	function	test_cov_function_sine_control_init.c	2	● PASSED
sine_control_output	function	test_cov_function_sine_control_output.c	2	● PASSED
sine_control_set_profile	function	test_cov_function_sine_control_set_profile.c	2	● PASSED
sine_control_update	function	test_cov_function_sine_control_update.c	8	● PASSED
x_nucleo_ihm16m1	module	test_cov_module_x_nucleo_ihm16m1.c	8	● PASSED
x_nucleo_ihm16m1_handle_size	function	test_cov_function_x_nucleo_ihm16m1_handle_size.c	1	● PASSED
x_nucleo_ihm16m1_read_adc	function	test_cov_function_x_nucleo_ihm16m1_read_adc.c	1	● PASSED
x_nucleo_ihm16m1_read_fault	function	test_cov_function_x_nucleo_ihm16m1_read_fault.c	1	● PASSED
x_nucleo_ihm16m1_read_sample	function	test_cov_function_x_nucleo_ihm16m1_read_sample.c	2	● PASSED
x_nucleo_ihm16m1_set_pwm_mode	function	test_cov_function_x_nucleo_ihm16m1_set_pwm_mode.c	1	● PASSED
app	module	test_cov_module_app.c	11	● FAILED
app_start	function	test_cov_function_app_start.c	16	● FAILED
helpers	header	test_cov_header_helpers.c	15	● FAILED
x_nucleo_ihm16m1_init	function	test_cov_function_x_nucleo_ihm16m1_init.c	17	● FAILED

6. Failure, Ignored Case, and Root-Cause Record

Scope / cases	Observed result	Suspected cause	Severity	Disposition
Header helper behavior helpers	test_helpers_10 and test_helpers_11 observed 3 where 2 was expected.	The helper execution path produces one additional operation or event relative to the test expectation. The relevant helper branch and test setup need to be compared.	● Low	Open; inspect the helper call or operation count, confirm the intended behavior, and adjust the implementation or test expectation before rerunning.
Automatic sequencer shutdown endpoint PERF-007	The shutdown-ramp check observed a remaining value of 0.04999995 where zero was expected at the end of the 2.0-second ramp.	The shutdown calculation or endpoint handling appears not to reach the exact zero expected by the assertion, potentially because of ramp-step, boundary-time, or floating-point handling.	● Medium	Open; inspect the shutdown-ramp endpoint and its boundary-time calculation, define the intended zero tolerance, and rerun the sequencer case.
Application-module behavior app	test_app_08 returned 10 where zero was expected, and test_app_09 returned 5 where 9.995 was expected.	The application module's computed or reported values differ from the values encoded in these module tests. The mismatch may be in application calculation, scaling, initialization, or the test setup.	● Medium	Open; compare the application calculation and initialization path with the two expected values, then rerun the module tests after the discrepancy is resolved.
Application-start call sequencing app_start	test_app_start_07 and test_app_start_08 recorded fewer motor_platform_enable calls than expected. test_app_start_10 through test_app_start_16 recorded more sine_control_update calls than expected.	The startup control flow or its timing loop does not match the call-count assumptions in the tests. The evidence does not by itself distinguish an implementation sequencing change from stale mock expectations.	● Medium	Open; trace startup iteration timing and enable/update sequencing, reconcile the intended call contract with the mocks, and rerun the app_start cases.
Motor-interface initialization x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_14 observed 1 where zero was expected.	The initialization path performs an operation that the test expects to be absent. The result may reflect an initialization side effect or an expectation mismatch.	● Medium	Open; identify the unexpected initialization operation, confirm whether it is required by the interface contract, and rerun the initialization case.

Scope / cases	Observed result	Suspected cause	Severity	Disposition
Open-loop motor profile and shutdown behavior FR-007, FR-008, PERF-004	FR-007 asserted that the measured electrical frequency was not nominally 10 Hz throughout the hold window. FR-008 did not observe the shutdown ramp starting immediately after the over-amplitude condition. PERF-004 recorded an unexpected sine_control_set_profile amplitude argument of 0.16 instead of 0.1.	The observed results indicate a mismatch between the implemented motor-control profile or transition logic and the expected frequency, amplitude, and over-amplitude responses. The specific cause should be isolated by tracing profile values and state transitions at the defined time points.	High	Open; trace the profile calculations and shutdown transition conditions, then rerun the affected motor-control cases with the required measurement tolerance confirmed.
Fault recovery after active EN/FAULT shutdown SF-003	The case exceeded the expected number of sine_control_set_profile calls while checking that clearing EN/FAULT without reset does not re-enable the driver or generate PWM.	The fault-state handling or the test's expected call sequence does not align with the observed post-fault control activity. The state transition and call contract need to be compared with the intended latched-fault behavior.	High	Open; trace the EN/FAULT shutdown and recovery state machine, confirm the required latched behavior, and update the implementation or expectation before rerunning the case.

7. Limitations and Exclusions

This report states what the executed cases established. The boundaries below mark where off-target unit testing ends and other verification activities begin - they are the scope of this activity, not defects in it.

- These host unit tests do not prove electrical PWM frequency, waveform shape, phase separation, voltage, or motor behavior on the target hardware.
- They do not prove MCU interrupt latency, hardware-watchdog reset behavior, reset-cause reporting, or RTOS scheduling behavior.
- They do not establish that firmware programs or executes successfully on the NUCLEO-G431RB board.
- They do not replace source-tree inspection for absence requirements that have no executable interface or runtime observable.
- They do not provide a complete verdict for the 10 units without a verdict or the 4 units with no test yet.

8. Verification Status and Conclusion

Decision field	Conclusion
Verified scope	121 of 177 executed case(s) passed, covering 8 requirement(s) in full across 61 test file(s).
Outstanding items	Address the 19 failing cases by tracing the motor profile and shutdown behavior, fault recovery, application values and call sequencing, helper counts, and interface initialization. Add or enable evidence for the 37 cases not yet verified, including the 24 requirements not yet covered, and use targ...
Conclusion	The activity provides executed evidence for 121 cases, 8 requirements, and 24 firmware units, giving a concrete basis for focused engineering follow-up. The remaining findings are separable into motor-control behavior, sequencer and fault transitions, application call contracts, helper behavior, and initialization behavior, which supports targeted investigation rather than broad rework. The next verification cycle should resolve the 19 cases to address and add the missing evidence for the 37 cases not yet verified.

Generated automatically from the executed test results of run 490056a2-2f4b-49a0-98f8-74a7ec70ea8c. The figures in this document are computed from executed_tests.xlsx; no count in it was written by a language model.

9. Appendix: Complete Case Record

Every case this run executed appears below, one row each - 177 in total, R1-R52 from the requirement suite and C1-C125 from the firmware-coverage suite. These are the rows every figure in Section 4 was counted from.

Case	Identifier	Test function	Result
R1	FR-001	test_FR_001_01	IGNORED
R2	FR-001	test_FR_001_02	IGNORED
R3	FR-001	test_FR_001_03	IGNORED
R4	FR-002	test_FR_002_01	PASSED
R5	FR-003	test_FR_003_01	IGNORED
R6	FR-003	test_FR_003_02	IGNORED
R7	FR-003	test_FR_003_03	IGNORED
R8	FR-004	test_FR_004_01	IGNORED
R9	FR-004	test_FR_004_02	IGNORED
R10	FR-005	test_FR_005_01	IGNORED
R11	FR-005	test_FR_005_02	IGNORED
R12	FR-006	test_FR_006_01	PASSED
R13	FR-007	test_FR_007_01	FAILED
R14	FR-007	test_FR_007_02	PASSED
R15	FR-008	test_FR_008_01	PASSED
R16	FR-008	test_FR_008_02	FAILED
R17	FR-009	test_FR_009_01	PASSED
R18	FR-018	test_FR_018_01	IGNORED
R19	FR-018	test_FR_018_02	IGNORED
R20	FR-018	test_FR_018_03	IGNORED

Case	Identifier	Test function	Result
R21	HW-001	test_HW_001_01	IGNORED
R22	HW-003	test_HW_003_01	PASSED
R23	HW-004	test_HW_004_01	IGNORED
R24	HW-004	test_HW_004_02	IGNORED
R25	IF-003	test_IF_003_01	IGNORED
R26	NFR-002	test_NFR_002_01	IGNORED
R27	NFR-003	test_NFR_003_01	IGNORED
R28	NFR-003	test_NFR_003_02	IGNORED
R29	NFR-004	test_NFR_004_01	PASSED
R30	NFR-005	test_NFR_005_01	IGNORED
R31	NFR-006	test_NFR_006_01	IGNORED
R32	NFR-007	test_NFR_007_01	IGNORED
R33	NFR-008	test_NFR_008_01	IGNORED
R34	NFR-009	test_NFR_009_01	IGNORED
R35	NFR-010	test_NFR_010_01	IGNORED
R36	NFR-011	test_NFR_011_01	IGNORED
R37	NFR-012	test_NFR_012_01	IGNORED
R38	NFR-013	test_NFR_013_01	IGNORED
R39	NFR-014	test_NFR_014_01	IGNORED
R40	NFR-014	test_NFR_014_02	IGNORED
R41	NFR-015	test_NFR_015_01	IGNORED
R42	NFR-016	test_NFR_016_01	IGNORED
R43	PERF-001	test_PERF_001_01	IGNORED
R44	PERF-001	test_PERF_001_02	IGNORED
R45	PERF-002	test_PERF_002_01	PASSED
R46	PERF-003	test_PERF_003_01	PASSED
R47	PERF-004	test_PERF_004_01	FAILED
R48	PERF-006	test_PERF_006_01	PASSED
R49	PERF-007	test_PERF_007_01	FAILED
R50	SF-002	test_SF_002_01	IGNORED
R51	SF-002	test_SF_002_02	IGNORED
R52	SF-003	test_SF_003_01	FAILED
C1	app	test_app_01	PASSED
C2	app	test_app_02	PASSED
C3	app	test_app_03	PASSED
C4	app	test_app_04	PASSED
C5	app	test_app_05	PASSED
C6	app	test_app_06	PASSED
C7	app	test_app_07	PASSED

Case	Identifier	Test function	Result
C8	app	test_app_08	FAILED
C9	app	test_app_09	FAILED
C10	app	test_app_10	PASSED
C11	app	test_app_11	PASSED
C12	app_start	test_app_start_01	PASSED
C13	app_start	test_app_start_02	PASSED
C14	app_start	test_app_start_03	PASSED
C15	app_start	test_app_start_04	PASSED
C16	app_start	test_app_start_05	PASSED
C17	app_start	test_app_start_06	PASSED
C18	app_start	test_app_start_07	FAILED
C19	app_start	test_app_start_08	FAILED
C20	app_start	test_app_start_09	PASSED
C21	app_start	test_app_start_10	FAILED
C22	app_start	test_app_start_11	FAILED
C23	app_start	test_app_start_12	FAILED
C24	app_start	test_app_start_13	FAILED
C25	app_start	test_app_start_14	FAILED
C26	app_start	test_app_start_15	FAILED
C27	app_start	test_app_start_16	FAILED
C28	board	test_board_01	PASSED
C29	board	test_board_02	PASSED
C30	board_name	test_board_name_01	PASSED
C31	helpers	test_helpers_01	PASSED
C32	helpers	test_helpers_02	PASSED
C33	helpers	test_helpers_03	PASSED
C34	helpers	test_helpers_04	PASSED
C35	helpers	test_helpers_05	PASSED
C36	helpers	test_helpers_06	PASSED
C37	helpers	test_helpers_07	PASSED
C38	helpers	test_helpers_08	PASSED
C39	helpers	test_helpers_09	PASSED
C40	helpers	test_helpers_10	FAILED
C41	helpers	test_helpers_11	FAILED
C42	helpers	test_helpers_12	PASSED
C43	helpers	test_helpers_13	PASSED
C44	helpers	test_helpers_14	PASSED
C45	helpers	test_helpers_15	PASSED
C46	motor_sequence_init	test_motor_sequence_init_01	PASSED

Case	Identifier	Test function	Result
C47	motor_sequence_init	test_motor_sequence_init_02	PASSED
C48	motor_sequence_is_active	test_motor_sequence_is_active_01	PASSED
C49	motor_sequence_is_active	test_motor_sequence_is_active_02	PASSED
C50	motor_sequence_is_active	test_motor_sequence_is_active_03	PASSED
C51	motor_sequence_is_active	test_motor_sequence_is_active_04	PASSED
C52	motor_sequence_is_active	test_motor_sequence_is_active_05	PASSED
C53	motor_sequence_is_active	test_motor_sequence_is_active_06	PASSED
C54	motor_sequence_is_stopped	test_motor_sequence_is_stopped_01	PASSED
C55	motor_sequence_is_stopped	test_motor_sequence_is_stopped_02	PASSED
C56	motor_sequence_is_stopped	test_motor_sequence_is_stopped_03	PASSED
C57	motor_sequence_step	test_motor_sequence_step_01	PASSED
C58	motor_sequence_step	test_motor_sequence_step_02	PASSED
C59	motor_sequence_step	test_motor_sequence_step_03	PASSED
C60	motor_sequence_step	test_motor_sequence_step_04	PASSED
C61	motor_sequence_step	test_motor_sequence_step_05	PASSED
C62	motor_sequence_step	test_motor_sequence_step_06	PASSED
C63	motor_sequence_step	test_motor_sequence_step_07	PASSED
C64	motor_sequence_step	test_motor_sequence_step_08	PASSED
C65	motor_sequence_step	test_motor_sequence_step_09	PASSED
C66	motor_sequence_step	test_motor_sequence_step_10	PASSED
C67	motor_sequence_step	test_motor_sequence_step_11	PASSED
C68	safety_platform_check_fault	test_safety_platform_check_fault_01	PASSED
C69	safety_platform_check_fault	test_safety_platform_check_fault_02	PASSED
C70	safety_platform_check_fault	test_safety_platform_check_fault_03	PASSED
C71	safety_platform_check_fault	test_safety_platform_check_fault_04	PASSED
C72	safety_platform_disable	test_safety_platform_disable_01	PASSED
C73	safety_platform_init	test_safety_platform_init_01	PASSED
C74	safety_platform_init	test_safety_platform_init_02	PASSED
C75	sine_control	test_sine_control_01	PASSED
C76	sine_control	test_sine_control_02	PASSED
C77	sine_control	test_sine_control_03	PASSED
C78	sine_control	test_sine_control_04	PASSED
C79	sine_control	test_sine_control_05	PASSED
C80	sine_control	test_sine_control_06	PASSED
C81	sine_control_init	test_sine_control_init_01	PASSED
C82	sine_control_init	test_sine_control_init_02	PASSED
C83	sine_control_output	test_sine_control_output_01	PASSED
C84	sine_control_output	test_sine_control_output_02	PASSED
C85	sine_control_set_profile	test_sine_control_set_profile_01	PASSED

Case	Identifier	Test function	Result
C86	sine_control_set_profile	test_sine_control_set_profile_02	PASSED
C87	sine_control_update	test_sine_control_update_01	PASSED
C88	sine_control_update	test_sine_control_update_02	PASSED
C89	sine_control_update	test_sine_control_update_03	PASSED
C90	sine_control_update	test_sine_control_update_04	PASSED
C91	sine_control_update	test_sine_control_update_05	PASSED
C92	sine_control_update	test_sine_control_update_06	PASSED
C93	sine_control_update	test_sine_control_update_07	PASSED
C94	sine_control_update	test_sine_control_update_08	PASSED
C95	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_01	PASSED
C96	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_02	PASSED
C97	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_03	PASSED
C98	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_04	PASSED
C99	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_05	PASSED
C100	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_06	PASSED
C101	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_07	PASSED
C102	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_08	PASSED
C103	x_nucleo_ihm16m1_handle_size	test_x_nucleo_ihm16m1_handle_size_01	PASSED
C104	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_01	PASSED
C105	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_02	PASSED
C106	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_03	PASSED
C107	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_04	PASSED
C108	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_05	PASSED
C109	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_06	PASSED
C110	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_07	PASSED
C111	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_08	PASSED
C112	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_09	PASSED
C113	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_10	PASSED
C114	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_11	PASSED
C115	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_12	PASSED
C116	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_13	PASSED
C117	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_14	FAILED
C118	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_15	PASSED
C119	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_16	PASSED
C120	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_17	PASSED
C121	x_nucleo_ihm16m1_read_adc	test_x_nucleo_ihm16m1_read_adc_01	PASSED
C122	x_nucleo_ihm16m1_read_fault	test_x_nucleo_ihm16m1_read_fault_01	PASSED
C123	x_nucleo_ihm16m1_read_sample	test_x_nucleo_ihm16m1_read_sample_01	PASSED
C124	x_nucleo_ihm16m1_read_sample	test_x_nucleo_ihm16m1_read_sample_02	PASSED

Case	Identifier	Test function	Result
C125	x_nucleo_ihm16m1_set_pwm_mode	test_x_nucleo_ihm16m1_set_pwm_mode_01	● PASSED