

UNIT TEST REPORT

By Firmgen

Report identity

Project	motor_demo
Target	firmware (verified off target, no MCU hardware in the loop)
Report ID	UTR-C90368D7
Run ID	c90368d7-e128-4226-a220-fa1b59635fe4
Execution date	24 September 2026, 06:06 UTC
Prepared by	Firmgen automated unit-test agent
Cases executed	175 across 64 test file(s)

1. Test Objective

This activity established executable host-side evidence for 119 of 175 cases, including behavior across motor-control sequencing, control boundaries, fault handling, hardware-interface support and demonstration-build categories. It verified 21 of 39 enumerated firmware units and provides passing evidence for 13 of 43 traced requirements. The results support targeted follow-up on the remaining assertions and on requirements that need additional observability or other verification methods.

2. Environment and Scope

Source under test	motor_demo
Compile-time defines	UNIT_TEST, HOST_TEST, UNITY_INCLUDE_EXEC_TIME
Test parallelism	8 thread(s)
Test framework	Ceedling 1.1.6 (Unity + CMock)
Build system	Ceedling 1.1.6
Compiler	C:\Users\YatendraBhargava\AppData\Local\craftifai\toolchains\mingw\16.2.0posix-14.0.0-ucrt-r1\bin\gcc.exe 16.2.0
Host environment	FirmGen-managed toolchain (ruby 3.3.12-1) on Windows-10
Execution mode	Off target - compiled for the build architecture, no MCU hardware in the loop; executed directly on the build host, not in a container
Test cases executed	175 across 64 test file(s)

3. Test Harness and Reproducibility

The tests were built and run with Ceedling 1.1.6 using Unity and CMock, with UNIT_TEST, HOST_TEST and UNITY_INCLUDE_EXEC_TIME defined. Test files were executed with 8 threads using GCC 16.2.0 in the FirmGen-managed Ruby 3.3.12-1 toolchain on Windows 10. The activity ran off target on the build host, using mocks, fakes and stubs rather than MCU hardware; no container or hardware-in-the-loop execution was used.

Reproduction step	Command	Result
Configure	`ceedling project.yml (generated per run)`	● PASS
Build and link	`ceedling test:build_only`	● PASS
Execute tests	`ceedling test:all`	● PASS


Evidence shipped with this run: executed_tests.xlsx, run.txt

4. Execution Summary


119	68%	175	11
Cases passed	Case pass rate	Cases executed	To address

Metric	Result
Cases passed	119
Case pass rate	68.0%
Requirements fully passing	13
Requirements traced to test evidence	43
Total test cases	175
Test files executed	64
Requirement-driven cases	67
Firmware-coverage cases	108
Cases awaiting a verdict	45
Cases with a failure to address	11
Requirements awaiting a verdict	27
Requirements with a failure to address	3
Total execution time	38,541 ms


Outcome of every executed case

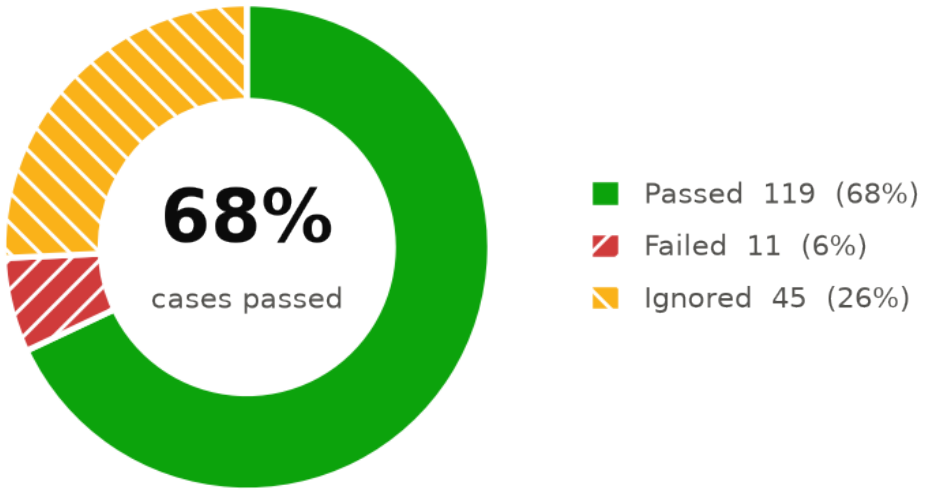


Outcomes by requirement category, strongest first

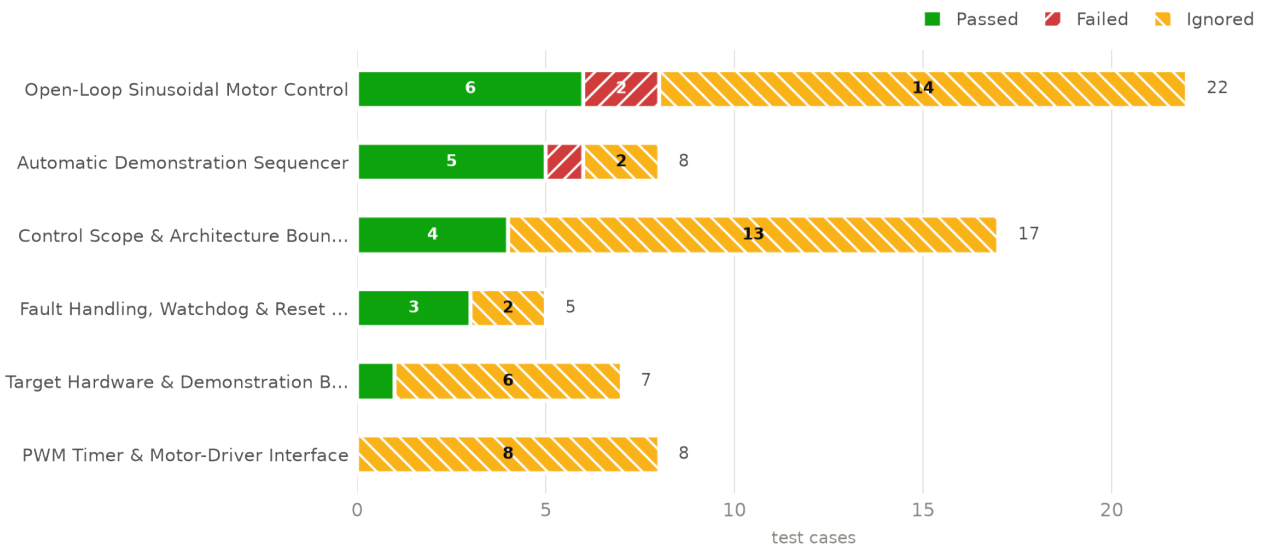

Firmware units verified by this suite

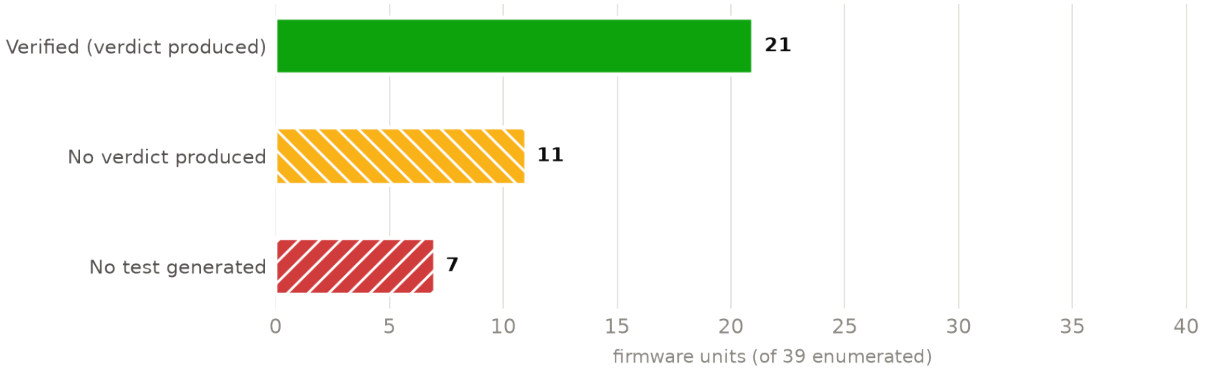

Where to focus next

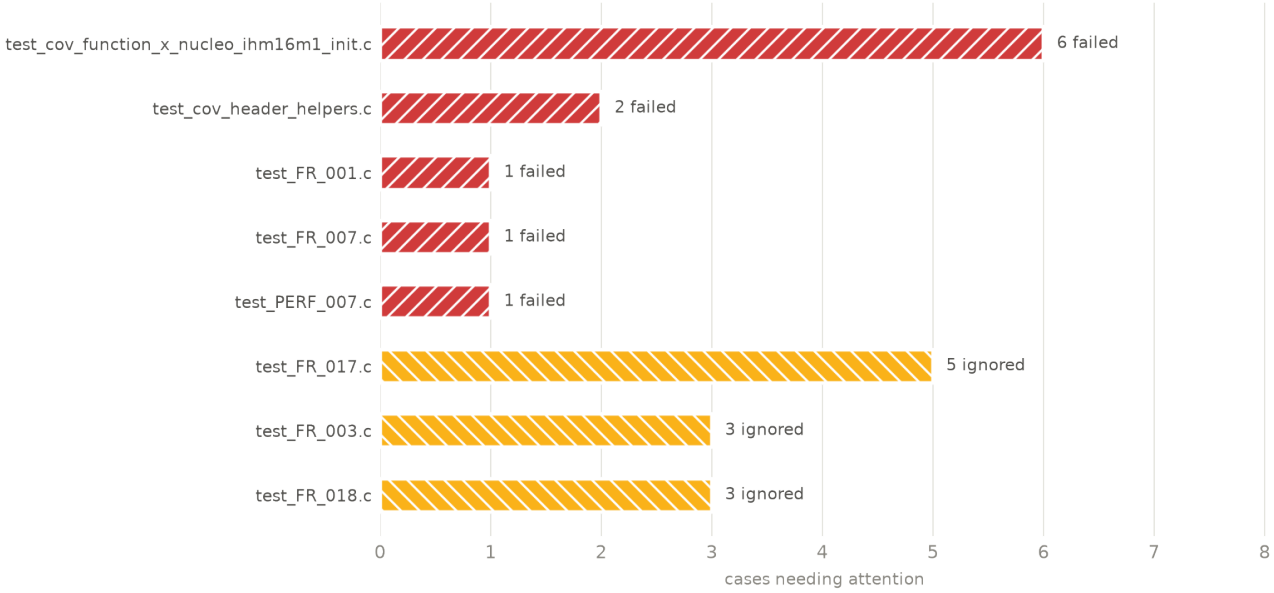

5. Traceability

The executed evidence traces 13 of 43 requirements and covers 67 requirement cases plus 108 coverage cases across 64 test files. The remaining 27 requirements are not yet passing, including 3 with assertions to address, while 45 cases remain not yet verified; this reflects a combination of open assertions and criteria requiring additional interfaces, measurements, source inspection or target execution.

Requirements traced to executed cases

Req. ID	Category	Module / symbol	Test file	Cases	Result
FR-002	Automatic Demonstration Sequencer	app_start +2 more	test_FR_002.c	1	PASSED
FR-009	Automatic Demonstration Sequencer	app_start +2 more	test_FR_009.c	1	PASSED
HW-003	Target Hardware & Demonstration B…	app_config.h	test_HW_003.c	1	PASSED
NFR-004	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_004.c	1	PASSED
NFR-008	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_008.c	1	PASSED
NFR-014	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_014.c	2	PASSED
PERF-002	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_002.c	1	PASSED
PERF-003	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_003.c	1	PASSED
PERF-004	Open-Loop Sinusoidal Motor Control	app_set_profile	test_PERF_004.c	1	PASSED
PERF-005	Open-Loop Sinusoidal Motor Control	app_set_profile	test_PERF_005.c	2	PASSED
PERF-006	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_006.c	1	PASSED
SF-001	Fault Handling, Watchdog & Reset…	app_start +2 more	test_SF_001.c	2	PASSED
SF-003	Fault Handling, Watchdog & Reset…	app_start +2 more	test_SF_003.c	1	PASSED
FR-003	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_003.c	3	IGNORED
FR-004	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_004.c	2	IGNORED
FR-005	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_005.c	2	IGNORED
FR-008	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_008.c	2	IGNORED

Req. ID	Category	Module / symbol	Test file	Cases	Result
FR-011	Automatic Demonstration Sequencer	app_start +2 more	test_FR_011.c	2	IGNORED
FR-015	Control Scope & Architecture Boun…	app_start +3 more	test_FR_015.c	2	IGNORED
FR-017	PWM Timer & Motor-Driver Interface	app_start +2 more	test_FR_017.c	5	IGNORED
FR-018	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_018.c	3	IGNORED
HW-001	Target Hardware & Demonstration B…	main	test_HW_001.c	1	IGNORED
HW-004	Target Hardware & Demonstration B…	app_config.h	test_HW_004.c	2	IGNORED
IF-003	PWM Timer & Motor-Driver Interface	motor_platform_drive +1 more	test_IF_003.c	1	IGNORED
NFR-001	Target Hardware & Demonstration B…	app_motor_step, app_start +1 more	test_NFR_001.c	1	IGNORED
NFR-002	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_002.c	1	IGNORED
NFR-003	Target Hardware & Demonstration B…	app_start +1 more	test_NFR_003.c	2	IGNORED
NFR-005	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_005.c	1	IGNORED
NFR-006	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_006.c	1	IGNORED
NFR-007	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_007.c	1	IGNORED
NFR-009	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_009.c	1	IGNORED
NFR-010	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_010.c	1	IGNORED
NFR-011	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_011.c	1	IGNORED
NFR-012	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_012.c	1	IGNORED

Req. ID	Category	Module / symbol	Test file	Cases	Result
NFR-013	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_013.c	1	IGNORED
NFR-015	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_015.c	1	IGNORED
NFR-016	Control Scope & Architecture Boun…	app_start +2 more	test_NFR_016.c	1	IGNORED
PERF-001	PWM Timer & Motor-Driver Interface	motor_platform_init	test_PERF_001.c	2	IGNORED
PERF-008	Open-Loop Sinusoidal Motor Control	app_start +1 more	test_PERF_008.c	2	IGNORED
SF-002	Fault Handling, Watchdog & Reset…	safety_platform_init +1 more	test_SF_002.c	2	IGNORED
FR-001	Open-Loop Sinusoidal Motor Control	app_drive_sine +2 more	test_FR_001.c	3	FAILED
FR-007	Open-Loop Sinusoidal Motor Control	app_set_profile	test_FR_007.c	2	FAILED
PERF-007	Automatic Demonstration Sequencer	app_start +2 more	test_PERF_007.c	1	FAILED

Firmware units traced to executed cases

Firmware unit	Kind	Test file	Cases	Result
app	module	test_cov_module_app.c	11	PASSED
board	header	test_cov_header_board.c	2	PASSED
board_name	function	test_cov_function_board_name.c	1	PASSED
motor_sequence_init	function	test_cov_function_motor_sequence_init.c	2	PASSED
motor_sequence_is_active	function	test_cov_function_motor_sequence_is_active.c	6	PASSED
motor_sequence_is_stopped	function	test_cov_function_motor_sequence_is_stopped.c	3	PASSED
motor_sequence_step	function	test_cov_function_motor_sequence_step.c	11	PASSED
safety_platform_check_fault	function	test_cov_function_safety_platform_check_fault.c	5	PASSED
safety_platform_disable	function	test_cov_function_safety_platform_disable.c	1	PASSED
sine_control	module	test_cov_module_sine_control.c	4	PASSED
sine_control_init	function	test_cov_function_sine_control_init.c	2	PASSED
sine_control_output	function	test_cov_function_sine_control_output.c	2	PASSED
sine_control_set_profile	function	test_cov_function_sine_control_set_profile.c	2	PASSED
sine_control_update	function	test_cov_function_sine_control_update.c	8	PASSED
x_nucleo_ihm16m1	module	test_cov_module_x_nucleo_ihm16m1.c	9	PASSED
x_nucleo_ihm16m1_handle_size	function	test_cov_function_x_nucleo_ihm16m1_handle_size.c	1	PASSED
x_nucleo_ihm16m1_read_sample	function	test_cov_function_x_nucleo_ihm16m1_read_sample.c	2	PASSED
x_nucleo_ihm16m1_set_pwm_mode	function	test_cov_function_x_nucleo_ihm16m1_set_pwm_mode.c	1	PASSED
x_nucleo_ihm16m1_set_standby	function	test_cov_function_x_nucleo_ihm16m1_set_standby.c	1	PASSED
helpers	header	test_cov_header_helpers.c	19	FAILED
x_nucleo_ihm16m1_init	function	test_cov_function_x_nucleo_ihm16m1_init.c	15	FAILED

6. Failure, Ignored Case, and Root-Cause Record

Scope / cases	Observed result	Suspected cause	Severity	Disposition
Header helper expectations helpers	test_helpers_11 observed 3 where 2 was expected, and test_helpers_19 observed 7 where 6 was expected.	The helper behavior and the test expectations differ by one in both cases. The supplied results do not identify whether the implementation, input setup or expected values require correction.	Low	Open; compare the helper contracts with the test inputs and expected values, correct the applicable side, and rerun the helper tests.
Shutdown ramp endpoint PERF-007	test_PERF_007_01 expected the final value to be 0 but observed 0.04999995 at the shutdown-ramp endpoint.	The shutdown calculation or endpoint sampling leaves a small nonzero residual at the expected end of the 2.0 s ramp, or the test samples before the final update is applied.	Medium	Open; review endpoint calculation and sampling order, then establish the intended zero-value assertion and rerun the case.
x_nucleo_ihm16m1_init behavior x_nucleo_ihm16m1_init	Six initialization cases reported expectation mismatches. Tests 10 and 11 expected 0 and observed 3; tests 12 and 13 expected 4 and observed 3; test 14 expected 6 and observed 3; test 15 expected 5 and observed 3.	The initialization return or status mapping observed by the tests does not match the configured expectations across these cases. The result does not by itself determine whether the implementation mapping, mock setup or expected status values are incorrect.	Medium	Open; review the initialization status contract and CMock setup for these six cases, then update the implementation or expectations as justified and rerun them.
Motor failure shutdown call expectation FR-001	test_FR_001_03 reported that motor_platform_enable was called fewer times than expected while verifying that a rotating-field failure disables PWM and aborts the sequence.	The observed call count does not match the expectation configured by the test. The supplied result does not establish whether the implementation behavior or the test expectation is the source of the mismatch.	High	Open; review the failure-injection path, expected motor_platform_enable call sequence and aborted-state observation, then rerun the case.
Hold-window frequency profile FR-007	test_FR_007_01 expected a frequency argument of 10 but observed 0 in a sine_control_set_profile call.	The profile value reaching sine_control_set_profile does not match the criterion's expected 10 Hz hold value, or the test is observing a different profile transition than intended.	High	Open; inspect the hold-window timing and profile-generation sequence, align the test observation with the intended 8 s to 18 s window, and rerun the case.

7. Limitations and Exclusions

This report states what the executed cases established. The boundaries below mark where off-target unit testing ends and other verification activities begin - they are the scope of this activity, not defects in it.

- These host-side tests do not prove electrical PWM frequency, duty-cycle waveforms, GPIO switching, motor motion or driver standby behavior on physical hardware.
- They do not verify MCU interrupt latency, watchdog reset behavior, boot timing or RTOS scheduling.
- They do not establish operation on the NUCLEO-G431RB, the 12 V supply condition, firmware programming or post-reset target execution.
- Criteria requiring absence across the complete source or configuration, such as omitted control algorithms and ADC or DMA paths, require source or configuration inspection beyond these executable unit tests.
- The off-target build does not replace target integration, hardware demonstration or physical measurement of the motor-driver interface.

8. Verification Status and Conclusion

Decision field	Conclusion
Verified scope	119 of 175 executed case(s) passed, covering 13 requirement(s) in full across 64 test file(s).
Outstanding items	Address the 11 cases with assertion mismatches, beginning with the motor-control shutdown and profile timing cases, the shutdown endpoint, the helper expectations and the x_nucleo_ihm16m1_init status mapping. Add or expose the interfaces and evidence needed for the 45 cases not yet verified, includ...
Conclusion	The activity provides executed evidence for 119 of 175 cases, 13 of 43 traced requirements and 21 of 39 enumerated firmware units. The strongest current evidence is in the automatic demonstration sequencer, control scope and architecture boundaries, and fault-handling categories, while PWM timer and motor-driver interface behavior has no passing case in this run. The next step is to resolve the 11 assertion mismatches and extend observability or use complementary verification layers for the cases that cannot be decided by host-side unit tests.

Generated automatically from the executed test results of run c90368d7-e128-4226-a220-fa1b59635fe4. The figures in this document are computed from executed_tests.xlsx; no count in it was written by a language model.

9. Appendix: Complete Case Record

Every case this run executed appears below, one row each - 175 in total, R1-R67 from the requirement suite and C1-C108 from the firmware-coverage suite. These are the rows every figure in Section 4 was counted from.

Case	Identifier	Test function	Result
R1	FR-001	test_FR_001_01	PASSED
R2	FR-001	test_FR_001_02	PASSED
R3	FR-001	test_FR_001_03	FAILED
R4	FR-002	test_FR_002_01	PASSED
R5	FR-003	test_FR_003_01	IGNORED
R6	FR-003	test_FR_003_02	IGNORED
R7	FR-003	test_FR_003_03	IGNORED

Case	Identifier	Test function	Result
R8	FR-004	test_FR_004_01	IGNORED
R9	FR-004	test_FR_004_02	IGNORED
R10	FR-005	test_FR_005_01	IGNORED
R11	FR-005	test_FR_005_02	IGNORED
R12	FR-007	test_FR_007_01	FAILED
R13	FR-007	test_FR_007_02	PASSED
R14	FR-008	test_FR_008_01	IGNORED
R15	FR-008	test_FR_008_02	IGNORED
R16	FR-009	test_FR_009_01	PASSED
R17	FR-011	test_FR_011_01	IGNORED
R18	FR-011	test_FR_011_02	IGNORED
R19	FR-015	test_FR_015_01	IGNORED
R20	FR-015	test_FR_015_02	IGNORED
R21	FR-017	test_FR_017_01	IGNORED
R22	FR-017	test_FR_017_02	IGNORED
R23	FR-017	test_FR_017_03	IGNORED
R24	FR-017	test_FR_017_04	IGNORED
R25	FR-017	test_FR_017_05	IGNORED
R26	FR-018	test_FR_018_01	IGNORED
R27	FR-018	test_FR_018_02	IGNORED
R28	FR-018	test_FR_018_03	IGNORED
R29	HW-001	test_HW_001_01	IGNORED
R30	HW-003	test_HW_003_01	PASSED
R31	HW-004	test_HW_004_01	IGNORED
R32	HW-004	test_HW_004_02	IGNORED
R33	IF-003	test_IF_003_01	IGNORED
R34	NFR-001	test_NFR_001_01	IGNORED
R35	NFR-002	test_NFR_002_01	IGNORED
R36	NFR-003	test_NFR_003_01	IGNORED
R37	NFR-003	test_NFR_003_02	IGNORED
R38	NFR-004	test_NFR_004_01	PASSED
R39	NFR-005	test_NFR_005_01	IGNORED
R40	NFR-006	test_NFR_006_01	IGNORED
R41	NFR-007	test_NFR_007_01	IGNORED
R42	NFR-008	test_NFR_008_01	PASSED
R43	NFR-009	test_NFR_009_01	IGNORED
R44	NFR-010	test_NFR_010_01	IGNORED
R45	NFR-011	test_NFR_011_01	IGNORED
R46	NFR-012	test_NFR_012_01	IGNORED

Case	Identifier	Test function	Result
R47	NFR-013	test_NFR_013_01	IGNORED
R48	NFR-014	test_NFR_014_01	PASSED
R49	NFR-014	test_NFR_014_02	PASSED
R50	NFR-015	test_NFR_015_01	IGNORED
R51	NFR-016	test_NFR_016_01	IGNORED
R52	PERF-001	test_PERF_001_01	IGNORED
R53	PERF-001	test_PERF_001_02	IGNORED
R54	PERF-002	test_PERF_002_01	PASSED
R55	PERF-003	test_PERF_003_01	PASSED
R56	PERF-004	test_PERF_004_01	PASSED
R57	PERF-005	test_PERF_005_01	PASSED
R58	PERF-005	test_PERF_005_02	PASSED
R59	PERF-006	test_PERF_006_01	PASSED
R60	PERF-007	test_PERF_007_01	FAILED
R61	PERF-008	test_PERF_008_01	IGNORED
R62	PERF-008	test_PERF_008_02	IGNORED
R63	SF-001	test_SF_001_01	PASSED
R64	SF-001	test_SF_001_02	PASSED
R65	SF-002	test_SF_002_01	IGNORED
R66	SF-002	test_SF_002_02	IGNORED
R67	SF-003	test_SF_003_01	PASSED
C1	app	test_app_01	PASSED
C2	app	test_app_02	PASSED
C3	app	test_app_03	PASSED
C4	app	test_app_04	PASSED
C5	app	test_app_05	PASSED
C6	app	test_app_06	PASSED
C7	app	test_app_07	PASSED
C8	app	test_app_08	PASSED
C9	app	test_app_09	PASSED
C10	app	test_app_10	PASSED
C11	app	test_app_11	PASSED
C12	board	test_board_01	PASSED
C13	board	test_board_02	PASSED
C14	board_name	test_board_name_01	PASSED
C15	helpers	test_helpers_01	PASSED
C16	helpers	test_helpers_02	PASSED
C17	helpers	test_helpers_03	PASSED
C18	helpers	test_helpers_04	PASSED

Case	Identifier	Test function	Result
C19	helpers	test_helpers_05	PASSED
C20	helpers	test_helpers_06	PASSED
C21	helpers	test_helpers_07	PASSED
C22	helpers	test_helpers_08	PASSED
C23	helpers	test_helpers_09	PASSED
C24	helpers	test_helpers_10	PASSED
C25	helpers	test_helpers_11	FAILED
C26	helpers	test_helpers_12	PASSED
C27	helpers	test_helpers_13	PASSED
C28	helpers	test_helpers_14	PASSED
C29	helpers	test_helpers_15	PASSED
C30	helpers	test_helpers_16	PASSED
C31	helpers	test_helpers_17	PASSED
C32	helpers	test_helpers_18	PASSED
C33	helpers	test_helpers_19	FAILED
C34	motor_sequence_init	test_motor_sequence_init_01	PASSED
C35	motor_sequence_init	test_motor_sequence_init_02	PASSED
C36	motor_sequence_is_active	test_motor_sequence_is_active_01	PASSED
C37	motor_sequence_is_active	test_motor_sequence_is_active_02	PASSED
C38	motor_sequence_is_active	test_motor_sequence_is_active_03	PASSED
C39	motor_sequence_is_active	test_motor_sequence_is_active_04	PASSED
C40	motor_sequence_is_active	test_motor_sequence_is_active_05	PASSED
C41	motor_sequence_is_active	test_motor_sequence_is_active_06	PASSED
C42	motor_sequence_is_stopped	test_motor_sequence_is_stopped_01	PASSED
C43	motor_sequence_is_stopped	test_motor_sequence_is_stopped_02	PASSED
C44	motor_sequence_is_stopped	test_motor_sequence_is_stopped_03	PASSED
C45	motor_sequence_step	test_motor_sequence_step_01	PASSED
C46	motor_sequence_step	test_motor_sequence_step_02	PASSED
C47	motor_sequence_step	test_motor_sequence_step_03	PASSED
C48	motor_sequence_step	test_motor_sequence_step_04	PASSED
C49	motor_sequence_step	test_motor_sequence_step_05	PASSED
C50	motor_sequence_step	test_motor_sequence_step_06	PASSED
C51	motor_sequence_step	test_motor_sequence_step_07	PASSED
C52	motor_sequence_step	test_motor_sequence_step_08	PASSED
C53	motor_sequence_step	test_motor_sequence_step_09	PASSED
C54	motor_sequence_step	test_motor_sequence_step_10	PASSED
C55	motor_sequence_step	test_motor_sequence_step_11	PASSED
C56	safety_platform_check_fault	test_safety_platform_check_fault_01	PASSED
C57	safety_platform_check_fault	test_safety_platform_check_fault_02	PASSED

Case	Identifier	Test function	Result
C58	safety_platform_check_fault	test_safety_platform_check_fault_03	PASSED
C59	safety_platform_check_fault	test_safety_platform_check_fault_04	PASSED
C60	safety_platform_check_fault	test_safety_platform_check_fault_05	PASSED
C61	safety_platform_disable	test_safety_platform_disable_01	PASSED
C62	sine_control	test_sine_control_01	PASSED
C63	sine_control	test_sine_control_02	PASSED
C64	sine_control	test_sine_control_03	PASSED
C65	sine_control	test_sine_control_04	PASSED
C66	sine_control_init	test_sine_control_init_01	PASSED
C67	sine_control_init	test_sine_control_init_02	PASSED
C68	sine_control_output	test_sine_control_output_01	PASSED
C69	sine_control_output	test_sine_control_output_02	PASSED
C70	sine_control_set_profile	test_sine_control_set_profile_01	PASSED
C71	sine_control_set_profile	test_sine_control_set_profile_02	PASSED
C72	sine_control_update	test_sine_control_update_01	PASSED
C73	sine_control_update	test_sine_control_update_02	PASSED
C74	sine_control_update	test_sine_control_update_03	PASSED
C75	sine_control_update	test_sine_control_update_04	PASSED
C76	sine_control_update	test_sine_control_update_05	PASSED
C77	sine_control_update	test_sine_control_update_06	PASSED
C78	sine_control_update	test_sine_control_update_07	PASSED
C79	sine_control_update	test_sine_control_update_08	PASSED
C80	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_01	PASSED
C81	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_02	PASSED
C82	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_03	PASSED
C83	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_04	PASSED
C84	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_05	PASSED
C85	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_06	PASSED
C86	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_07	PASSED
C87	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_08	PASSED
C88	x_nucleo_ihm16m1	test_x_nucleo_ihm16m1_09	PASSED
C89	x_nucleo_ihm16m1_handle_size	test_x_nucleo_ihm16m1_handle_size_01	PASSED
C90	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_01	PASSED
C91	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_02	PASSED
C92	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_03	PASSED
C93	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_04	PASSED
C94	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_05	PASSED
C95	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_06	PASSED
C96	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_07	PASSED

Case	Identifier	Test function	Result
C97	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_08	PASSED
C98	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_09	PASSED
C99	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_10	FAILED
C100	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_11	FAILED
C101	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_12	FAILED
C102	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_13	FAILED
C103	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_14	FAILED
C104	x_nucleo_ihm16m1_init	test_x_nucleo_ihm16m1_init_15	FAILED
C105	x_nucleo_ihm16m1_read_sample	test_x_nucleo_ihm16m1_read_sample_01	PASSED
C106	x_nucleo_ihm16m1_read_sample	test_x_nucleo_ihm16m1_read_sample_02	PASSED
C107	x_nucleo_ihm16m1_set_pwm_mode	test_x_nucleo_ihm16m1_set_pwm_mode_01	PASSED
C108	x_nucleo_ihm16m1_set_standby	test_x_nucleo_ihm16m1_set_standby_01	PASSED