



Learjet 60

Aircraft registration: FAC-1216

Aircraft Serial number: 317

CSN: 2682

TSN: 3648.04

Page **1** de **5**

FAC-1216 / MSN: 317 Print Date: 27-Nov-2024





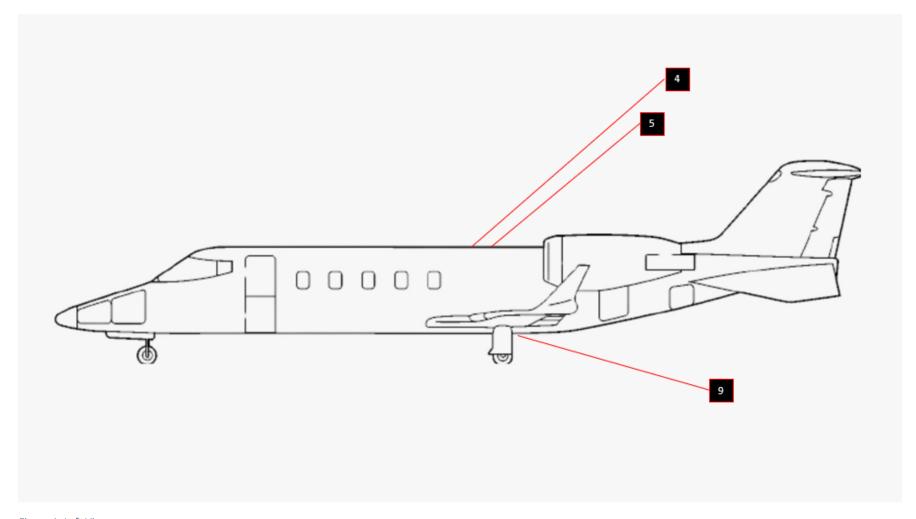


Figure 1. Left View.

Page **2** de **5**

FAC-1216 / MSN: 317	Print Date: 27-Nov-2024
---------------------	-------------------------





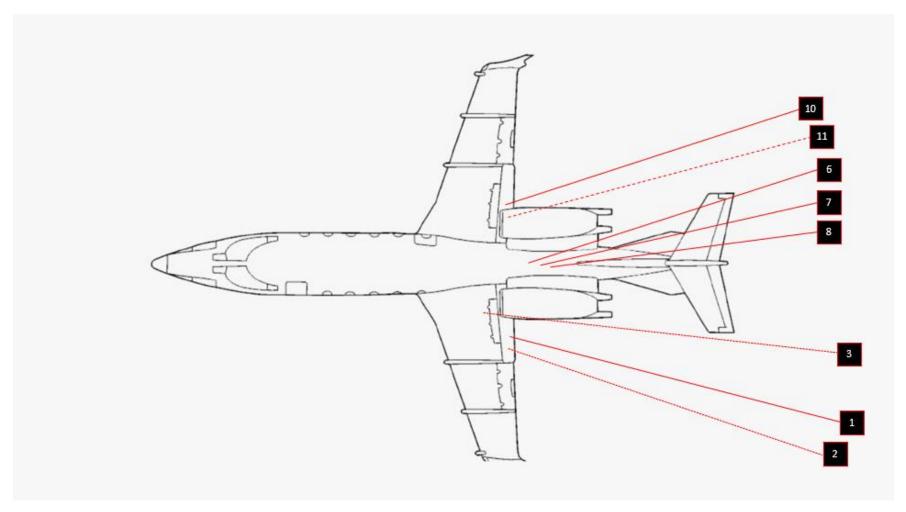


Figure 2. Upper View

Page **3** de **5**

FAC-1216 / MSN: 317 Print Date: 27-Nov-2024





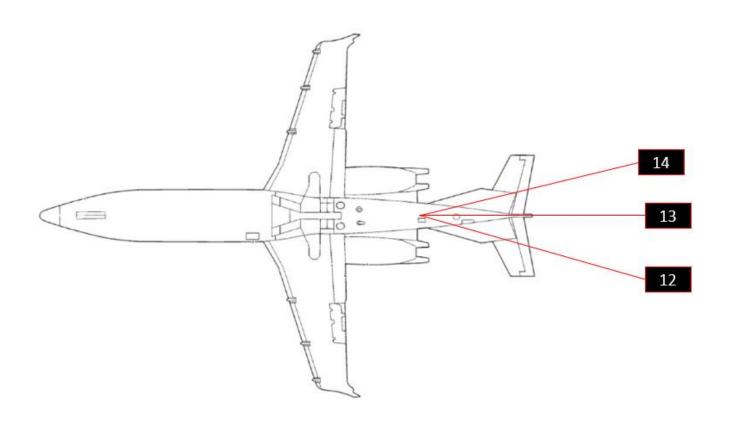


Figure 3. Down View

Page **4** de **5**

FAC-1216 / MSN: 317 Print Date: 27-Nov-2024





ITEM	TYPE OF DAMAGE	DESCRIPTION	LOCATION			0.0.451.0.0.0.0	2555251105		ACCOMPLISH	CTATUS	NEXT DUE
			FRAME	STRINGER	OTHER	DIMENSIONS	REFERENCE	LIMITATIONS	MENT DATA	STATUS	NEXT DUE
1	DENT	Dent in Flap upper area	Flap ST (86,50-95,30)	Spar 9R	Flap	L=9,3 H=9,3 D= 0,9 DR=90	SRM 57-50-00	N/A	N/A	CLOSED	N/A
2	DENT	Dent in Flap lower area	Flap ST R (104,2)	Spar (9-10)R	Flap	L=8,1 H=7,0 D= 0,57 DR =72	SRM 57-50-00	N/A	N/A	CLOSED	N/A
3	OTHER	Missing rivet in low wing area	WS 53,040	Spar 8-7R	Wing	N/A	N/A	N/A	N/A	CLOSED	N/A
4	DENT	Upper fuselage dent in oxygen duct	FR (25-27)	STR 1R-1L	Center Fuselage	L=6,8 H=4,6 D=0,37 DR=65	SRM 53-23-00	N/A	N/A	CLOSED	N/A
5	DENT	Upper fuselage dent in oxygen duct	FR (25-27)	STR 1R-1L	Center Fuselage	L=10,4 H=6,4 D=0,69 DR=58	SRM 53-23-00	N/A	N/A	CLOSED	N/A
6	DENT	Upper fuselage dent in oxygen duct	FR (33-34)	STR 1R-1L	Center Fuselage	L=16,4 H=11,8 D=0,97 DR=30	SRM 53-23-00	N/A	N/A	CLOSED	N/A
7	DENT	Upper fuselage dent in oxygen duct	FR (33-34)	STR 1R-1L	Center Fuselage	L=7,6 H=5 D=0,23 DR=26	SRM 53-23-00	N/A	N/A	CLOSED	N/A
8	DENT	Upper fuselage dent in oxygen duct	FR (33-34)	STR 1R-1L	Center Fuselage	L= 8,9 H=7,6 D=0,47 DR=16	SRM 53-23-00	N/A	N/A	CLOSED	N/A
9	DENT	Dent in the lower fuselage area	FR (28-27)	STR 22L	Center Fuselage	L=6,4 H=5,2 D=0,8	SRM 53-23-00	N/A	N/A	CLOSED	N/A
10	DENT	Dent in Upper Flap zone	Flap ST 77,70L	Spar 9L	Flap	L=8,9 H=7,8 D=0,33 DR= 16,2	SRM 57-50-00	N/A	N/A	CLOSED	N/A
11	DENT	Dent in Bottom area of the flap	Flap ST (42,15-31,35)L	Spar 9L	Flap	L=10,3 H= 8,4 D=0,77 DR=11,4	SRM 57-50-00	N/A	N/A	CLOSED	N/A
12	DENT	Dent Lower Tail cone RH	FR (44-42)	Lower Zone	Tail Cone	L=4,5 H= 2,3 D=0,77 DR=220	SRM 53-33-00	N/A	N/A	CLOSED	N/A
13	DENT	Dent Lower Tail cone RH	FR (44-42)	Lower Zone	Tail Cone	L=3.9 H= 2.8 D=0,2 DR=190	SRM 53-33-00	N/A	N/A	CLOSED	N/A
14	DENT	Dent Lower Tail cone LH	FR (44-42)	Lower Zone	Tail Cone	L=2.4 H= 1.7 D=0,05 DR=220	SRM 53-33-00	N/A	N/A	CLOSED	N/A