

SCUTTLE Mechanical Guide


revised 2022.11



In This Guide

- Mechanical Design Upgrades
 - ► Key upgrades between parts variants
- Mechanical Design Plans
 - Key upgrades coming soon
- Quality of Mechanical parts
 - Refined quality addressed by SCUTTLE Designers
 - ► How to check & countermeasure important qualityrelated items in your mechanical assemblies



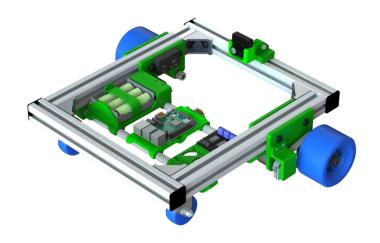

Part 1: Mechanical Upgrades

These slides show the mechanical improvements between design versions.


© 2022 SCUTTLE Robotics LLC

M6 Hardware:

SCUTTLE v2.3 to v2.4

- Replace 8 drop-in nuts with slide-in nuts
 - Easier assembly of wheel bracket
- Increase casters fasteners
 - From 2 sets to 3 sets per caster
 - (screw + washer + lock washer + drop-in nut)

Slide-in Nuts for Wheel Brackets

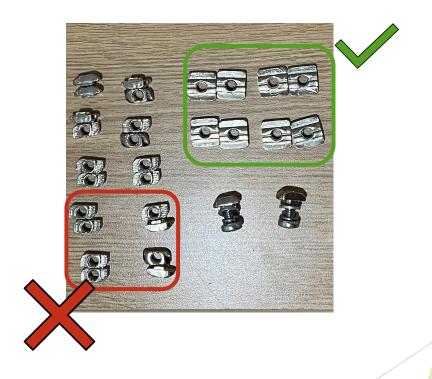

Extrusion Cap

- Extrusion caps aim to match the extrusion type
 - Asia: small center hole
 - North America: large center hole



Mcmaster holes around 7.12mm





© 2022 SCUTTLE Robotics LLC

AutomationDirect holes around 7.24mm





Caps with "X" cannot fit AutomationDirect Extrusion




BOM Changes

Coming soon: details on Bill of Materials Updates (dated 2022.10)



2022.08 SCTL Wrench v2

- Upgrade to v2 from v1
 - uses less material
 - accommodates just the latest tools
 - reduce leverage on the nut, reducing chance of over-torquing the wheel screw.

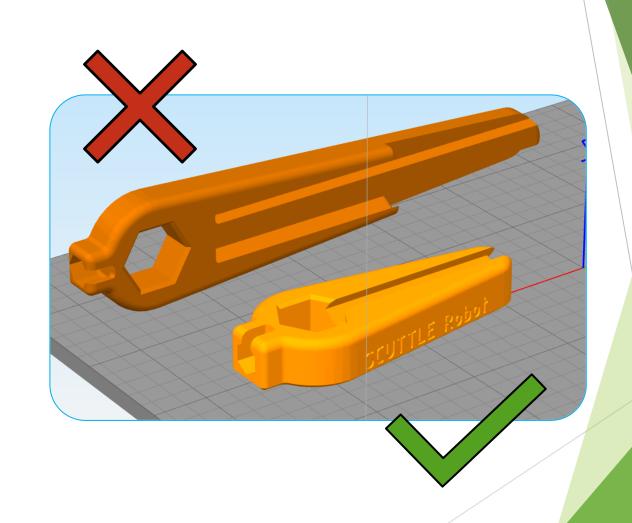


2022.04 Wheel Bracket v3.3


- Updated from v3.2
 - ► Lateral dimension increases from 2.2 to 3.0mm


Increase of the reach of the adhesion face to make more contact with urethane portion of the wheel.

0.80

1.00

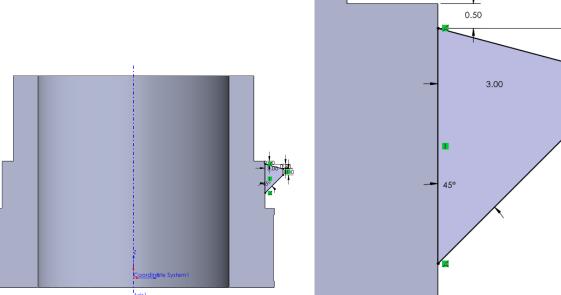


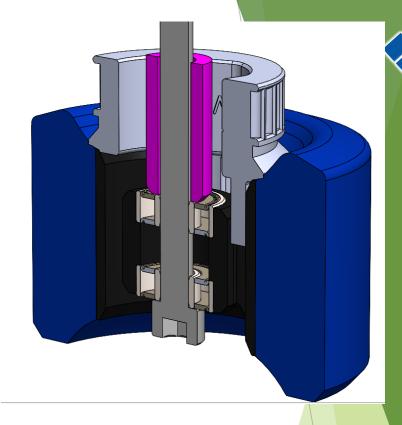

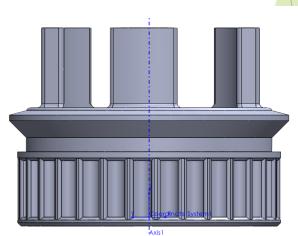

2022.08 Motor Driver Bracket v1.5


- Upgrade to v1.5 from v1.4
 - uses less material
 - holes chamfered for threaded inserts insertion
 - improved clearance for motor drivers pins

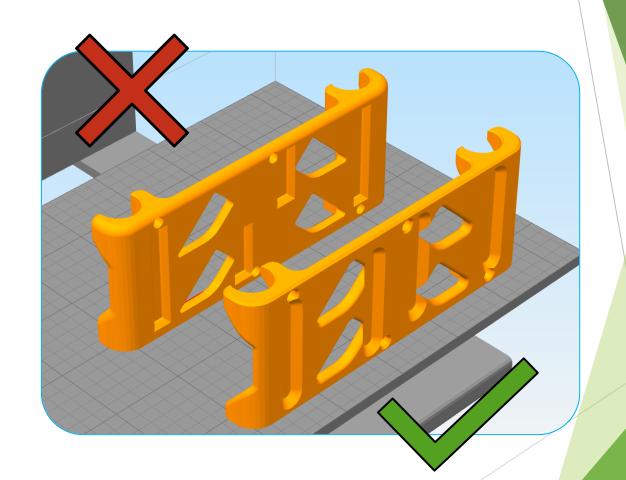




2022.07 Belt Assembly Countermeasure (pt1)


- Motor Pulley v3.2 updated to v3.3
 - base shelf is cleared so belts can move when the motor shaft length deviates.
- DM making countermeasures that eliminate the motor spacer requirement.
- Belt tension too high when the belt is slightly misaligned.

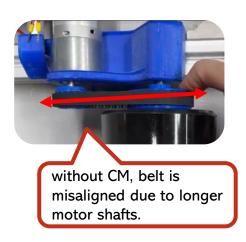

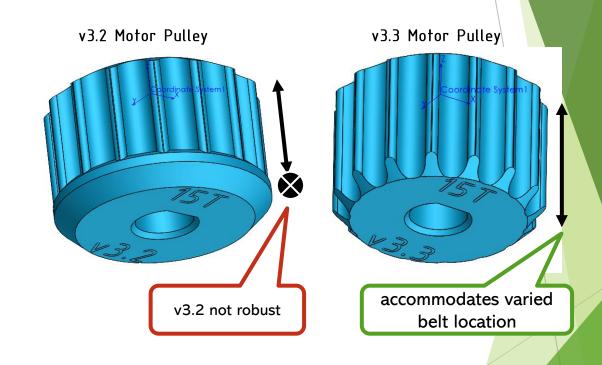


2022.07 Belt Assembly Countermeasure (pt2)

- Encoder Bracket variant created (v2.8)
 - reach is extended to accommodate motors with longer shaft.
 - This is an alternative to motor spacers
 - ► This variant is intended for bulk Malaysia motors from summer 2022
- Requires further verification for full assembly and for all motor variants.

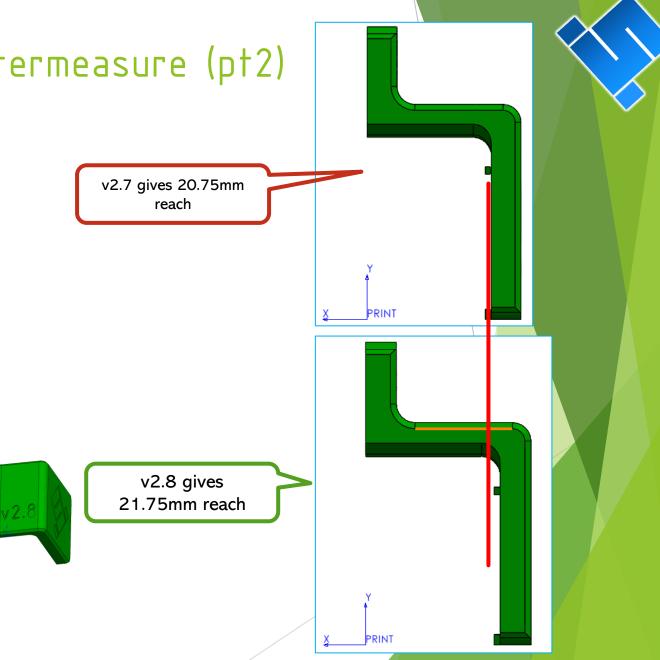

2022.06 M2.5 Screw Selection

- Encoder Bracket Screws:
 - Finer control of the head diameter
- Next Design
 - Migrate to flat heads for reduced stress
 - Update Encoder Bracket accordingly

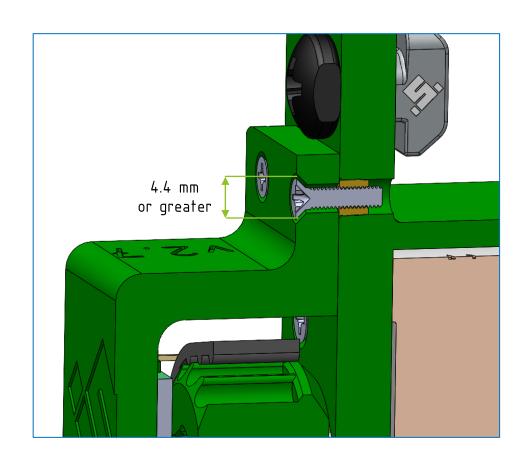




2022.06 Shaft Holes Spec

- The shaft hole diameter is critical.
 - The wheel bracket experiences impact when the robot drives on bumps.
 - Impact forces can be 100x the force of a static weight of your payload.
 - If the shaft diameter is smaller than the hole, the force concentrates on a very small region of the plastic material.
 - Pressure = Force / Area, and high pressure will yield in broken brackets.
- Shaft hole requires size "0" drill bit. The shank measures approx 7.96mm. The resulting hole (due to cutting mechanism) is around 8.02mm

shaft can wiggle in the hole when shaken.

If hole is oversized, resulting in loose fitment.

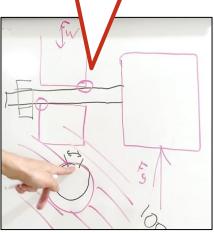



Holes made with size "o" drill









Encoder Assembly Dims (per CAD)

Item	Name	Design (mm)
0	shaft offset	19.5
Α	magnet gap	2.05
В	pulley offset	15.95
С	mag offset	15.18
D	belt gap	4.33

Design requires measurements of A and D to be controlled.

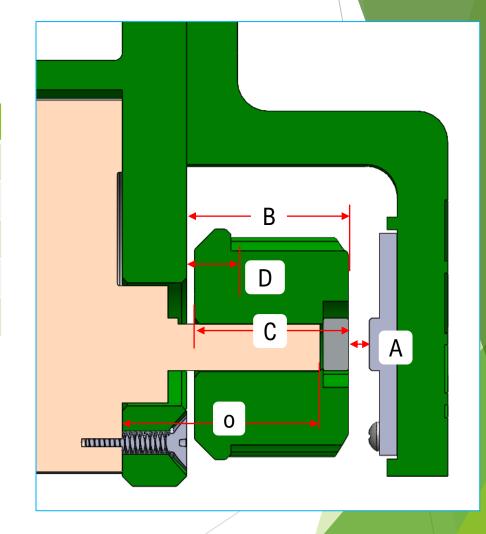

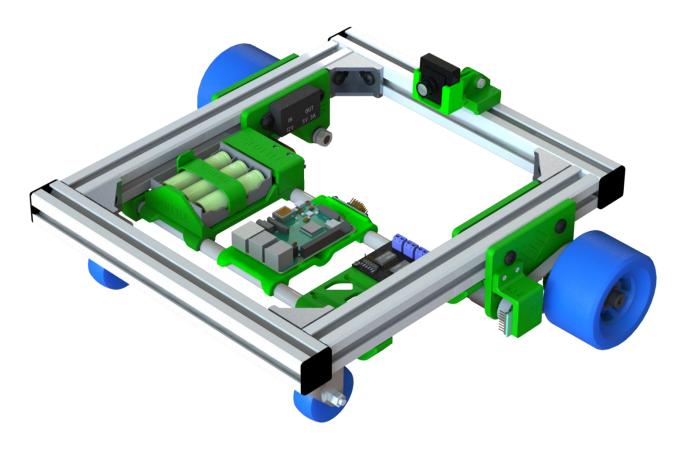

Part 3: Quality Verification

High quality of mechanical assembly is required for heavy payloads and refined robot control. Many of these details are unnecessary for beginners.

© 2022 SCUTTLE Robotics LLC

2022.06 Encoder Cables

- Beginners benefit from labels to decipher left and right cable assemblies.
- Encoders to have LH / RH stickers for customers to orient the assembly.
- Sticker is oriented upright and front facing when properly assembled.



Encoders sticker.






2022.06 Motor Pulley Fitment



- Motor pulley should press onto shaft with force F
 - ightharpoonup F_{min} = 5 Kgf
 - $F_{max} = 15 \text{ Kgf (updated 2022.07 DM)}$
- Test strategy:
 - 1) use a verified good printed pulley & test pressure on STANDARD motor
 - motor that we have already shipped or used multiple times
 - 2) use the same pulley (or pulley from same batch of prints) to test on the new shaft
 - make log of forces required
 - 3) if you press the pulley onto shaft 2x, then note if the force changes
 - this means that the plastic has worn during first insertion

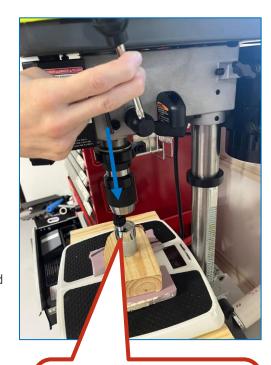

Apply static force by pressing, and measure the maximum force before the pulley slides onto the shaft.



Pulley requiring over 60 lbf (27Kg) of static force to press on

2022.08 Threaded Inserts

- Inserts do not protrude from bottom of the plastic.
- For thin brackets, use M2.5x4mm or shorter length of insert.











2022.08 PCB Pin Clearance

- Through-hole features on motor driver interfere with the bracket.
- For Assembled SCUTTLE, we install the motor driver & the pins must have clearance.
 - Verify the clearance for any assembled units made for demos or customers.
- If any PCB through-hole pins are contacting a plastic bracket, it is safe to snip the pins flush with the board.
 - This will not impact electrical performance.



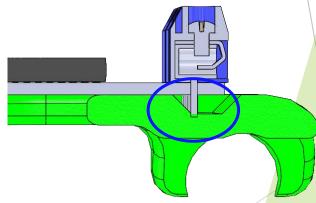

Motor Driver Bracket v1.5 improves clearance from v1.4





2022.11 M3 Motor Screws







- Design Spec uses M3x10mm
- Some variants use M3x8mm
 - ▶ Some variants have thinner gear cover.
- ISSUE:
 - ► Gearbox can be damaged if screw is too long



How to detect issue:

Proper condition	Problem condition	What's going on
M3 screws turn freely until they clamp wheelbracket to motor face	Screws have extra friction while tightening.	Screws are contacting gearbox faceplate.
After fastening three motor screws, motor is firmly fastened.	Motor can wobble against face of wheel bracket.	Screws bottomed out against the gear plate.
After wheel bracket assembly is built, motor shaft parallel to wheel axle.	Motor and shaft are not parallel.	Screws are not clamping the motor against the bracket face.
After assembly, wheels can turn by hand. Equal torque to backdrive Left/right/fwd/back.	Backdriving wheels takes more than a gentle twist. Motor takes >6 volts to turn.	Screws are binding the gearbox.



Damaged Motor Gear Assembly

© 2022 SCUTTLE Robotics LLC