RANK FRIENDLY

Weekly Update: Next Partitions

October 26, 2026 · Week of October 20

This week we moved from the installer directory to your website itself: the month-one site work from our proposal. **None of this is on nextpartitions.com yet.** The new pages, fixes and drawings live on our side for now, in our working copy of the site. They go live once we can merge them into Marc's code, which needs the access below.


What we did this week

1. **Your broken pages, fixed.** Three pages a buyer (and Google) currently hits as dead ends now have content ready:
   - **Guides** (blank today): a hub page that leads to your four guides.
   - **Blog** ("Coming Soon" today): opens with its first two articles, *What Are Bathroom Partitions Made Of?* and *Why Do Bathroom Stalls Have Gaps?*
   - A blog link in your sitemap that points to a missing page: Marc removes it.
2. **Your thinnest pages, rewritten.** The hardware section (6 pages) and the mounting-style section (5 pages) went from 136–291 words to 900–1,200 each. They now answer what buyers search for: hinges, latches, replacement doors, and how each mounting style is built. Each page has its own questions-and-answers section and lists its sources. The search terms come from your February keyword research (for example "restroom stall doors", 720 searches a month).
3. **Errors found on the current site, corrected in the new pages.** We checked your pages against the manufacturers' data sheets and the building codes. Some statements were wrong in ways a contractor or architect would notice:
   - **Hinges:** a spring hinge is called the US standard. The standard on the lines we checked is a gravity (cam) hinge, which uses the door's weight; Bobrick's data sheet, for example.
   - **Latches:** a paddle latch is said to be required for accessible stalls. No accessibility code requires one: the hardware only has to work without tight grasping or twisting, and Bobrick's standard slide latch meets that.
   - **Fire rating:** solid plastic is recommended for schools and gyms with no mention of fire ratings. Building codes require solid plastic partitions to pass the NFPA 286 fire test, and not every standard color does.
   - **Urinals:** the layout guide gives 13–15" from a side wall and 24–30" between urinals. The plumbing code minimum is 15" and 30".
   - **Accessible stalls:** all six industry pages describe them wrongly, mostly as needing a 36" outswing door. The ADA asks for a 32" minimum clear opening and a door that doesn't swing into the stall's minimum space.


   On the six industry pages we checked 128 statements: 26 need fixing, and the corrected wording is written out for each one.

4. **Technical drawings, in your brand.** Buyers think in pictures, and your pages had none. We set a drawing style for Next Partitions, built on your site's colours and font, that looks like a manufacturer's spec sheet. Then we made 29 drawings for the new pages:
   - A full data sheet for each mounting style: stalls from above, from the front and from the side, with close-ups of the anchors, headrail and brackets.
   - Hinge types, how to measure a replacement door, and the four gaps in a stall.

   The stall layout and the close-ups follow Bradley's and Bobrick's published data sheets, and every measurement comes from them or from the ADA standards.

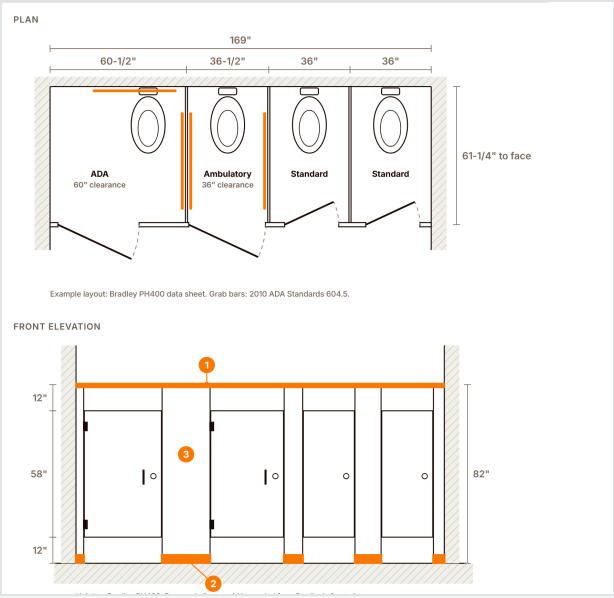

Overhead-braced stalls: from above and from the front.

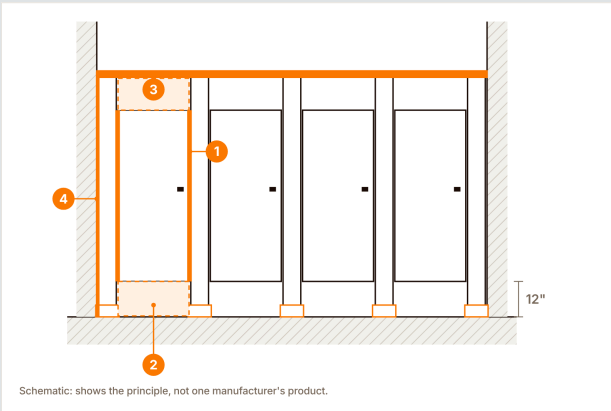

For the blog: the four gaps in a standard stall.

5. **The installer directory, as one working prototype.** All the directory pages from last week's report now link together, so you can click through a whole job: a customer's quote, an installer's portal, your team's view and the installer sign-up. Changes since last week:
   - A shorter installer application (4 steps; rates come later).
   - Two labels: **Verified** when an installer is listed, **Approved** after their first completed job.
   - The quick pricer asks three questions before it shows a price range.
   - The installation step in Marc's configurator is kept for a later phase.
   - We run the job coordinator role for you at first, until leads come in regularly.

   Open the prototype

6. **Job emails, automatic.** The directory now sends its own emails at each step: job requests and reminders to installers, the customer's quote link, and alerts to the job coordinator. Installers never get the customer's details before the customer has chosen them and paid.

What we need from you

1. **Your OK on the installer directory.** Have a click through the prototype. If referral-only with the Verified and Approved labels works for you, we can start recruiting installers in your first area.
2. **Price ranges for our cost guide.** The cost guide is the most-searched article on the plan. Per-stall ranges by material are enough; the figures you're giving Marc for the product pages work.
3. **One set of budget ranges and lead times.** Your pages currently give different figures for the same thing (for example powder coated per stall). We'll make every page match yours.

4. **Job photos you have the rights to use.** Real installs beat any drawing or stock photo, for buyers and for Google.
5. **For Marc:** write access to the site's code and an invite to the Lovable project (asked on October 16), so we can merge this week's pages into his code for him to publish. Until then they stay on our side.

Coming next

1. **New pages live:** merged into Marc's code and published, as soon as we have access.
2. **Material pages**: correct the fire ratings and warranties, with a cross-section drawing for each material.
3. **One quote promise everywhere**: standard configurations within 2 business hours, custom projects within 24–48 hours (your site shows four different times today).
4. **Next articles**: standard stall sizes and dimensions (1,000 searches a month), illustrated with the new drawings.
5. **Google Business Profile**, now that a printed sign on the door works for verification.

Sample installers, prices and reviews in the prototype are made up.