


7-18


($A_x = 0$ since no x loading on frame)

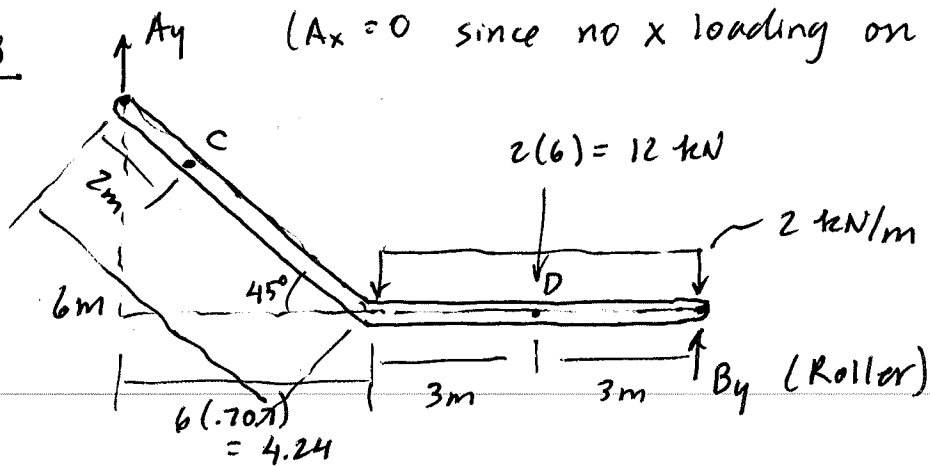

$$+\uparrow \Sigma M_A = 0; \quad 12(4.24 + 3) - B_y(4.24 + 6) = 0$$

$$B_y = 8.484 \text{ kN}$$

$$A_y = 3.516 \text{ kN}$$

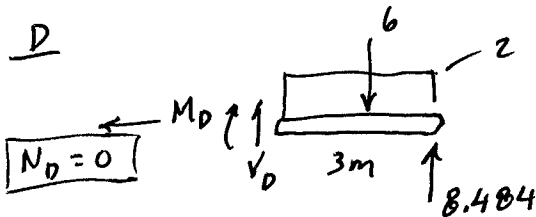


$$+\uparrow 8.484 - 6 + V_D = 0$$

$$V_D = -2.484 \text{ kN}$$

$$+\uparrow \Sigma M_{\text{cut}} = 0; \quad M_D + 6(1.5) - 8.484(3) = 0$$

$$M_D = 16.45 \text{ kN}\cdot\text{m}$$

$$N_D = 0$$

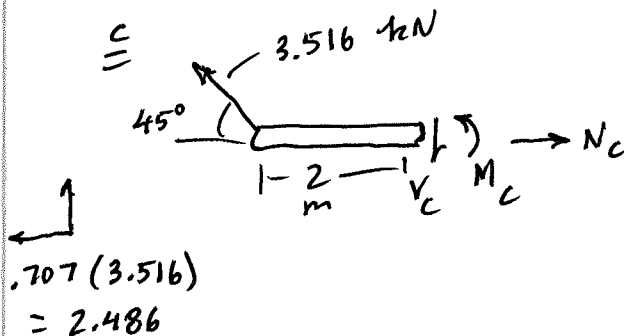


$$+\uparrow -V_C + 2.49 = 0$$

$$V_C = 2.49 \text{ kN}$$

$$N_C = 2.49 \text{ kN} \quad (\text{T})$$

$$+\uparrow \Sigma M_{\text{cut}} = 0; \quad M_C - 2.486(2) = 0$$

$$M_C = 4.97 \text{ kN}\cdot\text{m}$$

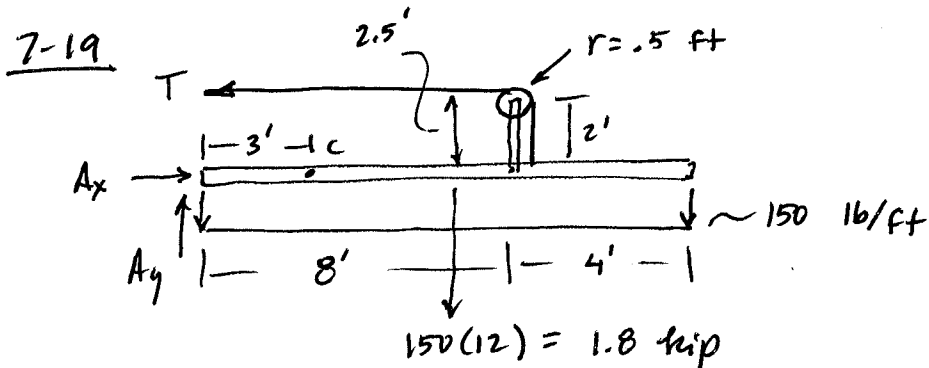


$$+\circlearrowleft \sum M_A = 0; \quad 1.8(6) - T(2.5) = 0;$$

$$T = 4.32 \text{ kip}$$

$$A_x = 4.32 \text{ kip} \rightarrow$$

$$A_y = 1.8 \text{ kip} \uparrow$$

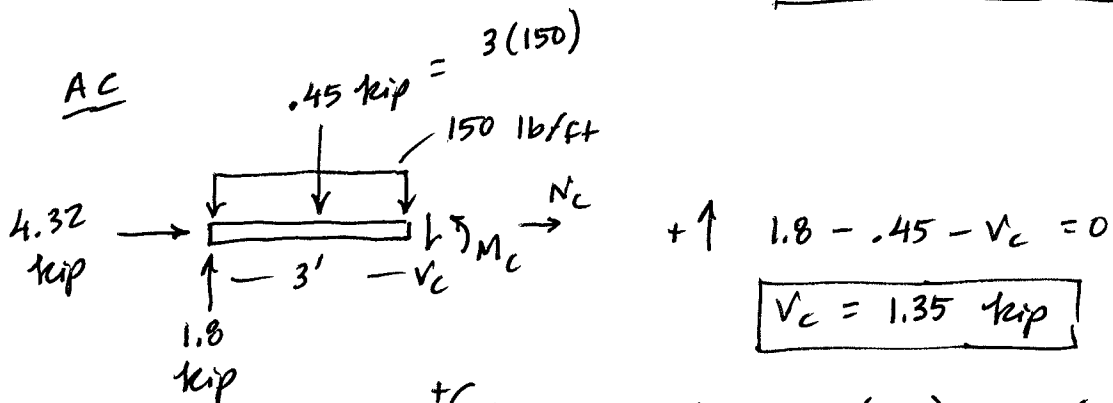

$$V_c = 1.35 \text{ kip}$$

$$+\circlearrowleft \sum M_c = 0; \quad M_c + .45(1.5) - 1.8(3) = 0$$

$$M_c = 4.725 \text{ kip}\cdot\text{ft}$$

$$N_c = -4.32 \text{ kip}$$