
3D PRINTING

(FLASHFORGE AD5X)

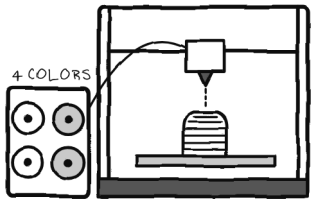

IT MELTS PLASTIC AND STACKS IT ONE THIN LAYER AT A TIME, IN UP TO 4 COLORS. IT'S **HOT AND OPEN**, SO READ THIS BEFORE YOUR FIRST PRINT.

1 HOW TO PRINT

1 GET YOUR FILE
AN STL IN MM THAT FITS IN A 220 MM CUBE.

2 SLICE IT
ORCA-FLASHFORGE: PICK AD5X, 0.4 NOZZLE. LAY IT FLAT. SUPPORTS PAST 45°.

3 CHECK THE PREVIEW
FIRST LAYER, TIME + GRAMS. SHOW MR. LEWIS BEFORE YOU SEND IT.

4 PREP THE PRINTER
PLATE CLEAN, FLAT ON THE MAGNETS, NO FINGERPRINTS. RIGHT FILAMENT LOADED.

5 WATCH IT START
STAY FOR THE FIRST 5 MINUTES. BAD FIRST LAYER? STOP IT EARLY.


6 POP IT OFF
LET IT COOL, FLEX THE PLATE. SAFETY GLASSES TO SNIP SUPPORTS.

2 PICK YOUR FILAMENT

FILAMENT	USE IT FOR	NOZZLE / BED °C	KNOW THIS
PLA (DEFAULT)	ALMOST EVERYTHING	190-220 / 55-65	EASIEST. MELTS IN A HOT CAR.
PETG	CLIPS, HOOKS, OUTDOOR STUFF	230-250 / 70-80	TOUGHER. GLUE STICK ON THE PLATE.
TPU	BENDY: BUMPERS, GRIPS	220-235 / 40-60	PRINT SLOW. ONE COLOR ONLY.
ABS / ASA	NOT IN THIS ROOM	-	FUMES + WARPING. PRINTER IS OPEN.

THE SPOOL LABEL WINS. KEEP SPOOLS SEALED IN A BAG SO THEY STAY DRY.


3 DESIGN RULES



FLAT SIDE DOWN
BIGGEST FLAT FACE ON THE PLATE



WALLS 1.2 MM+
THINNER SNAPS OR WON'T PRINT



GAP 0.2-0.3 MM
BETWEEN PARTS THAT FIT



45° MAX
STEEPER NEEDS SUPPORTS



DETAILS 0.6 MM+
GAPS 0.5 MM+. TEXT 5 MM TALL



COLOR ON TOP
EACH CHANGE WASTES PLASTIC

STAY SAFE

HOT!

- ! NOZZLE 300°C, BED 110°C. HANDS OFF WHILE IT RUNS.
- ! HAIR, HOODIE STRINGS + LANYARDS BACK.
- ! NEVER REACH IN MID-PRINT.
- ! NEVER LEAVE IT RUNNING ALONE.
- ! WEIRD SMELL OR SOUND? STOP IT, GET MR. LEWIS.

4 UH OH

WON'T STICK
WASH THE PLATE: DISH SOAP + WATER. ADD A BRIM.

SPAGHETTI
STOP IT. THE FIRST LAYER CAME LOOSE. CLEAN + RETRY.

HAIRY STRINGS
WET FILAMENT. DRY IT, OR DROP THE NOZZLE 5-10°.

JAM OR ERROR
DON'T FORCE IT. STOP AND GET MR. LEWIS.