Register the robot table

Quest 3 / Operator reference for the two-arm station

Face the table from the long edge carrying the two arms.

Read left and right from this position. The marks below are features on the station.

Factory mounting holes

Use the same three outer holes on both fixed flanges. Identify the near row first.

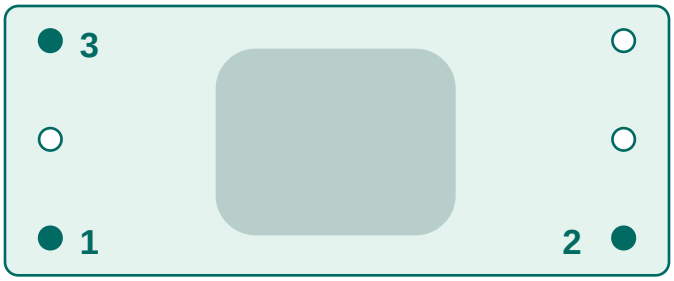

1 Near left

2 Near right

3 Far left

Columns are 180 mm apart. Outer rows are 80 mm apart. Diagram is schematic.

Capture sequence

L1, L2, L3 / R1, R2, R3 / A, B, C, D / Floor

Then touch each parked tool-center witness. Walk to a different viewpoint and repeat L2 and R1. Both robots must stay stationary throughout.

Before the audience sees the feed

Use Recheck both mounts. In the cast window, look for a real hand or room feature and the virtual robot at the same time. Keep the tested local pitch clip ready.