

Sensor Cable Assembly Specifications

Wind Direction Sensor:

Device: InSpeed e-Vane II Electronic Wind Direction Sensor

Connector: M12, 5 pos


Connector PN: T4111001051-000

Cable Length: 5m

Pinout:

Pin	Wire
1	Red
2	DNP
3	Black
4	White
5	DNP

Appendix A: Installation of M12 Connector

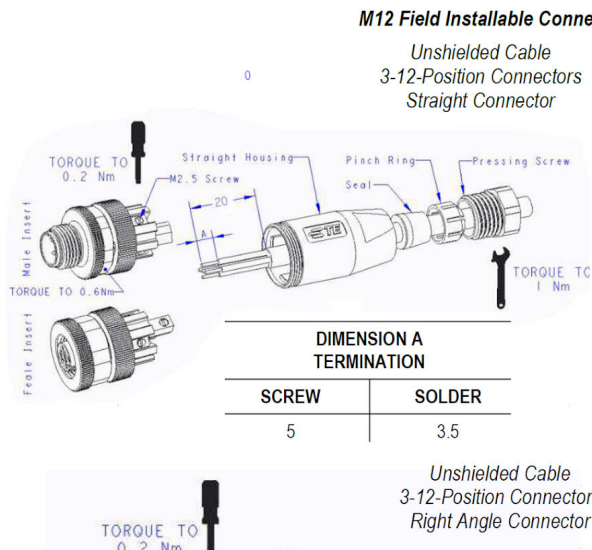

1. Connector components install on cable
2. Cable jacket should be stripped as shown
3. For 3-8-position, install wire to correct insert position (wire plug should be preferred to crimp on the wire)
4. Turn the M2.5 screw with suitable tool, torque to 0.2Nm [1.77 in.-lb.]
For 12-position, sold the wire
5. Install straight housing
6. Install seal, pinch ring, pressing screw
7. Pressing screw should be tightened with torque recommended as 1 Nm [8.85 in.-lb.]
8. Cable outlet: PG7 (cable feed: 4-6mm)
PG9 (cable feed: 6-8mm)

Taken from:
https://www.te.com/commerce/DocumentDelivery/DDEController?Action=showdoc&DocId=Specification+Or+Standard%7F114-137144%7FA7%7Fpdf%7FEnglish%7FENG_SS_114-137144_A7.pdf%7FT4111001051-000