

Support Support : Visualizing Part Orientation and Effects Thereof for 3D Printing

Valkyrie Savage & Derrick Cheng

University of California, Berkeley

Berkeley Institute of Design, Computer Science Division

{valkyrie,derrick}@eecs.berkeley.edu

ABSTRACT

3D printers proliferate, yet every step leading from idea to print is too complicated for all but dedicated users to perform. Those creating 3D printable objects have many concerns related to how the printing will go. While very fancy printers have multiple material capabilities and easy-dissolve supports, hobbyist-level machines are typically limited to a single material used for both the model and the model supports. Thus, one common user concern is how difficult support removal will be; this is based on the angle of attachment between model and support (e.g. removing support oblique to the model is more difficult), the accessibility of the area of support material (e.g. support is easy to remove from a flat, exposed surface and more difficult to remove from a curved surface partially obscured by other faces), and the amount of support (e.g. more support takes longer). Another common concern is the total printing time; users don't necessarily want to wait for long prints. A third issue is material waste; excess support material used in a print must be thrown away and cannot be used again. Finally, users may have areas of high detail in which they do not want to have support in their final prints, as support removal can break or damage finely-details surfaces. Unfortunately, these four issues are often at odds, and all depend upon the model's orientation in the bed. We have designed a tool which automatically generates several random model orientations and calculates statistics for each of these four metrics. We present these calculations to the user in an interactive web-based tool.

Author Keywords

Prototyping; Fabrication; 3D Printing

ACM Classification Keywords

H.5.2 User Interfaces (D.2.2, H.1.2, I.3.6): Prototyping

General Terms

Design, Human Factors

INTRODUCTION

3D printing has become an entrenched part of the prototyping process for professional industrial designers, and thanks to patent expiry it has begun to proliferate as a practice among hobbyists. However, there are many important differences in the ways that printers are used between these two groups.

The most important practical differences are related to machine specifications. FDM-style 3D printers (popular among both hobbyists and professionals) work by laying down layers at a time of a typically plastic-like material, melting it out in strands and fusing each layer to the previous one. This only works if there is something in the layer underneath: in 3D printing culture, this is known as the 45 degree rule. Overhang angles in an FDM part cannot be greater than 45 degrees without support material underneath. Here is the difference between hobbyist and professional machines: professional machines offer *two different* materials, one for the model and one for support. In this design, the support material is created to dissolve or melt, so that the final model part is simple to extract. In contrast, hobbyist-level printers are limited to just *one*. This means that extracting the model from the support material can be a time-consuming process, which is potentially damaging to the model itself.

Another crucial difference between the machines used by hobbyists and professionals is their *reliability*. A professional can typically start a print and walk away, allowing it to run its course. In contrast, hobbyist machines must be carefully observed until at least two layers have been laid down, to ensure that the print sticks to the bed correctly and that the calibration of the machine is correct. As such, time invested in a print on a hobbyist machine is much more precious, and many hobbyist 3D printers are loath to run extended unsupervised print jobs.

Other differences between professionals and hobbyists are in the types and complexities of models they design, the tools they use for design, and in their uses of the final artifacts. However, we selected to focus on the support material for our visualization topic.

Several things arise in conversations about support material, including time to print, support material volume, difficulty or time to remove support material, and faces covered in support material.

Time to Print

The time it takes for a part to print on FDM-style machines increases monotonically (but not linearly) with the amount of material required in a print. As mentioned, hobbyists prefer not leaving printing models unattended for extended periods of time.

Support Material Volume

Support material from hobbyist-level printers cannot be recycled as yet. Some support materials, for example PLA which is produced from corn, are biodegradable, however the most popular material—ABS—creates waste that does not degrade easily. Support material is also not free, and costs a set amount per unit volume used in a print. Hobbyists are in general sensitive to wasting money and creating waste, so the volume of support material printed is a concern for them. Irrespective of the orientation of the model, the volume of material used for the model does not change, so this can be disregarded.

Support Material Removal

Removal of support material is an issue for hobbyist machines. Because support is fabricated of the same material as models, separating support layers from model layers can be challenging. The main issues that contribute to support material removal time are surface area of model contacted by support material, angle of incidence of support material on model, surfaces affected by support material, connected components of support material, curvature of surface contacted by support material, and accessibility of support material.

Surface Area

The surface area of a model contacted by support material is directly proportional to the support removal time. Larger surface areas in contact with support lead to longer removal times.

Angle of Incidence

The angle at which support contacts model affects support removal time. Support which has a contact of 90 degrees is significantly easier to remove than support contacting at an oblique angle.

Affected Faces

Because the support material removal process can be rough, model makers may orient a model in order to keep faces with small details support-free to avoid damaging them.

Connected Components

Support material adheres well to itself, and is easiest to pull off as larger chunks. The more connected components there are created in support material for a model, the longer it will take to remove because leverage from one component can't be applied to another.

Curvature

Model surfaces don't always have smooth and slight curves. When printing a model like a person's head, quickly-varying curvature over the surface makes material more difficult to remove. Smooth curves over large areas are easy to pry support from, however detailed peaks and valleys in small spaces are more difficult to extract support from.

Accessibility

3D printers have opened up worlds beyond traditional manufacturing processes, and many objects that can be fabricated with a 3D printer cannot be fabricated with any other type of machinery. Designs can have completely enclosed, freely-moving parts, printed-in-place mechanisms like hinges or chain links, or any of a number of other interesting configurations. To allow these types of creations to be printed, support material is sometimes very difficult to access from the outside of a model.

We did not have time to focus on all of these metrics, however we have created a visualization tool for 3D designers to explore *time to print*, *support material volume*, *surface area*, *angle of incidence*, and *affected faces*.

RELATED WORK

There are two main areas of work which we build off for Support Support. The first is visualization design and sampling over multidimensional spaces. The second is in actual 3D printing tools.

Visualization Design

In terms of visualization design, there are multiple prior works in the space of multi-dimensional sampling and optimization.

The most crucial works are on evenly sampling the surface of a sphere. The 6D position of a 3D print is reducible to the three directional dimensions, since location in X, Y on the print bed does not affect print time or support, and, since by increasing Z we only cause more support structure to be created underneath, we can safely assume that Z position will be as close to 0 as possible.

Randomly sampling that 3-dimensional space is a spherical point picking problem. Spherical point picking has been studied previously by mathematicians. To pick a random point on the surface of a unit sphere, it is incorrect to select spherical coordinates θ and ϕ from uniform distributions θ in $[0, 2\pi)$ and ϕ in $[0, \pi]$, since the area element $d\Omega = \sin\phi d\theta d\phi$ is a function of ϕ , and hence points picked in this way will be "bunched" near the poles [9]. In [5] Marsaglia offers an elegant way of selecting randomly distributed points on the surface of a sphere: in essence, two numbers x_1 and x_2 are chosen from independent uniform distributions on $(-1, 1)$ and pairs that do not satisfy $x_1^2 + x_2^2 < 1$ are rejected. Points x , y , and z are then created with $x = 2x_1\sqrt{1 - x_1^2 - x_2^2}$, $y = 2x_2\sqrt{1 - x_1^2 - x_2^2}$, $z = 1 - 2(x_1^2 + x_2^2)$.

We initially built off this work, however with further literature and practical review we realized that in 3D printing it is not actually a sphere that is optimized over! A 2-dimensional square will do. Rotation about the z-axis (yaw) does not affect support material usage, accessibility, or any of our other metrics.

Multidimensional sampling and optimizations have been explored in visualization previously, as mentioned. The foundational work on this was Design Galleries [4]. Marks, et

al., sampled their multidimensional spaces before a user interacted with their system, generating a projection of the sampled functions into a 2D grid with points where their samples came from. Users could click on sampled points to see the results of rendering a digital scene with those parameters. We leverage this technique for the design of our visualization, and we extend their work by focusing also on distributions of several numerical measurements unrelated to the visual look of a generated sample.

3D Printing

There are numerous tools available for free or a fee which assist users with certain tasks in 3D printing. These tools are mostly focused on offering flexibility for users to customize their prints, rather than comparing different options.

The usual stages a user goes through to 3D print a model are orient, slice, and print. Some typical examples of interfaces that users use for this are Cura [1] and Willit 3D Print [8]. Cura and Willit are frontends which allow the user to freely rotate their model in space, and which can then call slicers.

Slicers are programs which cut the 3D model into "slices", determine where support is necessary (i.e. where model overhang is greater than 45 degrees), and generate toolpaths through which the printer head will move during the printing process. They are typically separate from the frontend orientation programs. Two example slicing engines are Cura Engine [2] and Skeinforge [7].

Designers usually use their orientation frontends to interface with their printers. They send the slicer-generated GCode instructions to the printer for execution.

Some services, e.g. Shapeways [6] and the aforementioned Willit, offer boolean "will it print" answers. Users can upload a model and are informed whether it will print by their selected process. Examples of features which could prevent printability are very thin features (i.e. which are too thin to recreate with the printer's filament) or very large objects (i.e. which do not fit in the printer). We go beyond this binary yes/no to offer more feedback on a printable objects' properties along particular dimensions.

Fabrication and Visualization

There has been little work in this area of intersection, Jansen, et al., in [3] explored 3D-printed visualizations of bar charts and how their physicality influenced time required and accuracy attained for users to read values, comparing the physical visualizations to digital and AR visualizations. Our work is focused on generating visualizations about fabrication, rather than visualizations with fabrication.

SUPPORT SUPPORTING A WIZZARD

A novice printer user surfing a 3D printing community website finds a design that she likes created by another user. She downloads the STL for this file, Wizzard.STL, to her computer. The designer who uploaded the design did not include instructions about optimal printing orientation, and our user notices (see Figure ??) that there are some parts of the model where the overhangs are definitely more than 45 degrees. This

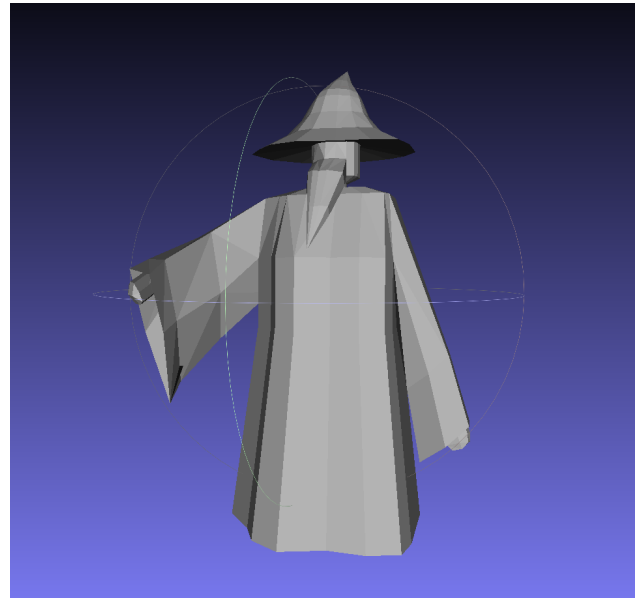


Figure 1. Wizzard.stl, a file downloaded from the 3D printing community site Thingiverse. Notice that there are several greater than 45 degree overhangs in this model, especially around the draping sleeves.

wizzard has sleeves that drape down below his hands which are totally unconnected to anything. She can immediately see that she will have to use support material for this print.

Being a novice printer user, she decides to fire up Support Support to help her find the best way to print the Wizzard. She runs the data generation script, and some time later comes back to her computer to look at the visualization of the data generated.

VS: Derrick, please put some story about how this user goes through the process of choosing things in our interface

IMPLEMENTATION

The visualization we implemented is broken down into two parts: data generation and visualization. Data generation is done offline and ahead of time. The visualization is visible and available for interaction in-browser.

Data Generation

To create data for our visualization, we randomly sample the space of possible rotations in X and Y. As mentioned, rotation in Z does not affect any of the statistics we measure. We create this set of rotations, and then we programmatically rotate the user's STL file and make a copy of it in each rotation. This collection of STL files is forwarded to the data generation portion of the pipeline.

Data generation is accomplished by logging aggressively during a slicing program's slicing process. The data we gather are, as mentioned, time to print, support material volume, surface area, angle of incidence, and affected faces. We used Cura and Skeinforge, both open-source slicing engines, to generate portions of this data.

The types of data that we collect for this visualization are as follows:

- support material volume
- time to print
- surface area of support material contact with model
- model faces contacted by support material
- angle of contact of support material on each face

All of these data are collected through a combination of added calculation in the slicing programs, extensive logging during the slicing process, and post-slicing log processing with python.

Rotations

Rotations are generated using a python script. Since we identified that rotation in Z did not affect our metrics, we use random selection over two independent distributions on $(-\pi, \pi]$ to select the X and Y rotation.

With the rotations selected, we generate one-time scripts for the programmatic 3D modeling program OpenSCAD. These scripts are used to call OpenSCAD on the commandline. This process saves out STL files with the proper rotations of the original.

Volume and Time

The support material volume and time to print are both calculated using Skeinforge, which is a pure python slicing program that is no longer actively supported. We selected it for this portion of the data generation because, though it runs slower than new slicing software, the code was much better commented and easy to work with.

Support material volume is calculated by first slicing the model with no support. This value, the base material use, is stored. We then slice the model in all generated orientations and calculate the volume of the total print. We subtract our stored base material use from the volume of each orientation, giving us the support material use in each orientation. Note that the volume of material used for the model does not change in different orientations.

Time to print is calculated using heuristics about the printer's speed moving in XY and Z. By parsing the generated machine code for the printer, we can sum the execution time over all commands sent to the printer. This estimated time can be slightly inaccurate; many 3D printers now have hardware acceleration which allows them to print long lines more quickly per distance than short lines. We do not account for this in our data gathering.

Surface Area, Affected Faces, and Angles

Our remaining metrics are calculated using Cura, an open-source slicing engine written in C++. It is more powerful and well-abstracted than Skeinforge, in addition to running faster, so it was ideal for these remaining metrics.

Supported surface area of the model is calculated alongside support. As the triangles of the STL file are iterated over, we

consider only those flagged as needing support. Using the three vertices (in 3-space) of the triangles, we calculate the area of the triangle ABC as follows:

1. Find angle between AB and AC, using $AB \cdot AC = |AB||AC|\cos\theta$
2. Calculate area using $A = \frac{1}{2}|AB||AC|\sin\theta$

We sum over the areas of all supported triangles. We are also interested in which triangles have support attached to them, so alongside this area calculation, we also log the 3D coordinates of the vertices of all triangles that contact support.

In its usual generation of supports, Cura calculates the angle of the support material's contact with the surface. It uses this for the purpose of creating accurate machine code where the support material meets the model material's surface. We simply log these angles as they are calculated and keep a running count of faces found at each orientation; we later take the average of these values.

Visualization

VS: Derrick, please write this section!

EVALUATION

suggestions we got from people.

LIMITATIONS AND FUTURE WORK

There are several considerations of support material and its removal that we do not currently measure, in particular connected components, curvature, and accessibility. We believe that these measurements are, while not trivial or necessarily computationally efficient, straightforward to determine given sufficient programming time. Accessibility of support material could be determined with raycasting algorithms. Curvature and connected components could be tracked by iterating over neighborhoods of each face and comparing measurements.

Another feature that would be very beneficial in future work is brushing and linking with affected faces. Ideally, a 3D moldor would be able to paint faces that should be kept support-free in a print, and use these constraints to narrow the search space of orientations. Without a reasonably sophisticated search index, we were unable to create this function in a way that functioned at interactive speeds.

DISCUSSION

Tools for sampling multi-dimensional spaces and visualizations in general have been employed to serve mainly digital needs. As 3D printers become more ubiquitous and digital design takes to the physical realm, we anticipate that more visualizations will focus on helping novices navigate the complex optimization problems associated with the printing process. Hopefully some of this is only a stopgap solution. We anticipate that more multi-material printers will become more affordable to hobbyists, and thereby that the support question will be less difficult. However, material waste is still a salient issue in even commercial 3D printers with dissolvable supports, as dissolved material is not recoverable. Even with more sophisticated machines, the fused deposition modeling

(FDM) process can still give rise to issues with differing resolution in XY and Z, and also can be subject to shearing at layer interfaces when forces are applied. We believe that orientation tools to help users explore the tradeoffs for different orientations will evolve with printers, and Support Support is just the start.

CONCLUSION

Support Support is a data generation pipeline and visualization designed to save inexperienced designers time in their search to balance material use, printing time, and post-print cleaning time. We have designed with our own experiences in mind, and with the input of others with 3D printing experience. There are innumerable features that could be added to a visualization such as this, and additionally it will become more useful as the preprocessing time approaches 0. A model for creating a better sampling process, i.e. to optimize for one or more user-selected parameters, would obviously make Support Support even more usable in the future.

We are excited to release Support Support into the wild with instructions for users to create their own deployments. We expect that we will get more feedback on it through this process, and plan to continue developing it in our spare time as it serves many of our own needs.

ACKNOWLEDGEMENTS

This material is based upon work supported by the National Science Foundation under Grant No. DGE 1106400. The authors would like to thank the kind users of the Ultimaker forums for their assistance with Cura and data generation.

REFERENCES

1. Cura - ultimaker wiki. <http://wiki.ultimaker.com/Cura>. Accessed: November 2013.
2. Curaengine on github. <https://github.com/Ultimaker/CuraEngine>. Accessed: November 2013.
3. Jansen, Y., Dragicevic, P., and Fekete, J.-D. Evaluating the efficiency of physical visualizations. In *Proceedings of the SIGCHI Conference on Human Factors in Computing Systems*, CHI '13, ACM (New York, NY, USA, 2013), 2593–2602.
4. Marks, J., Andalman, B., Beardsley, P. A., Freeman, W., Gibson, S., Hodgins, J., Kang, T., Mirtich, B., Pfister, H., Ruml, W., Ryall, K., Seims, J., and Shieber, S. Design galleries: A general approach to setting parameters for computer graphics and animation. In *Proceedings of the 24th Annual Conference on Computer Graphics and Interactive Techniques*, SIGGRAPH '97, ACM Press/Addison-Wesley Publishing Co. (New York, NY, USA, 1997), 389–400.
5. Marsaglia, G. Choosing a point from the surface of a sphere. In *Ann. Math. Stat.* 43, Ann. Math. Stat. (1972), 645–646.
6. Shapeways. <https://www.shapeways.com/>. Accessed: November 2013.
7. Skeinforge - fabmetheus. <http://fabmetheus.crsndoo.com/>. Accessed: November 2013.
8. Willit 3d print. <http://willit3dprint.com/>. Accessed: November 2013.
9. Sphere point picking – from wolfram mathworld. <http://mathworld.wolfram.com/>. Accessed: November 2013.