

Flood & debris situation report — Rasuwa — Timure to Syabru Bensi (Bhote Koshi)

Event date 26 August 2026 · generated 01 Oct 2026, 17:16 by Baadhi from satellite data · Educational prototype — verify on the ground

5.11 km²

flooded or debris-covered (2.29 km² water, 2.04 km² debris/mud)

613

buildings inside the footprint (+86 at its edge) of 6,378 mapped

22

settlements cut off by road from the nearest hospital or town (1 still reachable on foot)

35.16 km · 27

of road under water/debris where it blocks the way · bridges over an affected reach (verify)

Settlements cut off by road

Settlement	Hospital/clinic before	After	On foot now
Syabru Bensi	24 min	none by road	no mapped path
Tiwari	31 min	none by road	no mapped path
unnamed hamlet	33 min	none by road	no mapped path
Domen	34 min	none by road	157 min
Lingling	36 min	none by road	no mapped path
Pajung	38 min	none by road	no mapped path
Timure	41 min	none by road	no mapped path
Bhrajam	41 min	none by road	no mapped path
Bahun Danda	43 min	none by road	no mapped path
Rasuwa Gadhi	46 min	none by road	no mapped path

22 cut off in total. Travel times from OpenStreetMap roads (typical speeds), nearest facility within ~25 km.

Roads blocked (longest first)


Road	Blocked stretches	Under water/debris
unnamed unclassified	56	9.7 km
unnamed primary	31	8.3 km
unnamed path	55	6.3 km
unnamed trunk	19	3.1 km
Pasang Laahamu	10	1.8 km

Health facilities

In or next to the footprint: none of the mapped facilities.

Data used

- Sentinel-1 radar: track 85 (ascending): before 2026-07-23, 2026-08-04, 2026-08-16 → after 2026-08-28; track 121 (descending): before 2026-07-26, 2026-08-07, 2026-08-19 → after 2026-08-31 — skipped (covers 4% of the area); track 19 (descending): before 2026-07-31, 2026-08-12, 2026-08-24 → after 2026-09-05
- Sentinel-2 optical (clear pixels): before 2026-08-24, 2026-08-12; after 2026-08-27, 2026-09-01, 2026-09-08
- AI flood model: resnet18 U-Net trained on Kuro Siwo
- Copernicus DEM GLO-30 · OpenStreetMap as of 2026-08-24 (before the event, Overpass history)
- What found the affected area (km², kinds overlap): AI model 2.91 · radar change 1.25 · radar water 0.04 · optical change 3.00 · optical water 0.35 · terrain fill 0.11

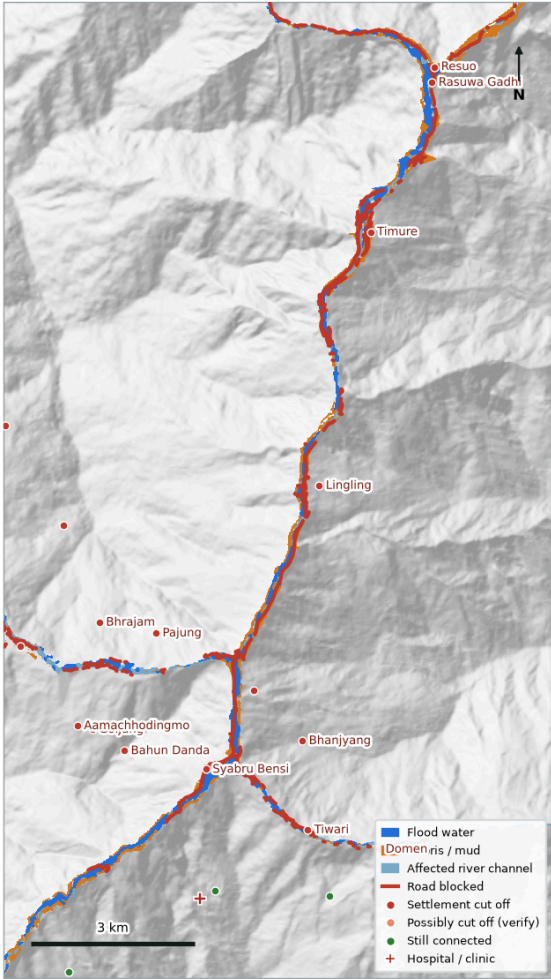

What this report cannot tell you

- Sentinel satellites revisit an area only every few days: what happened between passes, and water that drained before the next pass, is not seen. No warning ahead of an event is possible.
- Radar cannot see steep slopes facing away from or towards the satellite (shadow, layover); optical images need clear sky.
- At 10 m resolution a building "hit" means it lies in the flood/debris footprint, not that it collapsed.
- Buildings, roads and settlements come from OpenStreetMap before the event; anything not mapped is not counted.
- Travel times assume typical speeds per road type; roads outside the analysed area are assumed passable.

Contains modified Copernicus Sentinel data 2026. Produced using Copernicus WorldDEM-30 © DLR e.V. 2010–2014 and © Airbus Defence and Space GmbH 2014–2018 provided under COPERNICUS by the European Union and ESA; all rights reserved. © OpenStreetMap contributors (pre-event snapshot, ODbL). Flood model trained on Kuro Siwo (Bountos et al., NeurIPS 2024, CC BY 4.0).