

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
First look at the Practical Base	02.10.2023 / Monday
<i>At the start of the practical training, a student can work in a stress-free environment, feeling confident in themselves while working in a non - EASA part-145 organization with aircraft that are not airworthy.</i> <i>Practical training will be done in AGAI TLK on aircraft, such as the : Cessna 310, Cessna 152, segments and parts of Airbus A320, ATR42 aircraft. In this stage of practical training, student get acknowledged with standard procedures in aircraft maintenance, including tools skills, working with aircraft manuals. Because the aircraft in the laboratory are non-airworthy, it creates a unique opportunity to learn without the risk of consequences for making mistakes.</i>	
06.10.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Learning hangar and safety rules	03.10.2023 / Tuesday

- Had the opportunity to observe and learn about different types of aircraft present in the hangar. This involved understanding the components, systems, and technologies specific to each aircraft model.
- At the onset of the internship, underwent comprehensive safety orientation sessions. This included familiarization with emergency protocols, hazard identification, and personal protective equipment (PPE) requirements.
- Adherence to PPE guidelines was strictly enforced within the hangar. Ensured proper usage of safety gear such as gloves, safety goggles, ear protection, and appropriate attire to mitigate potential risks.
- Familiarized with safety signage and markings placed strategically throughout the hangar. These indicators provided guidance on hazards, restricted areas, emergency exits, and safety protocols.
- Understanding the importance of risk assessment, learned to identify potential hazards and assess associated risks. Thanks to that, implemented effective mitigation measures and prioritized safety in all tasks undertaken.

06.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Deciding on internship tasks from supervisor	04.10.2023 / Wednesday
➤ <i>The supervisor evaluates the intern's skills, qualifications, and interests to determine suitable tasks. By understanding the intern's strengths and areas for development, tasks can be tailored to optimize learning outcomes and foster professional growth.</i> ➤ <i>Tasks assignment should facilitate opportunities for the intern to interact with colleagues, stakeholders, and industry professionals. Participation in team projects, meetings, and networking events fosters collaboration, expands professional networks, and enhances interpersonal skills.</i> ➤ <i>Tasks should strike a balance between challenging the intern to learn new skills and providing adequate support for their success. Assignments that are too daunting may overwhelm the intern, while those that are too simple may not facilitate meaningful growth. Regular feedback and guidance from the supervisor are essential in this regard.</i> ➤ <i>While guidance from the supervisor is crucial, internship tasks should also encourage people to take ownership of their work and demonstrate initiative. Assignments that allow for autonomy empower the intern to make decisions, solve problems, and contribute creatively to projects under supervision.</i>	
06.10.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 overview- Wings and Engines	05.10.2023 / Thursday
<i>The Cessna 310 is a twin-engine, low-wing general aviation aircraft manufactured by the Cessna Aircraft Company. Introduced in 1954, the 310 quickly became one of the most popular light twin-engine aircraft of its time and has remained a favorite among pilots and owners for its versatility, reliability, and performance.</i> ➤ Twin-Engine Configuration checked <i>The Cessna 310 has a twin-engine configuration, usually powered by piston engines. This design provides redundancy and increases security; this makes it suitable for long-range flights and various mission profiles.</i> ➤ Low-Wing Configuration checked <i>With its low-wing configuration, the 310 offers enhanced stability and aerodynamics efficiency. This design also allows for easy access to the cabin and baggage compartments.</i> <i>By closely examining the wing structure and engine structure on the aircraft, both theoretical and practical information about the aircraft was obtained.</i>	
06.10.2023 / Friday	ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature)
NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 overview- Retractable Landing Gear	06.10.2023 / Friday
➤ Retractable Landing Gear: <i>The aircraft is equipped with retractable landing gear, which contributes to its streamlined aerodynamic profile and improves performance during takeoff and landing. The retractable gear also enhances ground clearance and reduces drag in flight.</i> ➤ Spacious Cabin: <i>The cabin of the Cessna 310 is known for its spaciousness and comfort, accommodating up to six occupants, including the pilot and co-pilot. The cabin layout can be configured with various seating arrangements to suit the needs of passengers and cargo.</i> <i>Both research and visual inspection were carried out on the general structure of retractable landing gear. Additionally, the layout of the cabin and cargo area was examined.</i>	
06.10.2023 / Friday	ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature)
NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 overview- Avionics and Instrumentation	09.10.2023 / Monday
➤ Avionics and Instrumentation: <i>Cessna 310 are equipped with advanced avionics and instrumentation, including GPS navigation systems, autopilot, weather radar, and traffic collision avoidance systems (TCAS). These features enhance situational awareness and safety during flight operations.</i> ➤ Performance and Range: <i>The Cessna 310 is renowned for its impressive performance capabilities, including a maximum cruise speed of around 200 knots (230 mph) and a range of approximately 1,000 nautical miles. These characteristics make it suitable for both short-haul and long-distance flights.</i> <i>In addition to visual preview, theoretical information was obtained about timers, navigation and navigation lights, heaters and many other systems in avionic systems.</i>	
13.10.2023 / Friday	ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature)
NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Fuel System	10.10.2023 / Tuesday
<i>The fuel system of the Cessna 310 is a crucial component responsible for storing, transferring, and delivering fuel to the aircraft's engines. It plays a vital role in ensuring the aircraft's performance, reliability, and safety during flight.</i> Fuel-Air Control ➤ <i>Cleaned</i> <i>Removed the fuel strainer and cleaned the screen in fresh cleaning solvent. Reinstalled.</i> ➤ <i>Inspected</i> <i>Checked control connections, levers, and linkage for security of attaching parts. Checked the air control body for cracks and the fuel-air control unit for overall condition.</i> Fuel Manifold <i>Removed the cover. Used clean gasoline, flush out the chamber below the screen. Flush above the screen and inside the center bore making sure that outlet passages are open.</i> <i>Aligned mounting holes in the body, diaphragm and top cover locating the small vent hole in the cover to the side.</i>	
13.10.2023 / Friday	ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature)
NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Fuel System	11.10.2023 / Wednesday
Fuel Discharge Nozzles ➤ Cleaned in fresh cleaning solvent. ➤ Inspected the fuel discharge nozzle for damaged orifice, dirt and foreign objects. Fuel Selector Valve and Strainer ➤ Cleaned. ➤ Fuel selector valve handles - OFF. ➤ Removed the lower access cover plate. ➤ Cleaned filter in fresh solvent and air dry. ➤ Inspected quick-drain valve, gasket, filter and fuel selector for scratches, dirt accumulation and other foreign matters. Main and Auxiliary Fuel System ➤ Visually inspected filler cap gasket If crushed or damaged or not. ➤ Removed the main tank nose cap and visually inspected the area for evidence of fuel leakage. No leakage from o-seals.	
13.10.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Fuel System - Oxygen System	12.10.2023 / Thursday
Fuel Selector Valve Control System ➤ Cleaned in fresh cleaning solvent, wiped with a dry cloth. ➤ Inspected fuel selector valve control system for binding of control, proper operation, excessive wear, safety. Main Tank Fuel Transfer Pump ➤ Cleaned. Oxygen System ➤ The filler valve is cleaned with trichloro-ethylene ➤ Inspected the filler valve for nicks, cracks and deep gouges. If require repair, limited to replacement parts. Oxygen Regulator and Cylinder ➤ Cleaned with cloth. Oxygen Masks and Hoses ➤ Cleaned the mask and hoses with a mild solution of soap and water. Rinsed with clean water and wiped to get dried.	
13.10.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Vacuum System-Deice System	13.10.2023 / Friday

Vacuum System Components

- *Cleaned in fresh cleaning solvent, wiped with a dry cloth.*
- *Wiped exterior of lines and hoses with a clean, dry cloth.*
- *Cleaned vacuum system filter with a jet of clean, dried air and tapping lightly while blowing air over the filter.*
- *Inspected the vacuum system for scratches, chips, nicks, dents, deformed tubes, sharp bends, dirt, proper operation and correct vacuum indication.*

Deice System

- *Cleaned.*
- *The deice boots are cleaned using soap and water.*
- *Inspected.*
- *No need for repairing or servicing. If needed, deice system components are limited to the replacement of parts.*

13.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Pitot Static System and Anti-Ice System	16.10.2023 / Monday
Pitot Static System Components ➤ Cleaned in fresh cleaning solvent, wiped with a dry cloth. ➤ Immersed lines in dry cleaning solvent. ➤ Dried lines with filtered compressed air. ➤ Inspected lines for cracks, chafing and abrasions. Anti-Ice System ➤ Cleaned and immersed lines in a dry cleaning solvent. ➤ Cleaned pump filter screen in accordance with Cleaning and Inspection of Main Tank Fuel Transfer Pump Parts. ➤ Inspected lines for cracks, chafing , abrasions and adjacent areas for evidence of leakage. ➤ Inspected pump for security and operation.	
20.10.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Electrical System	17.10.2023 / Tuesday
Electrical System <i>Inspected the electrical system and components for the following:</i> ➤ Circuit breakers for mounting and conditions. ➤ Regulators for mounting; terminals for loose wires. ➤ Switches for loose wiring and proper mounting. ➤ Relays for wiring and mounting. ➤ Motors for proper mounting; wires for clamping. ➤ Battery cables for corrosion and looseness. ➤ Battery for electrolyte level and specific gravity. ➤ instruments and interior lights for operation and broken glass. ➤ Instrument panel and control pedestal for loose wiring; clamps and terminals for security.	
20.10.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Electrical System	18.10.2023 / Wednesday

Electrical System

Continued for inspecting the electrical system and components for the following:

- *Circuit breakers for mounting and conditions.*
- *Regulators for mounting; terminals for loose wires.*
- *Switches for loose wiring and proper mounting.*
- *Relays for wiring and mounting.*
- *Motors for proper mounting; wires for clamping.*
- *Battery cables for corrosion and looseness.*
- *Battery for electrolyte level and specific gravity.*
- *instruments and interior lights for operation and broken glass.*
- *Instrument panel and control pedestal for loose wiring; clamps and terminals for security.*

20.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Electrical System	19.10.2023 / Thursday
Electrical System <i>Inspected the electrical system and components for the following:</i> ➤ Wing and fuselage wiring for proper wire routing, clamped properly and loose terminals. ➤ External power receptacle for proper door closing; terminals for corrosion and looseness. ➤ Electric heated windshield for operation. Battery ➤ Removed batteries from the airplane before cleaning. ➤ Rinsed with clear water and sponge off excess water and allow batteries to dry. ➤ Cleaned battery terminals as needed with a wire brush to brighten the terminals for good electrical contact. ➤ Checked battery case for possible cracks and deterioration.	
20.10.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Electrical System	20.10.2023 / Friday

Electrical System

Inspected the electrical system and components for the following:

Battery Box

- *Cleaned hard deposits of spilled acid and corrosion products using a wire brush.*
- *When all foreign materials have been removed from the box, flushed it thoroughly with clean water.*
- *After cleaning the battery box, flush surrounding skin with clean water to ensure that all corrosive material has been removed.*

Emergency Locator Transmitter (ELT).

- *Cleaned the emergency locator transmitter with a clean, dry cloth.*
- *The following periodic inspections be performed:
The maintenance, which should be done every month and confirms the operating accuracy of the ELT, was not carried out because there was no master switch was installed on the plane.*

If Master Switch would exist, procedures below will be followed:

- *Made sure that the ELT has the correct power output, correct carrier frequency.correct modulation. correct sweep angle and correct sweep rate.*


20.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

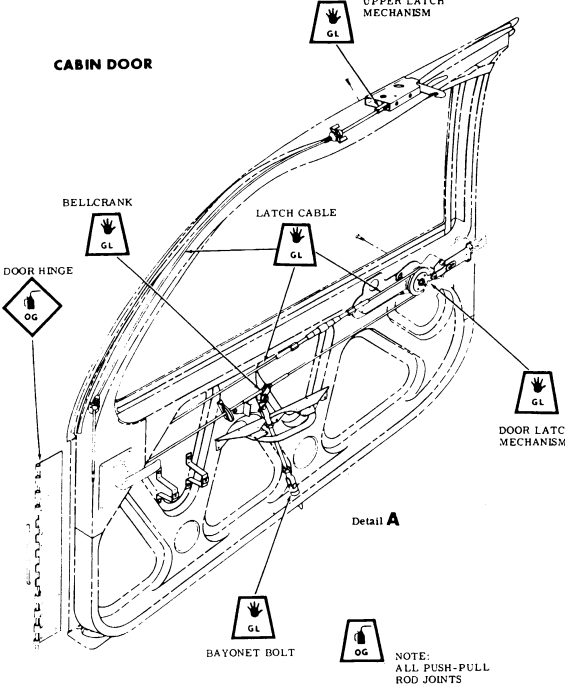Yapılan İş/Work Accomplished	Tarih/Date																				
Cessna 310 - Lubrication Diagram	23.10.2023 / Monday																				
 FREQUENCY (HOURS) 50 HOURS 100 HOURS 200 HOURS 500 HOURS 1500 HOURS - ON ASSEMBLY AND AS REQUIRED METHOD - HAND - SQUIRT CAN - FILLER CAN - GREASE GUN NOTE Specified lubricants will meet requirements for extreme hot or extreme cold temperature operations. Use of substitutes or other lubricants may cause malfunction when operating in extreme temperature conditions, or may cause excessive wear due to improper lubrication. TYPE OF LUBRICANT <table><tbody><tr><td>GL</td><td>Grease, Low Temperature (MIL-G-21164)</td></tr><tr><td>OG</td><td>Oil, General Purpose (MIL-L-7870)</td></tr><tr><td>FG</td><td>Graphite, Lubricating (SS-G-659)</td></tr><tr><td>P</td><td>Petrolatum or Terminal Grease (VV-P-236)</td></tr><tr><td>OI</td><td>Oil, Lubricating, Airplane Instrument (MIL-O-608)</td></tr><tr><td>OH</td><td>Hydraulic Fluid (MIL-H-5606A)</td></tr><tr><td>GW</td><td>Grease, Wide Temperature Range (MIL-G-25760)</td></tr><tr><td>GS</td><td>Grease, Medium Consistency Silicone (MIL-G-3278)</td></tr><tr><td>GLS</td><td>Grease, Light Consistency, Silicone #33 Dow Corning, Midland, Michigan</td></tr><tr><td>DS</td><td>Dry Spray, Lubricant Camie No. 1000 Watson Industrial Park, St. Louis, Mo., or Dupont Slip Spray Dry Film Lubricant</td></tr></tbody></table> *Lubrication Section, Cessna Model 310P, 310Q Service Manual.		GL	Grease, Low Temperature (MIL-G-21164)	OG	Oil, General Purpose (MIL-L-7870)	FG	Graphite, Lubricating (SS-G-659)	P	Petrolatum or Terminal Grease (VV-P-236)	OI	Oil, Lubricating, Airplane Instrument (MIL-O-608)	OH	Hydraulic Fluid (MIL-H-5606A)	GW	Grease, Wide Temperature Range (MIL-G-25760)	GS	Grease, Medium Consistency Silicone (MIL-G-3278)	GLS	Grease, Light Consistency, Silicone #33 Dow Corning, Midland, Michigan	DS	Dry Spray, Lubricant Camie No. 1000 Watson Industrial Park, St. Louis, Mo., or Dupont Slip Spray Dry Film Lubricant
GL	Grease, Low Temperature (MIL-G-21164)																				
OG	Oil, General Purpose (MIL-L-7870)																				
FG	Graphite, Lubricating (SS-G-659)																				
P	Petrolatum or Terminal Grease (VV-P-236)																				
OI	Oil, Lubricating, Airplane Instrument (MIL-O-608)																				
OH	Hydraulic Fluid (MIL-H-5606A)																				
GW	Grease, Wide Temperature Range (MIL-G-25760)																				
GS	Grease, Medium Consistency Silicone (MIL-G-3278)																				
GLS	Grease, Light Consistency, Silicone #33 Dow Corning, Midland, Michigan																				
DS	Dry Spray, Lubricant Camie No. 1000 Watson Industrial Park, St. Louis, Mo., or Dupont Slip Spray Dry Film Lubricant																				

- Checked oil status of bellcrank, upper latch mechanism, door latch mechanism, bayonet bolt, latch cable and door hinge according to lubrication diagram.

27.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)


NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Lubrication Diagram-Landing Gear	24.10.2023 / Tuesday


LANDING GEAR ACTUATOR GEAR BOX

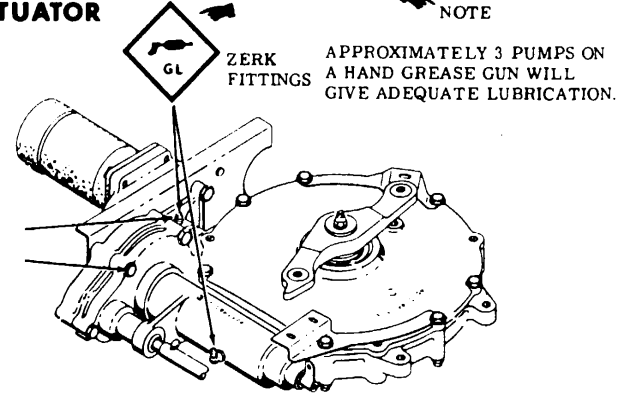

*Landing Gear Actuator, Gear Box, Cessna Model 310P, 310Q Service Manual.

- Removed bolts to prevent breaking seal. Reinstalled when finished greasing.
- After lubrication, wiped off excess lubricant on the crank handle.
- Wiped chain with a clean dry cloth.

LANDING GEAR MANUAL EXTENSION MECHANISM

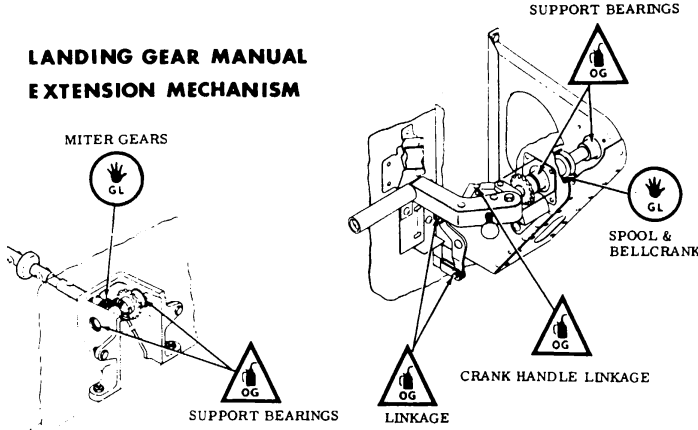

*Landing Gear, Extension Mechanism, Cessna Model 310P, 310Q Service Manual.

27.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE


(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished

Tarih/Date


Cessna 310 - Lubrication Diagram-Landing Gear

25.10.2023 / Wednesday

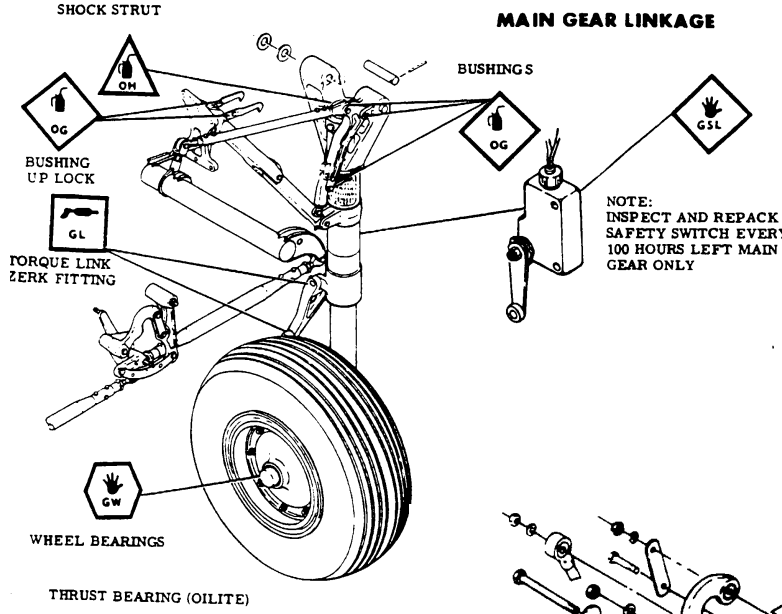

- Lubricated all spherical rod ends with low temperature aircraft lubricating grease.
- Wiped polished surface of landing gear shock strut with a clean dry clothes.
- Cleaned wheel bearings.

*Landing Gear , Main Gear Linkage,
Cessna Model 310P, 310Q Service
Manual.

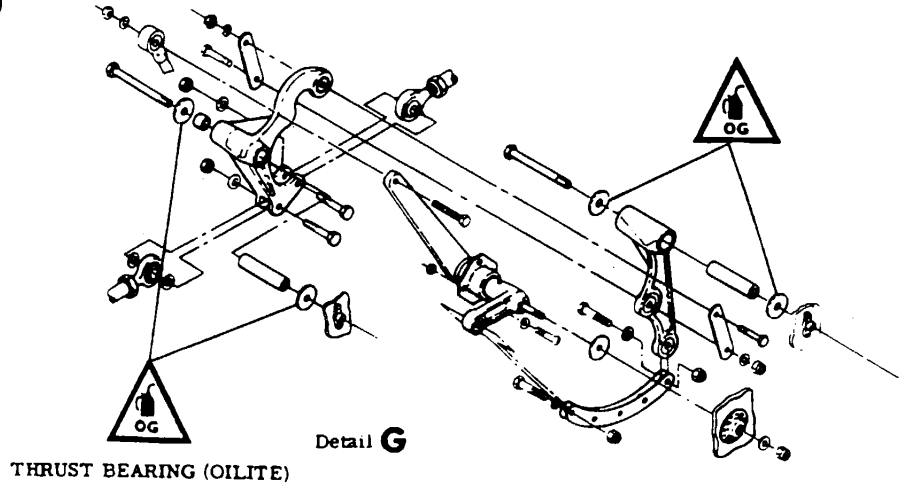


27.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

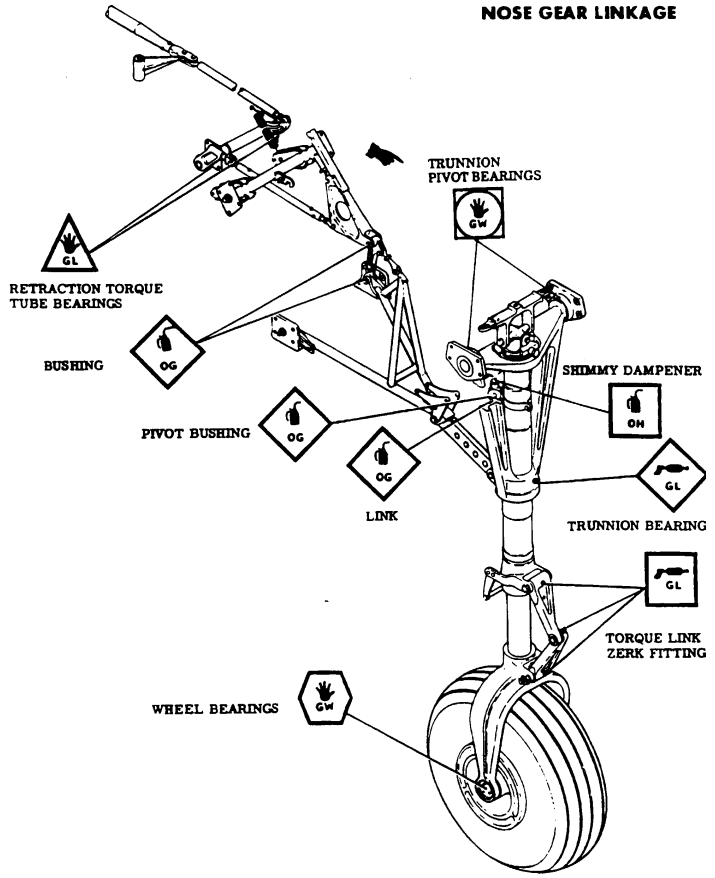Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Lubrication Diagram-Landing Gear	26.10.2023 / Thursday
➤ Lubricated all spherical rod ends with low temperature aircraft lubricating grease. ➤ Wiped the polished surface of landing gear shock strut with a clean dry cloth. ➤ Cleaned wheel bearings.  The diagram illustrates the nose gear linkage assembly of a Cessna 310P/310Q. It shows the main strut, torque tube, and various linkages. Lubrication points are marked with icons: a triangle with 'GL' for grease, a diamond with 'OG' for oil, and a hexagon with 'GW' for grease. Specific components labeled include: RETRACTION TORQUE TUBE BEARINGS, BUSHING, PIVOT BUSHING, LINK, TRUNNION PIVOT BEARINGS, SHIMMY DAMPENER, TRUNNION BEARING, TORQUE LINK ZERK FITTING, and WHEEL BEARINGS. A 'Detail H' label is present near the wheel assembly.	

*Landing Gear , Nose Gear Linkage, Cessna Model 310P, 310Q Service Manual.

27.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)


Yapılan İş/Work Accomplished

Tarih/Date

Cessna 310 - Lubrication Diagram- Rudder Pedal Mechanism

27.10.2023 / Friday

- After lubricating, actuated the rudder pedals and parking brake several times to ensure separate lubricant and wiped out any oil on the rudder pedals.

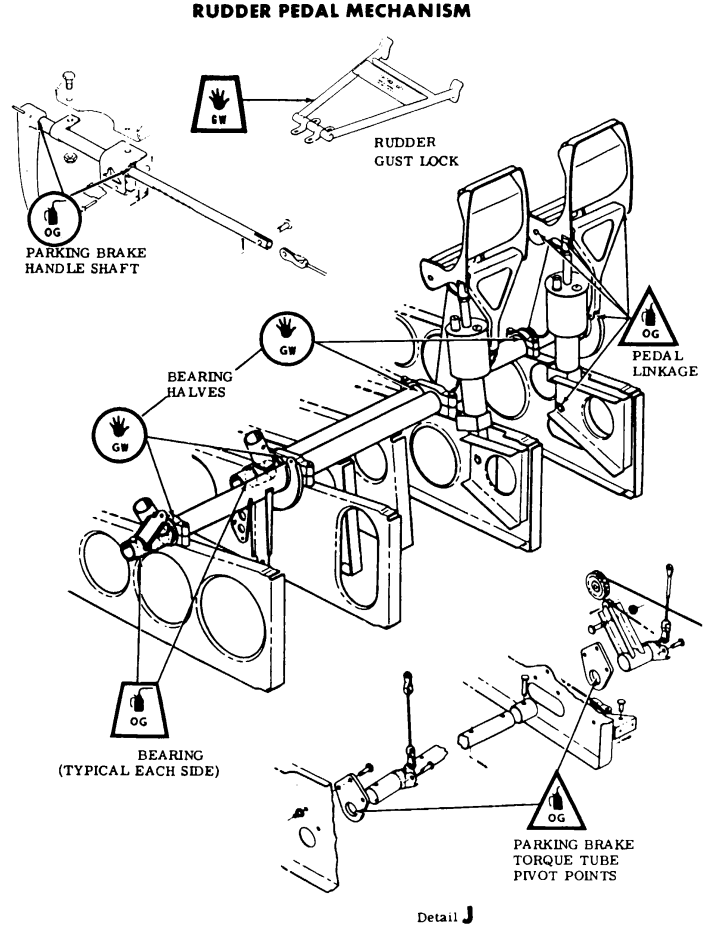

*Rudder, Rudder Pedal Mechanism, Cessna Model 310P, 310Q Service Manual.



27.10.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

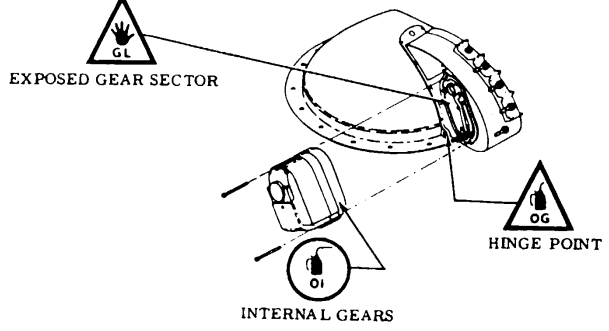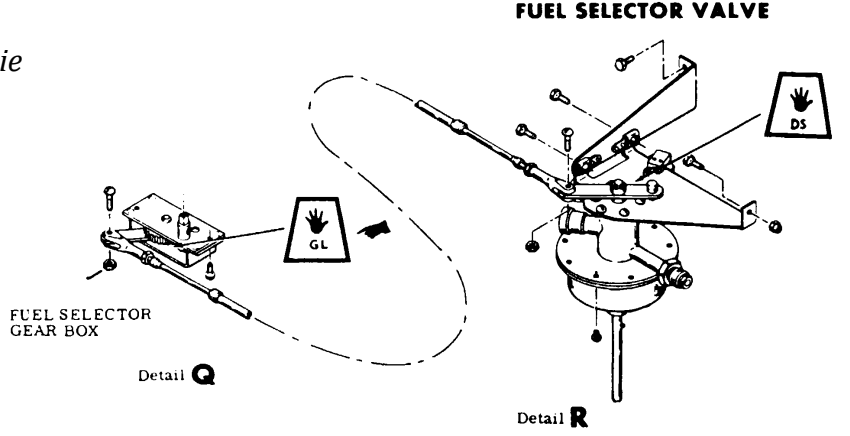Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Lubrication Diagram- Landing Light	30.10.2023 / Monday
➤ The light extended to lubricate the large gear. Wiped off excess grease from gear sector before retracting the light.  *Landing Light , Cessna Model 310P, 310Q Service Manual. ➤ Cleaned and lubricated with Camie 1000 dry spray lubricant.  *Fuel Selector Valve, Cessna Model 310P, 310Q Service Manual.	

03.11.2023 / Friday

ONAY/ CONFIRMATION
(Tarih, Mühür ve İmza)
(Date, Stamp and Signature)

NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır.
NOTE: This section will be filled in by the institution that made the internship.

ÇALIŞMA SAYFASI/STUDY PAGE

(Stajyer bu bölüme, not, diyagram, şekil ve çizelge ilavesi yapabilir./The intern can add some notes, diagrams, pictures and tables in this part of report.)

Yapılan İş/Work Accomplished	Tarih/Date
Cessna 310 - Lubrication Diagram- MISCELLANEOUS SERVICE ITEMS.	31.10.2023 / Tuesday
Cold Weather Servicing <i>If the aircraft is to be used frequently in freezing weather, the oil should be drained while the engine is hot and stored in a dry warm place until needed for next flight. If desired, the oil may be heated before it is poured into the engine for the next flight.</i> Draining Oil <i>The oil system was drained on each engine as follows:</i> ➤ Start engine and run until oil temperature is within normal operating limits. ➤ Stopped engine and open oil drain access. ➤ Removed drain plug and allow sump to completely drain. ➤ Installed drain plug and closed oil drain access. Defueling <i>The defueling procedures given pertain to the right wing. The procedure is the same for the left wing. A standard defueling truck or defueling pump is necessary to defuel the aircraft.</i> ➤ Turned off all electrical power. ➤ Turned fuel selector valve handles off. ➤ Removed fuel filler cap and insert defueling tube. ➤ Removed as much fuel as possible through the filler. ➤ Cut safety wire and remove drain valves from bottom side of wing and drain remaining fuel in a clean, open container. Used a defueling pump to remove fuel from a container. ➤ Drained right-hand crossover drain line at wing gap area.	
03.11.2023 / Friday ONAY/ CONFIRMATION (Tarih, Mühür ve İmza) (Date, Stamp and Signature) NOT: Bu bölüm staj yapılan kurum/kuruluş tarafından doldurulacaktır. NOTE: This section will be filled in by the institution that made the internship.	