Dale Automation

Friction drive spiral (Cooler - Double drum)

Inspection Details

Report #: Dale Automation 2773
Location:
Inspection Date: 16-Sep-2026 07:32 AM
Inspector Name: Kyle Kingma


Asset Details


Asset Category : 8000 LPH Double Drum Spiral Cooler
Asset Name : Albany Pietermaritzburg
Asset # : DSS 211-8
Meter Reading: 0 Hours
Model/Year: Dale Automation

Belt


SN	Inspection Item	Note	Good	Repair	Replace	NA
1	Free of major damage	Belt is free of major damage	✓	○	○	○
2	No Broken links	Few broken links found.	○	✕	○	○
3	Belt clips in place	Not all clips are in	○	✕	○	○
4	Ensure belt safe to start		✓	○	○	○

1. Free of major damage

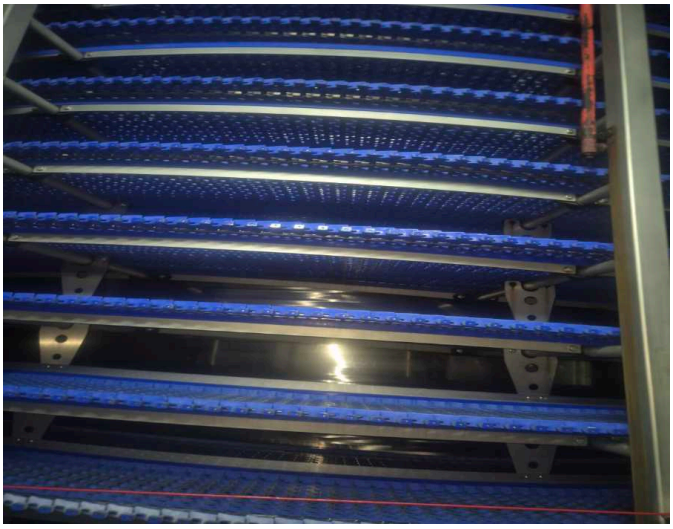

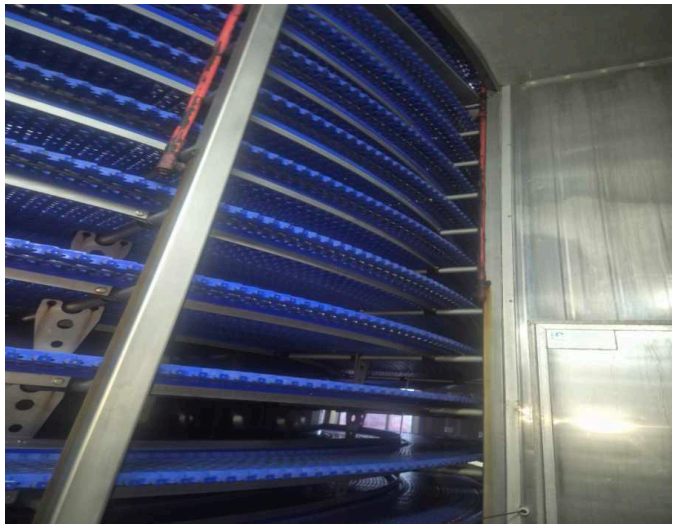

2. No Broken links

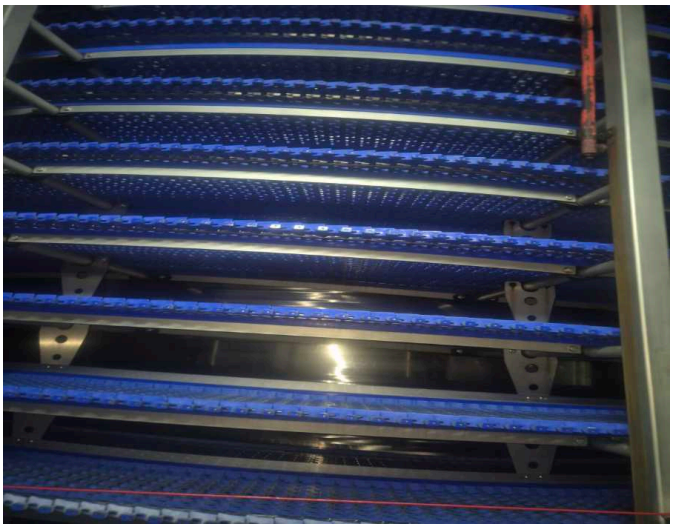

3. Belt clips in place



Belt oiler

SN	Inspection Item	Note	Good	Repair	Replace	NA
5	Oil level in tank	Oil level in oiler is correct.	○	○	✕	○
6	Festo piping		○	○	○	−
7	Operation of oiler	Oiler is broken. Oiler not working	○	○	✕	○

5. Oil level in tank



7. Operation of oiler



Belt washer

SN	Inspection Item	Note	Good	Repair	Replace	NA
8	Bearings and collars		○	○	○	⊖
9	Sprockets wear and /alignment		○	○	○	⊖
10	Side guides		○	○	○	⊖
11	Rail wear strips		○	○	○	⊖
12	Pump operational		○	○	○	⊖
13	Dosing pumps operational		○	○	○	⊖
14	Operation of rinse sprays		○	○	○	⊖
15	Operation of air blast		○	○	○	⊖
16	Operation of main solenoid		○	○	○	⊖

17	Operation of solenoid valve		○	○	○	⊖
18	Temperature security		○	○	○	⊖


CIP

SN	Inspection Item	Note	Good	Repair	Replace	NA
19	Temperature security		○	○	○	⊖
20	Leaks during operation		○	○	○	⊖
21	Operation of zones		○	○	○	⊖
22	Operation of dosing pumps		○	○	○	⊖
23	Operation of air purge		○	○	○	⊖

Control Panel

SN	Inspection Item	Note	Good	Repair	Replace	NA
24	Connections	Connections are good. There was another contractor working in the panel.	✓	○	○	○
25	Temperature display		○	○	○	⊖
26	Panel fans		✓	○	○	○
27	Panel door seals		✓	○	○	○
28	Door locks		✓	○	○	○
29	Panel neatness		✓	○	○	○
30	Panel drawings		✓	○	○	○

24. Connections

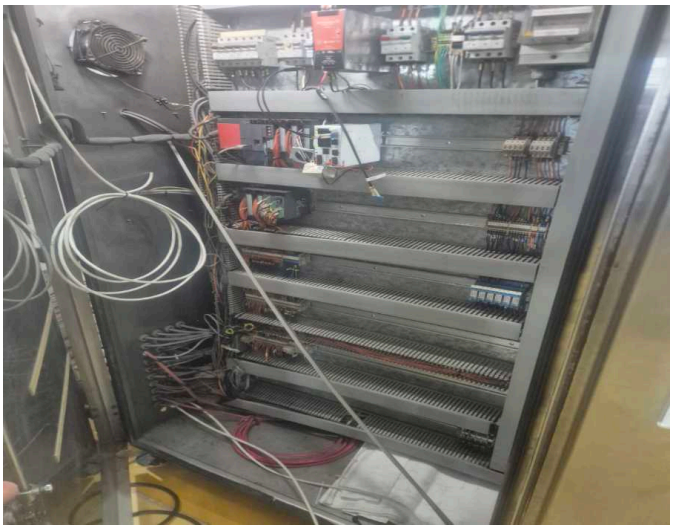





Cross overs (Top and bottom)

SN	Inspection Item	Note	Good	Repair	Replace	NA
31	Wear strips	Wearstrip is a little worn.	✓	○	○	○
32	Guides	Guides are in place	✓	○	○	○

31. Wear strips

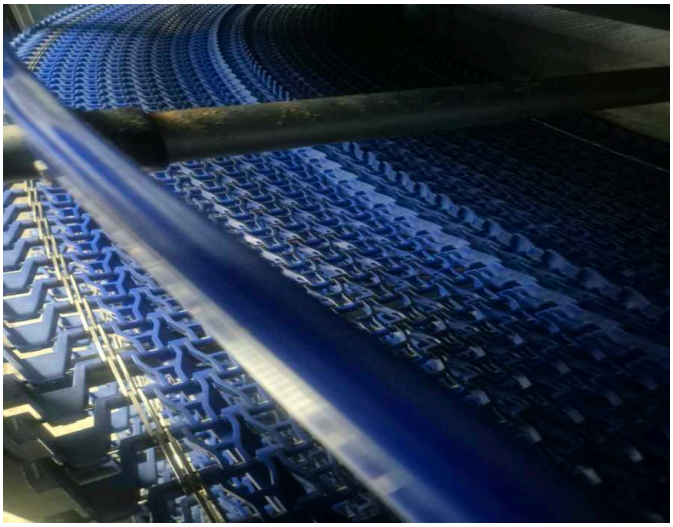

32. Guides

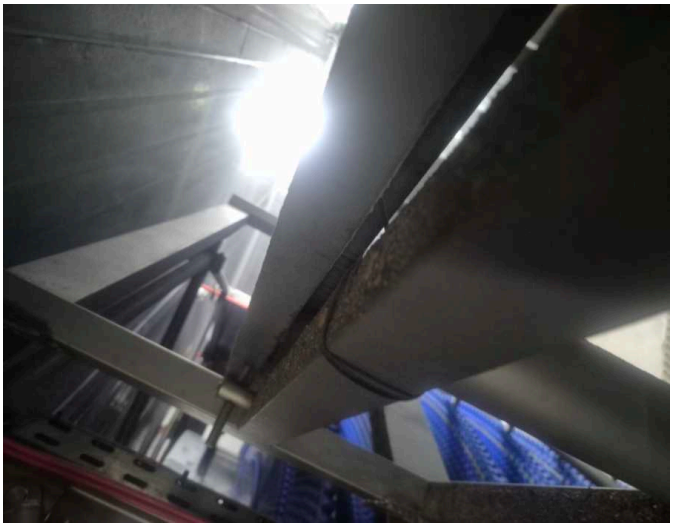

Discharge


SN	Inspection Item	Note	Good	Repair	Replace	NA
33	Bearings		○	○	○	−
34	Sprockets wear / alignment		○	○	○	−
35	Belt guides		○	○	○	−
36	Rail wear strips		○	○	○	−
37	Operation of product height sensor		○	○	○	−


38	Product height, level with first tier height		○	○	○	⊖
39	Discharge E-stop		○	○	○	⊖

Down Drum


SN	Inspection Item	Note	Good	Repair	Replace	NA
40	Rail wear strips	Wearstrip in good condition. Need to fix oiler.	✓	○	○	○
41	Support arms	Rail arms in good condition. All straight	✓	○	○	○
42	Rail arm supports (Plastic or welded tabs)	Plastic tabs installed. No broken tabs found	✓	○	○	○
43	Hold down rail	All old down rails in place	✓	○	○	○
44	Tier lift switches	All sensors working amd stopping belt.	✓	○	○	○
45	Motor and gearbox		○	○	○	⊖
46	Sputnik		○	○	○	⊖
47	Internal drum bolts	All bolts to be replaced as they are badly rusted	○	○	✗	○
48	Top Centre shaft bearing	Centre bearing in good condition and greased	✓	○	○	○
49	Drum rings and internal drive spokes	Welds on rings need to be repaired	○	✗	○	○
50	Drum bar wear strips		○	○	○	⊖

40. Rail wear strips

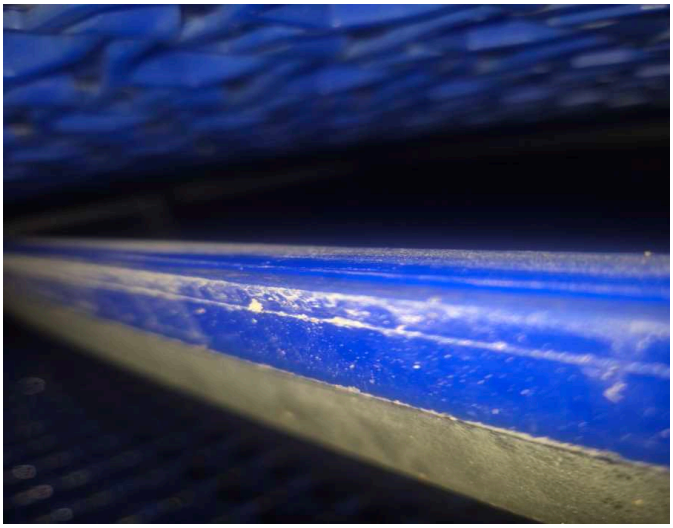


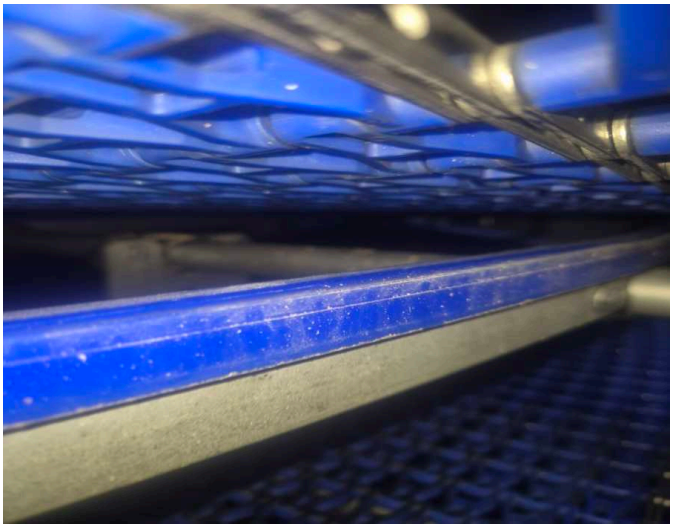



41. Support arms

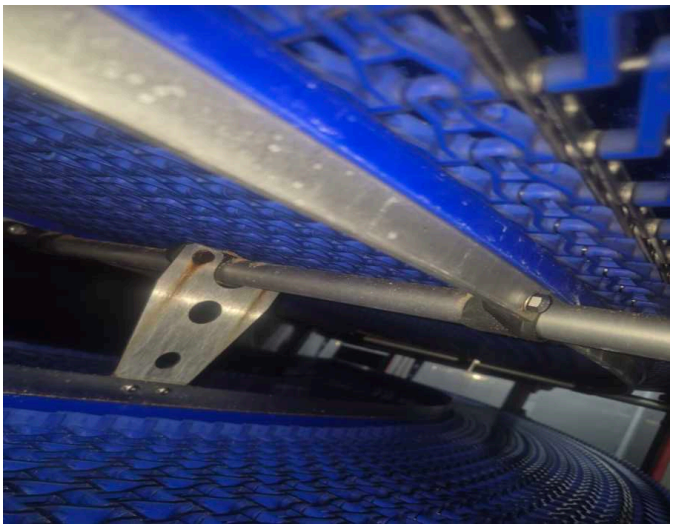


42. Rail arm supports (Plastic or welded tabs)

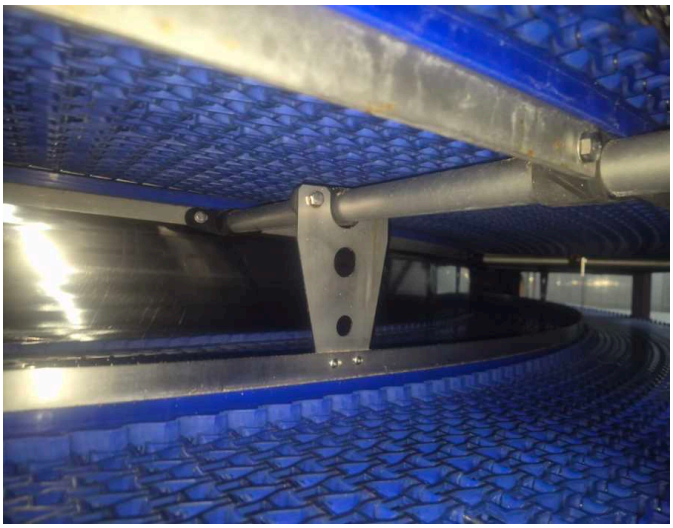


43. Hold down rail

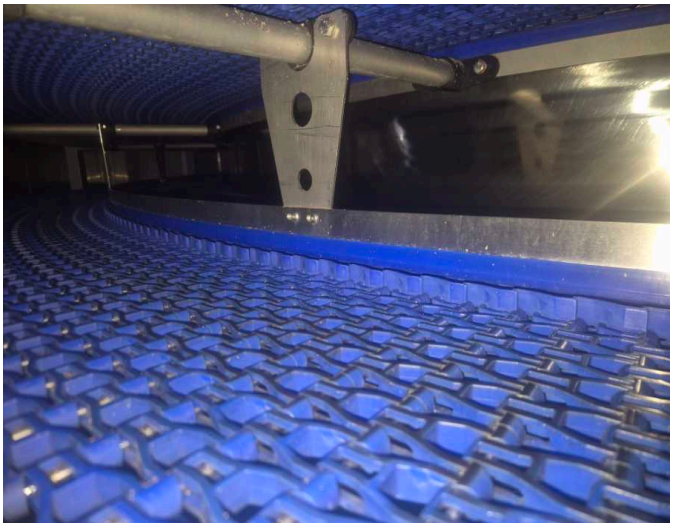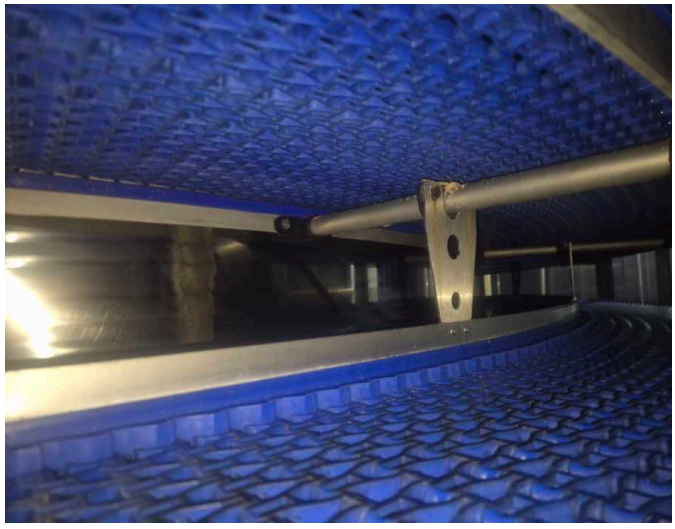44. Tier lift switches





47. Internal drum bolts







48. Top Centre shaft bearing




49. Drum rings and internal drive spokes




Electrical

SN	Inspection Item	Note	Good	Repair	Replace	NA
51	Lighting	All lights working	✓	○	○	○
52	Cables and connections		○	○	○	−
53	Safeties	All safeties working and appearing on hmi	✓	○	○	○
54	Tier lifts	All sensors working and stopping cooler	✓	○	○	○

53. Safeties

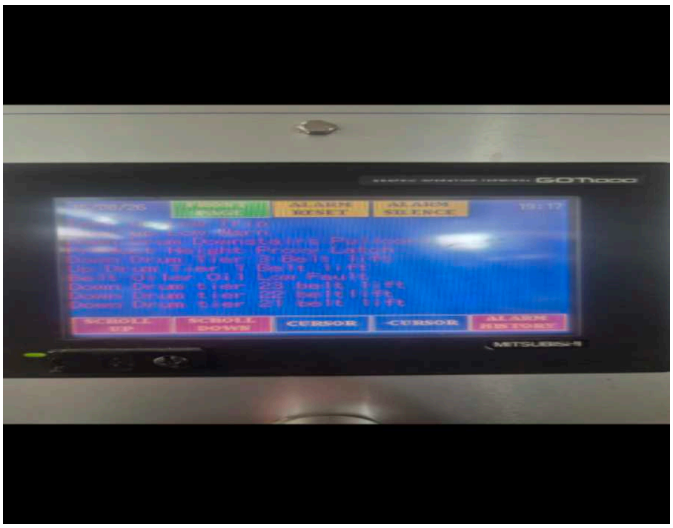

54. Tier lifts

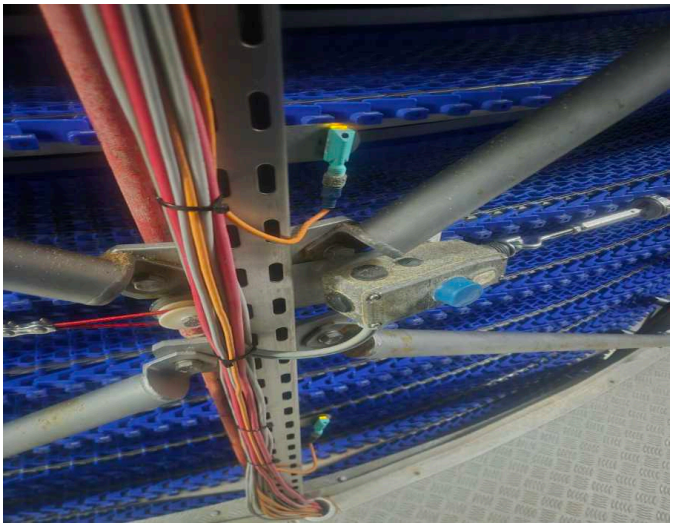




Enclosure

SN	Inspection Item	Note	Good	Repair	Replace	NA
55	Condition	Enclosure is in good condition.	✓	○	○	○
56	Main door seal - Sliding	Main door seal in good condition.	✓	○	○	○
57	Temperature probes		○	○	○	−
58	Internal doors	Internal door broken and handle broken	○	○	✗	○
59	Flashings		○	○	○	−
60	Drains		○	○	○	−

55. Condition




56. Main door seal - Sliding

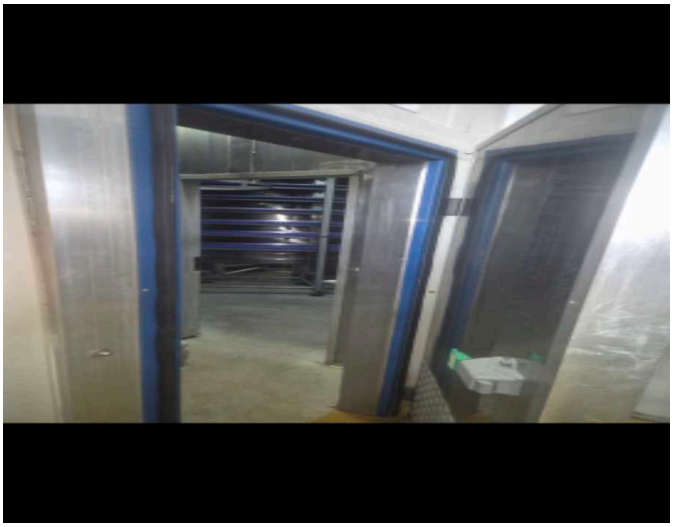

58. Internal doors




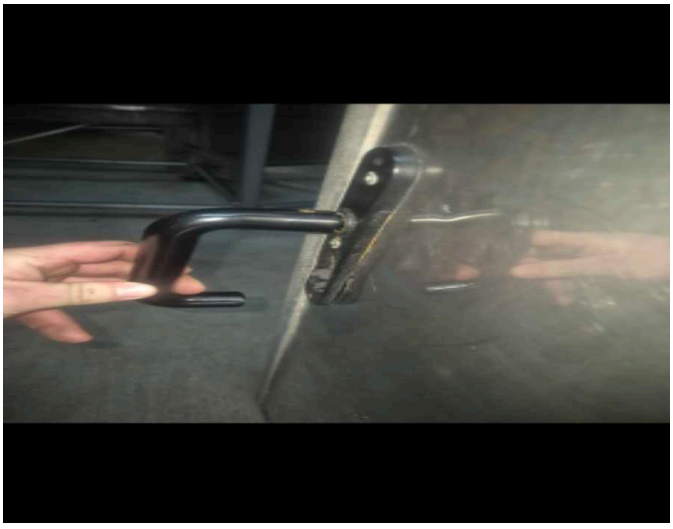

Evaporators

SN	Inspection Item	Note	Good	Repair	Replace	NA
61	Air flow	Airflow is good.	✓	○	○	○
62	Cleanliness	Coils are very clean	✓	○	○	○
63	Corrosion		○	○	○	−
64	Filters	Filters are in very bad condition and need to be replaced	○	○	✗	○
65	Drains	Drains are open and water flows easily	✓	○	○	○

61. Air flow

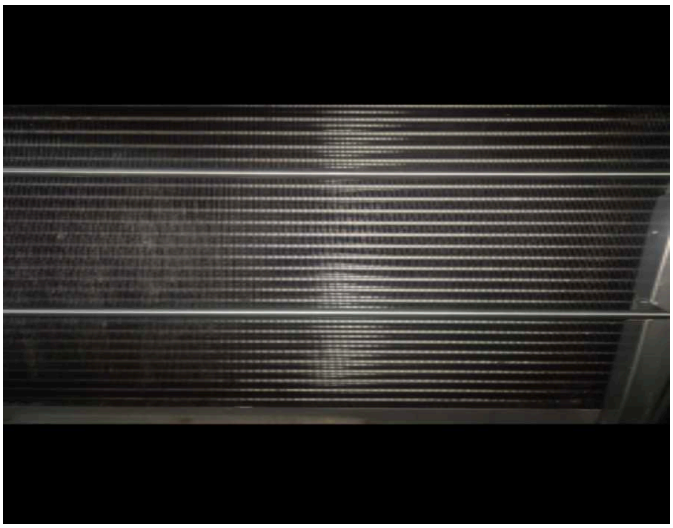



62. Cleanliness



64. Filters







65. Drains



Fans

SN	Inspection Item	Note	Good	Repair	Replace	NA

66	Fans	All fans running	✓	○	○	○
67	Fan guards	All fans are fitted with fan guards	✓	○	○	○
68	Bearins		○	○	○	−
69	Motor currect readings		○	○	○	−

67. Fan guards







Gearbox

SN	Inspection Item	Note	Good	Repair	Replace	NA
70	Oil levels	Oil level is correct on up drum and down drum gearbox	✓	○	○	○
71	Leaks	No leaks on up drum gearbox. Small leak found on uo drum reduction gearbox.	✓	○	○	○
72	Gearbox noise	No noise found on both gearboxes	✓	○	○	○
73	Coupling and fasteners	Everything in place. No cracks found on coupling	✓	○	○	○


74	Gearbox motor	Gearbox motors in good condition	✓	○	○	○

71. Leaks





73. Coupling and fasteners

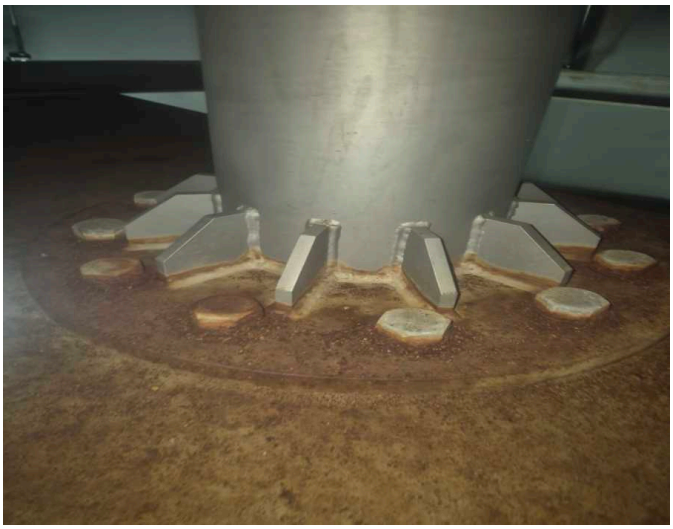




74. Gearbox motor





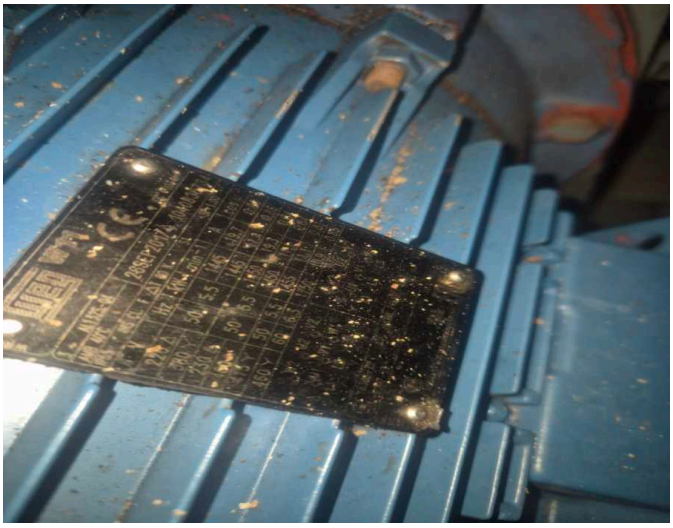



Infeed

SN	Inspection Item	Note	Good	Repair	Replace	NA
75	Bearings	Bearings need to be greased	○	✕	○	○
76	Sprockets wear/ alignment	Sprocket and rollers in good condition	✓	○	○	○
77	Belt guides	Belt guides in place	✓	○	○	○
78	Condition of rail wear strips	Wearstrip is very worn	○	○	✕	○
79	Operation of product height sensor		○	○	○	−
80	Compare product height, level with first tier height		○	○	○	−
81	Infeed E-stop	E stop trios spiral when pressed	✓	○	○	○

75. Bearings




76. Sprockets wear/ alignment

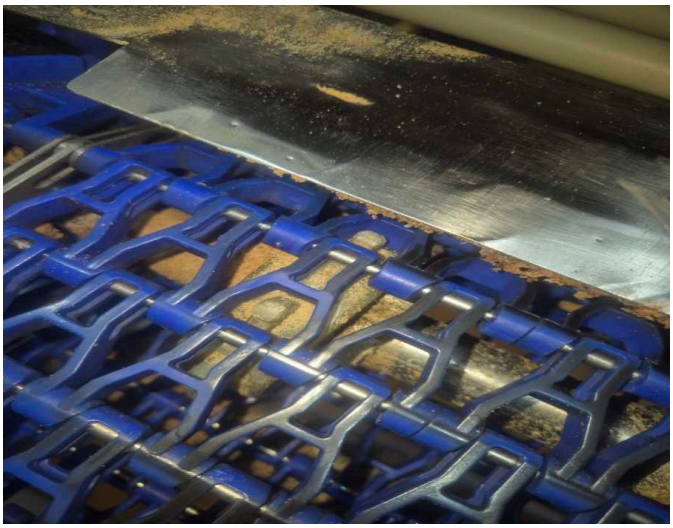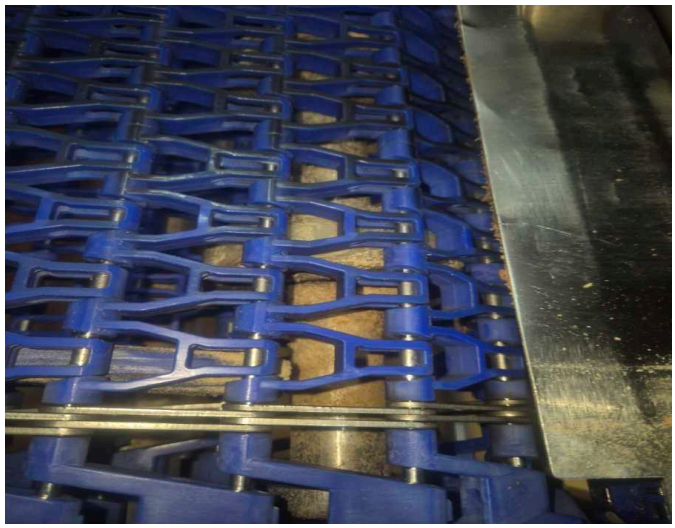77. Belt guides




78. Condition of rail wear strips







81. Infeed E-stop



Take-up

SN	Inspection Item	Note	Good	Repair	Replace	NA

82	Bearings	Bearings greased amd in good condition	✓	○	○	○
83	Sprocket alignment and wear	All sprockets are aligned and in good condition. Sprocket needs to hook at the back of a rod	✓	○	○	○
84	Belt side guides		○	○	○	−
85	Rail wear strip		○	○	○	−
86	Take-up switches	All sensors working .	✓	○	○	○
87	Overdrive	No leaks found on gearbox	✓	○	○	○

82. Bearings








83. Sprocket alignment and wear



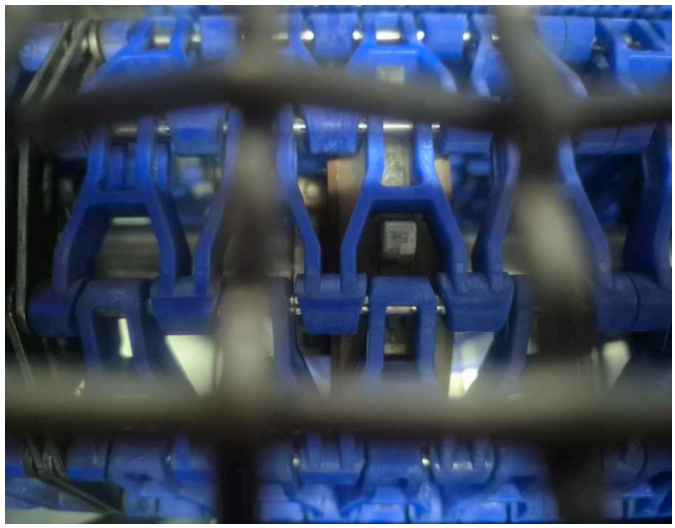

87. Overdrive



Turn stations (Infeed and Discharge)


SN	Inspection Item	Note	Good	Repair	Replace	NA
88	Sprockets and wear strips		○	○	○	⊖
89	Bearings		○	○	○	⊖


Up Drum

SN	Inspection Item	Note	Good	Repair	Replace	NA
90	Rail wear strips	Wearstrip is still in good condition. Need to fix oiler otherwise Wearstrip will start to wear and cause problems	✓	○	○	○
91	Support arms	All support arms are level . No cracks found on support arms.	✓	○	○	○
92	Rail arm supports (Plastic or welded on steel tabs)	Plastic tabs installed. No broken tabs found. All tabs are level	✓	○	○	○
93	Tier lift switches	All tier lift switches working and stopping cooler.	✓	○	○	○

94	Motor and gearbox		○	○	○	−
95	Sputnik		○	○	○	−
96	Drum internals - Bolts	Full drum bolt change to be done. All bolts are badly rusted	○	○	✕	○
97	Drum internals - Drive spokes, intermediate spokes and rings	Spokes are in good condition. Welds on Drive and intermediate rings broke off. Need to do a proper weld	○	○	✕	○
98	Top Centre bearing	Center bearing in good condition and greased.	✓	○	○	○
99	Drum bar wear strips		○	○	○	−

90. Rail wear strips

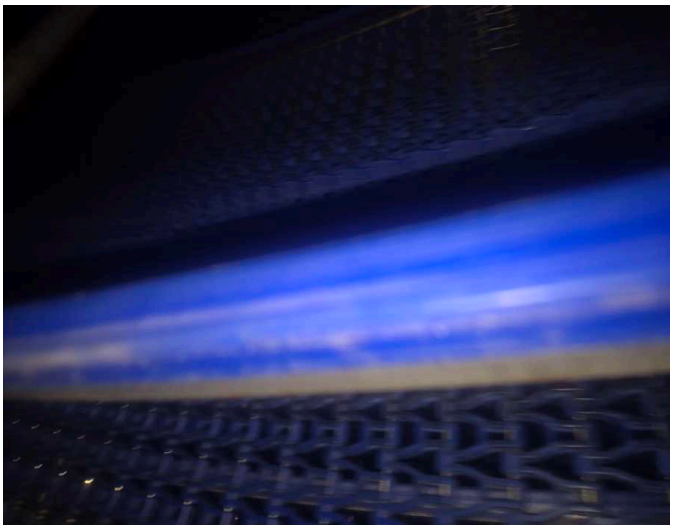

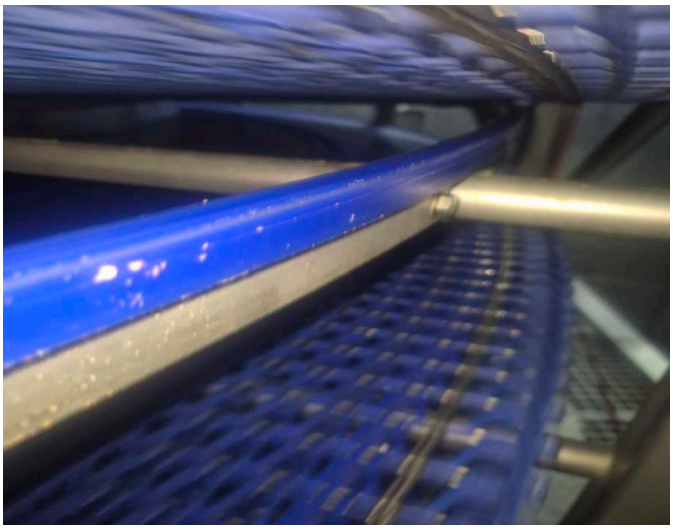

91. Support arms









92. Rail arm supports (Plastic or welded on steel tabs)



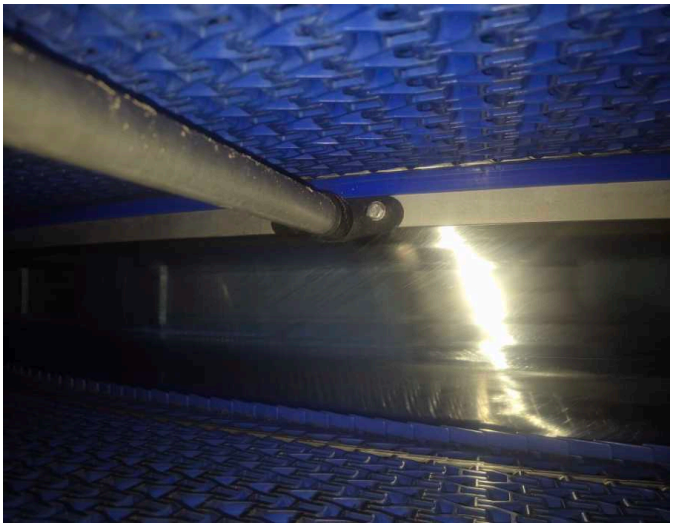



93. Tier lift switches

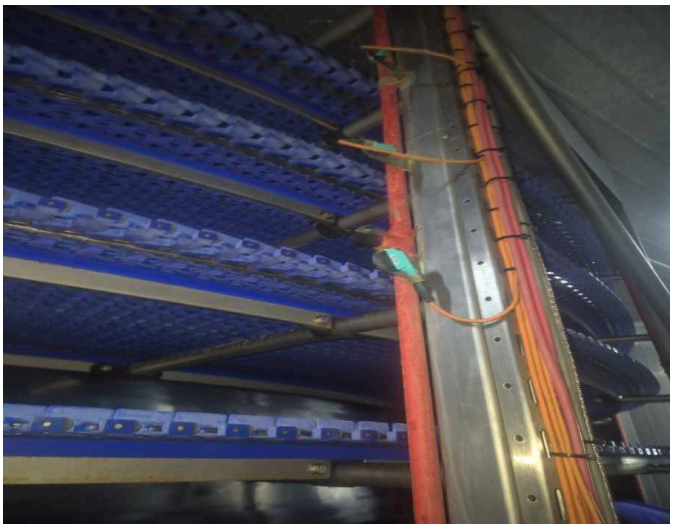



96. Drum internals - Bolts








97. Drum internals - Drive spokes, intermediate spokes and rings

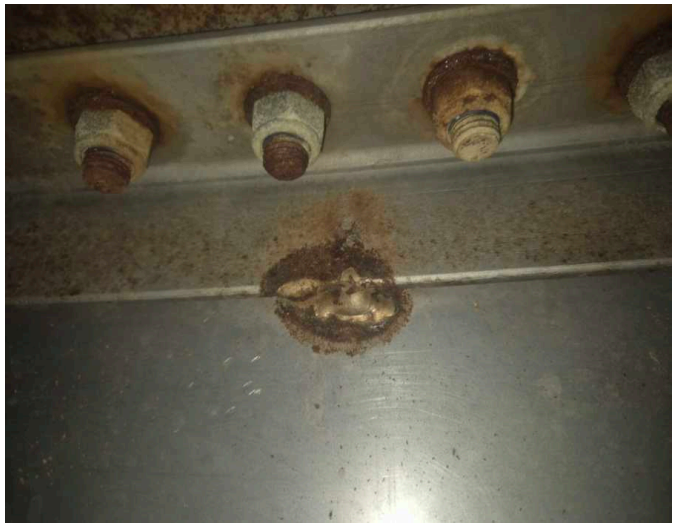

98. Top Centre bearing




Additional Note

Overall Condition:	Minor Repair required
Asset Safe to Use:	**Yes**
Maintenance Required:	Yes
Asset Status	Maintenance Required
Maintenance Priority:	Low


Custom Business Fields

Client Name : robert

Contact details : 0114620044



Dale Technician Signature

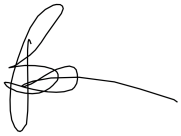

Client Signature