Dale Automation

Friction Drive Spiral (Freezer)

Inspection Details

Report #: Dale Automation 2738
Location: South Africa
Inspection Date: 10-Aug-2026 08:58 AM
Inspector Name: Raynard Kruger

Asset Details

Asset Category : Spiral freezer
Asset Name : Goldi Standerton
Asset # : DSS 176
Meter Reading: 107100 Hours
Model/Year: Spiral Friction Drive Freezer

BAFFELS

SN	Inspection Item	Note	Good	Repair	Replace	NA
1	BAFFLE PLATES TOP	Baffle plates on top are in place and in good condition.	✓	○	○	○

SN	Inspection Item	Note	Yes	No	NA
2	BAFFLE PLATES BOTTOM	Bottom baffels are in place.	✓	○	○

1. BAFFLE PLATES BOTTOM









2. BAFFLE PLATES TOP









BELT

SN	Inspection Item	Note	Readings

3	STEEL OR BLUE BELT		Ashworth steel belt
4	BELT WIDTH		1060
5	TIERS		36 Tiers
6	PITCH		N/A
7	DESIGN		Ashworth steel belt design

3. STEEL OR BLUE BELT



4. BELT WIDTH




BELT OILER

SN	Inspection Item	Note	Good	Repair	Replace	NA
8	BELT OILER BLOCKS	Belt oiler blocks are not blocked.	✓	○	○	○
9	BELT OILER DIVIDER BLOCK	Belt oiler divider blocks is still in good working condition.	✓	○	○	○
10	BELT OILER PIPING	Belt oiler pipes are still in good condition	✓	○	○	○
11	MANUAL RUN OF OILER		○	○	○	−

SN	Inspection Item	Note	Yes	No	NA
12	OIL LEVEL	Oiler is level	✓	○	○


SN	Inspection Item	Note	OK	Faulty	NA
13	BELT OILER WIRING	Belt oiler wiring is in good condition there are no loose or open wires.	✓	○	○
14	PUMP PISTON		○	○	−

8. BELT OILER BLOCKS

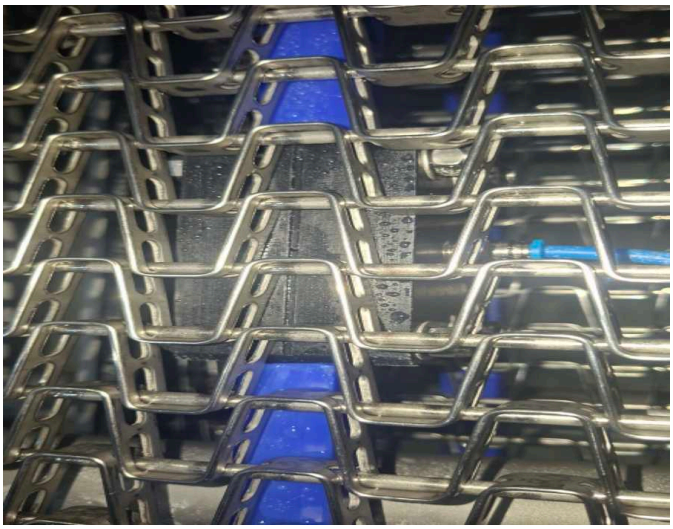







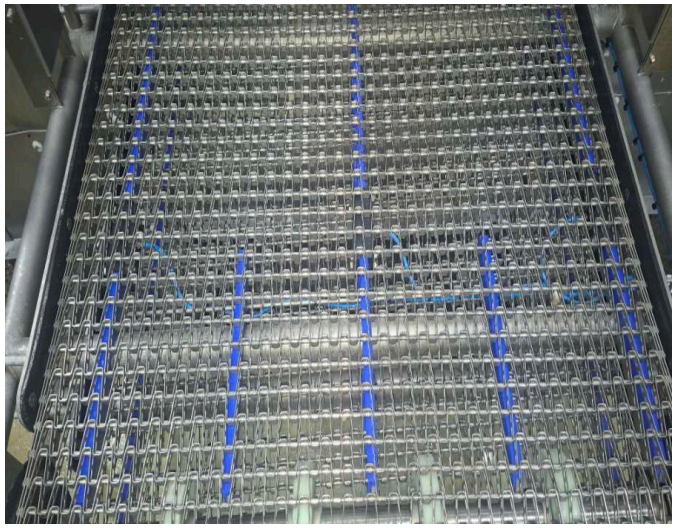


9. BELT OILER DIVIDER BLOCK

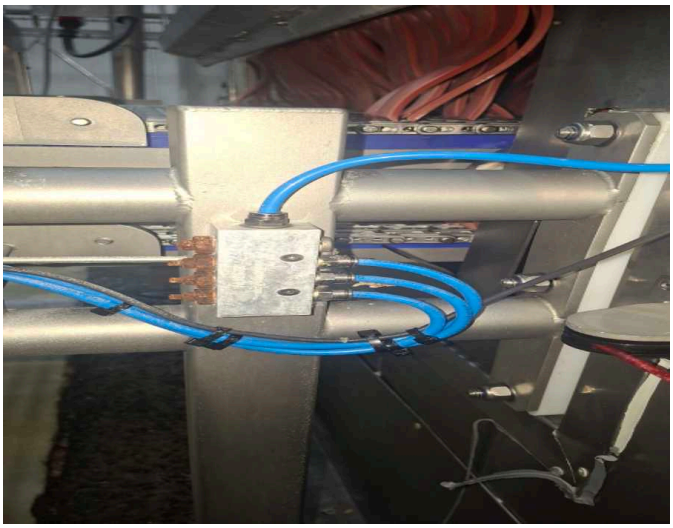

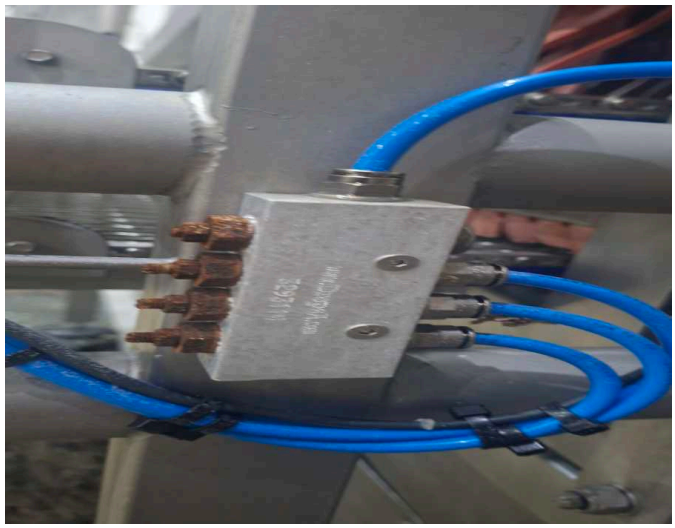

10. BELT OILER PIPING

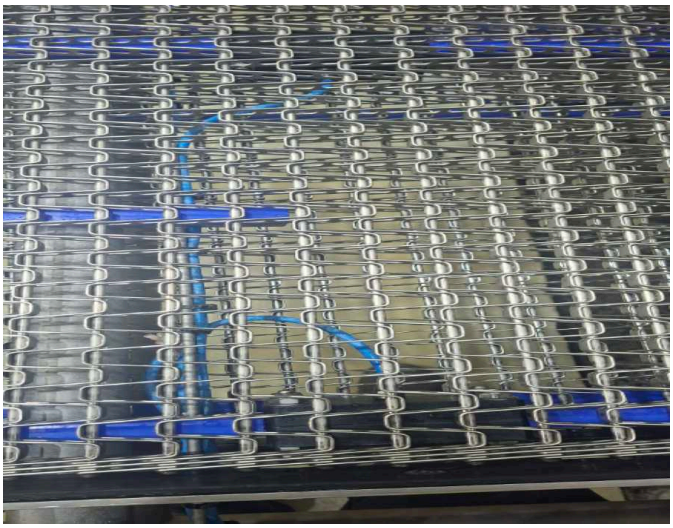







11. BELT OILER WIRING



12. OIL LEVEL



COILS

SN	Inspection Item	Note	Good	Repair	Replace	NA
15	COIL CONDITION	A peace of the coil is damaged,but still in good working condition.	◯	✕	◯	◯
16	PIPE WORK & LAGGING	The covers on the piping need to be replaced or fixed	◯	✕	◯	◯

15. COIL CONDITION










16. PIPE WORK & LAGGING



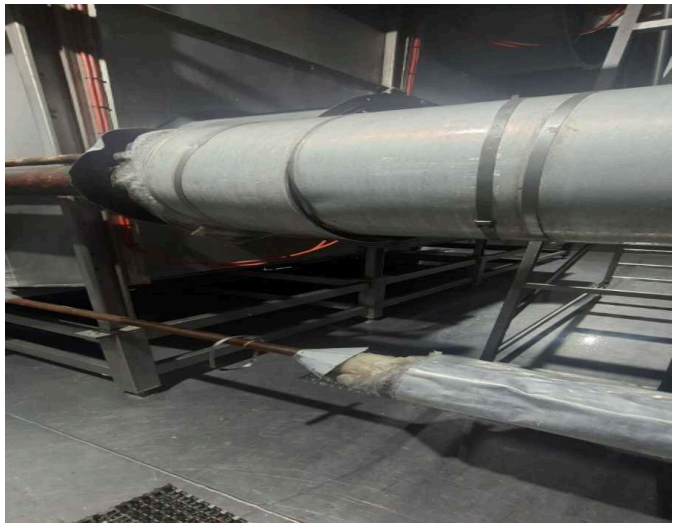



DISCHARGE

SN	Inspection Item	Note	Good	Repair	Replace	NA
17	DISCHARGE SHAFT	Discharge shaft is in a very good condition.	✓	○	○	○
18	SCRAPER	Scrapper is in a good condition.	✓	○	○	○
19	BEARINGS	Bearings haven't been greased in a while.	○	✕	○	○
20	BELT GUIDES	Discharge belt guides are in good condition, but they are not the same please put the green wearstrip back	○	○	✕	○

17. DISCHARGE SHAFT








18. SCRAPER





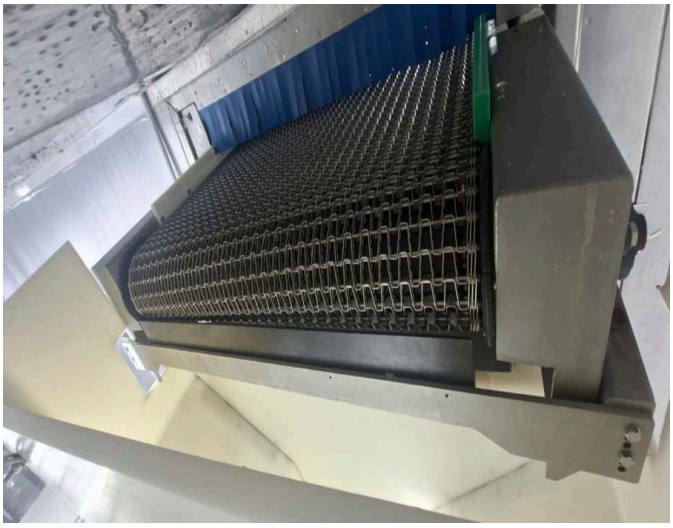



19. BEARINGS









20. BELT GUIDES











DRUM


SN	Inspection Item	Note	Good	Repair	Replace	NA
21	DRUM FASTNERS	Drum fasteners are in place and there are no missing fasteners.	✓	○	○	○
22	DRUM SUPPORTS (SPOKES & RINGS)	Drum supports and spokes are in good condition	✓	○	○	○
23	DRUM CENTER BEARING	Drum center shaft bearing is well greased. Please clean the over-grease off from bearing housing. Bearing size SF216	✓	○	○	○
24	TIE RODS	Tie rods are in good condition	✓	○	○	○
25	DRUM PULL CORD	Drum pull cord is in place	✓	○	○	○

21. DRUM FASTNERS

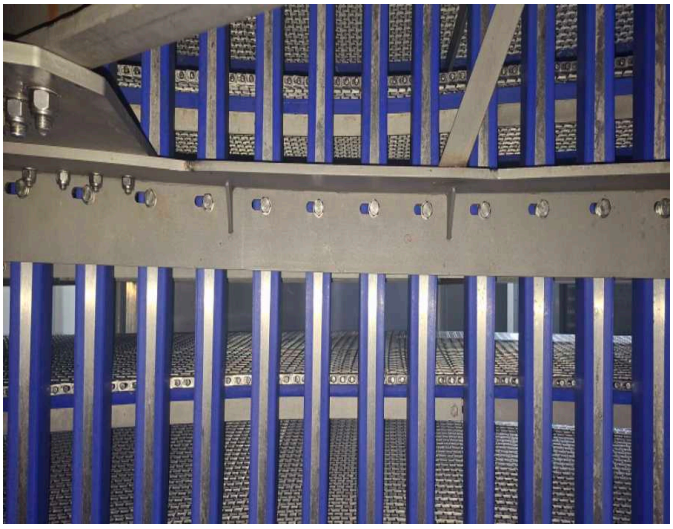



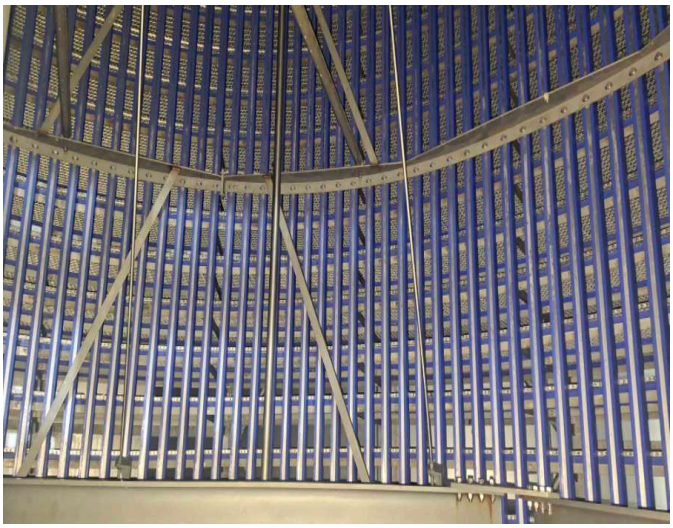


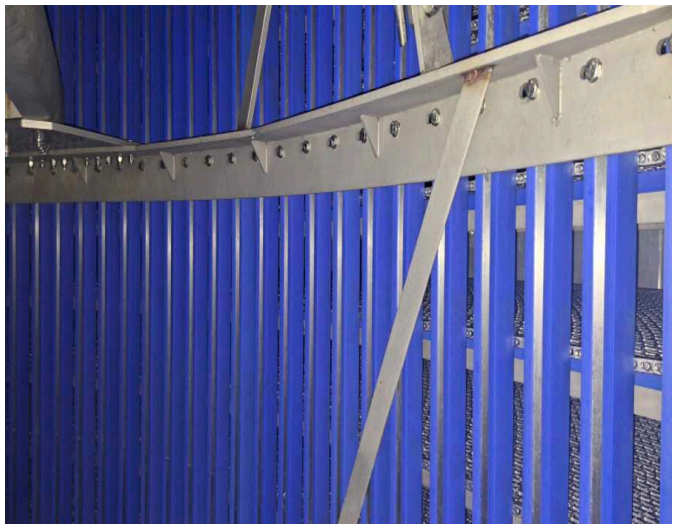


22. DRUM SUPPORTS (SPOKES & RINGS)






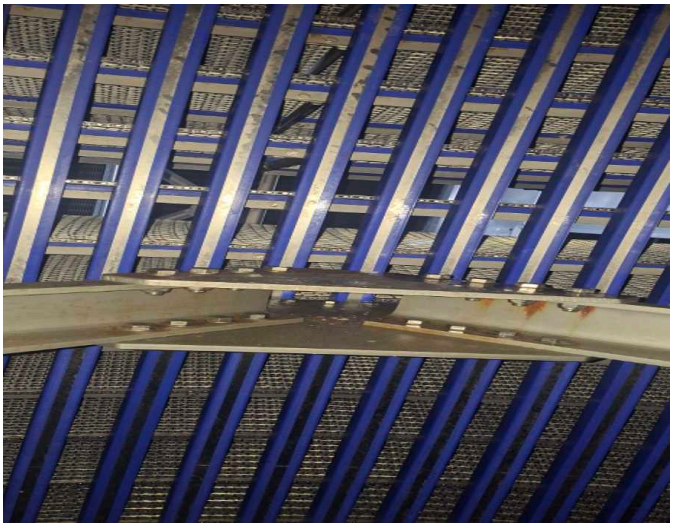

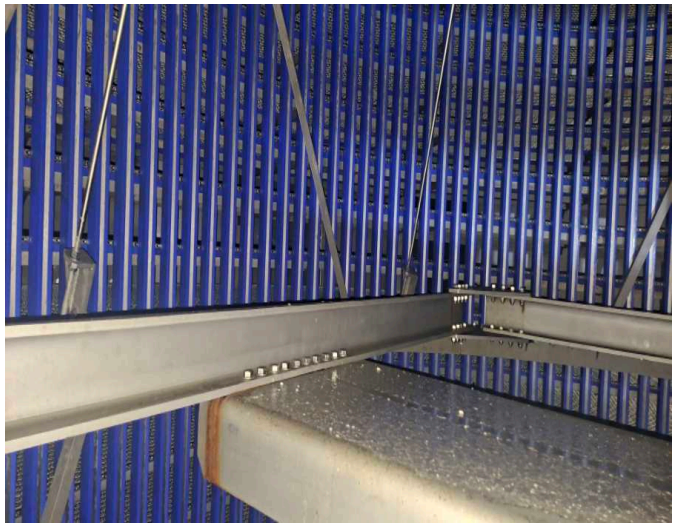

23. DRUM CENTER BEARING

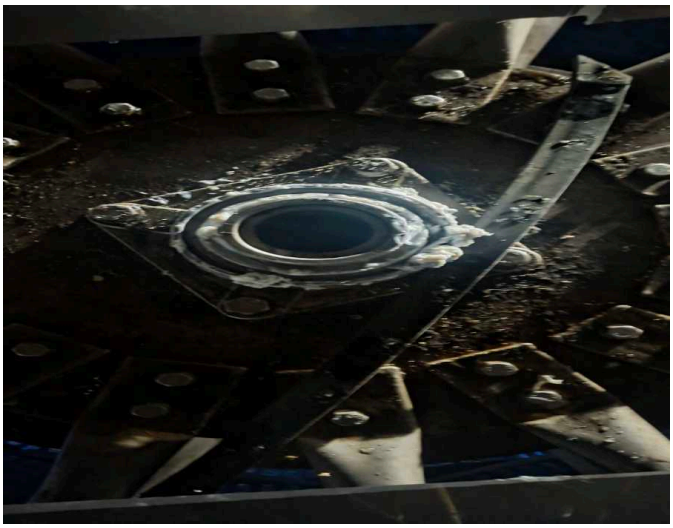









24. TIE RODS





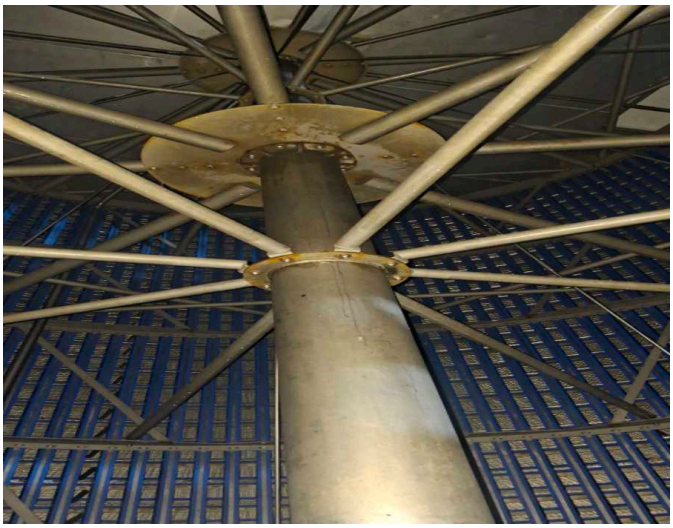

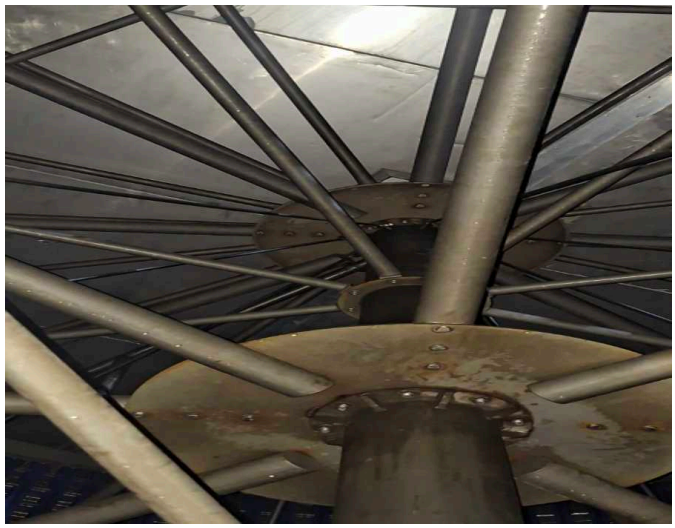

25. DRUM PULL CORD






ELECTRICAL

SN	Inspection Item	Note	Good	Repair	Replace	NA
26	PULL CORDS		✓	○	○	○
27	E-STOPS	All the E-Stops are in good working condition. Have tested and rested at the HMI	✓	○	○	○
28	LIGHTNING	All the lights are in good working condition.	✓	○	○	○
29	TEMPERATURE PROBES	Temperature probes need to be repositioned	○	○	✗	○

26. PULL CORDS



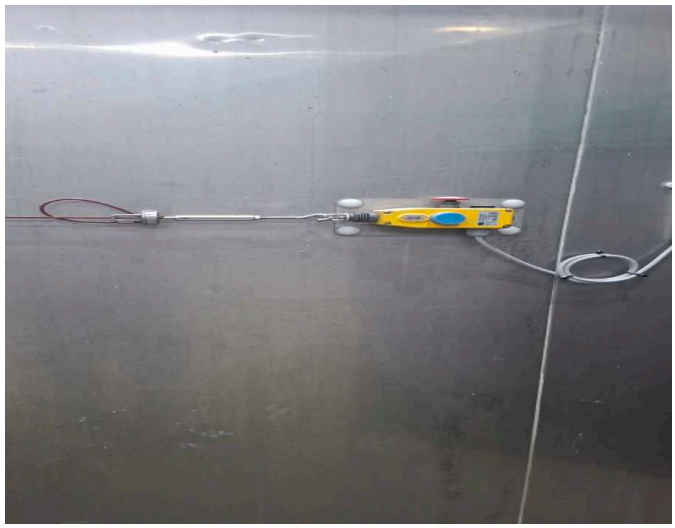






27. E-STOPS







28. LIGHTNING

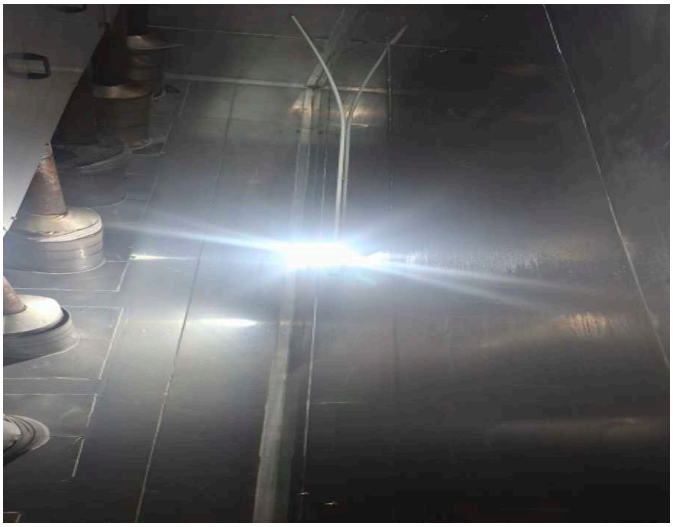









29. TEMPERATURE PROBES

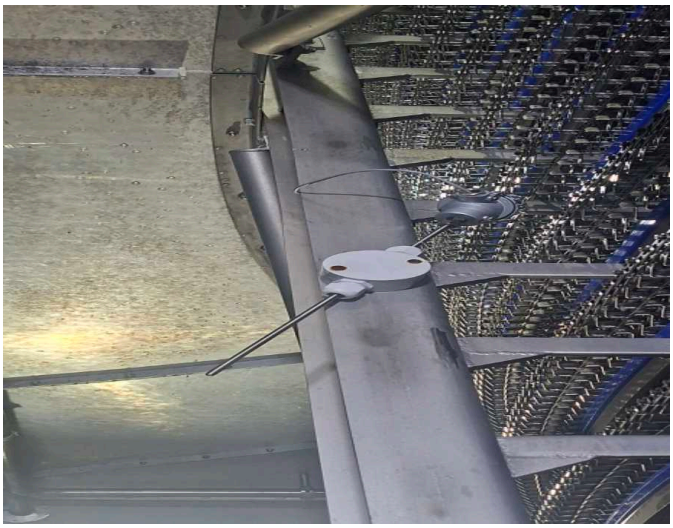

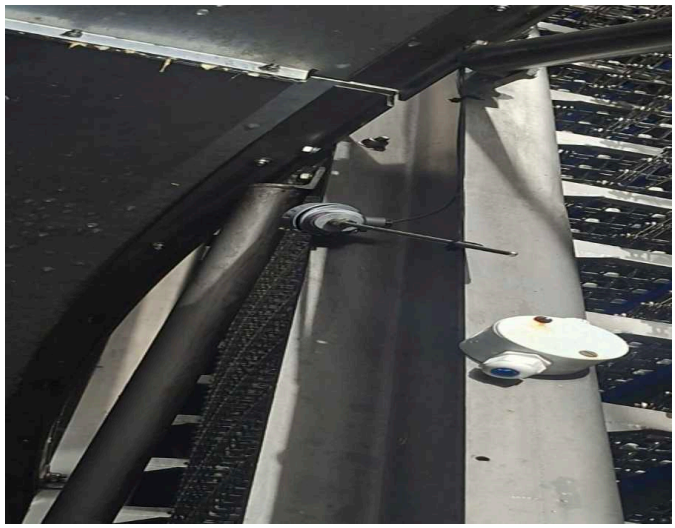

ENCLOSURE

SN	Inspection Item	Note	Good	Repair	Replace	NA
30	DOORS	Door seals are damaged and there is a peace missing	○	○	✕	○
31	FLASHINGS		○	○	○	−
32	WALL PANELS	Wall are in good condition	✓	○	○	○
33	INFEED AND DISCHARGE CURTAINS	In-feed curtains are in place and in good condition. Discharge curtains are in place and in good condition	✓	○	○	○
34	FLOOR	Floor is inngood condition there are no open or broken floor panels.	✓	○	○	○
35	MESS FLOOR	Some places of the mess floor need to be supported	○	✕	○	○
36	INTERNAL DOORS	Internal doors are in a good condition.	✓	○	○	○
37	ENCLOSURE DRAINS	Drains are in good condition	✓	○	○	○
38	CAT LADDER.	Cat ladderbis secure and safe to use	✓	○	○	○

30. DOORS










32. WALL PANELS









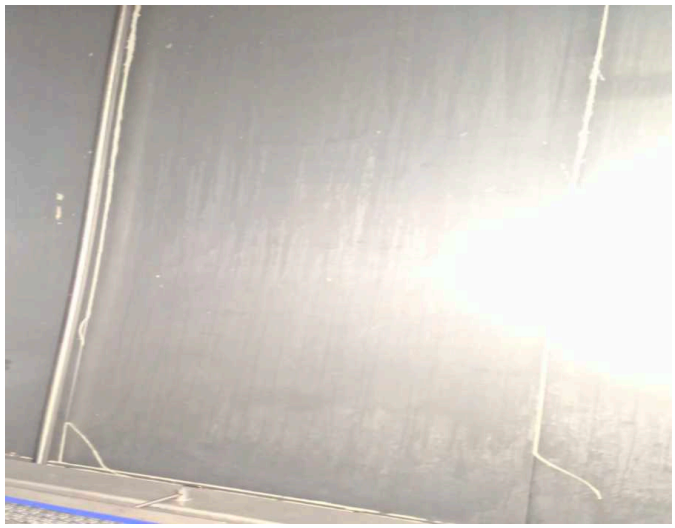

33. INFEED AND DISCHARGE CURTAINS

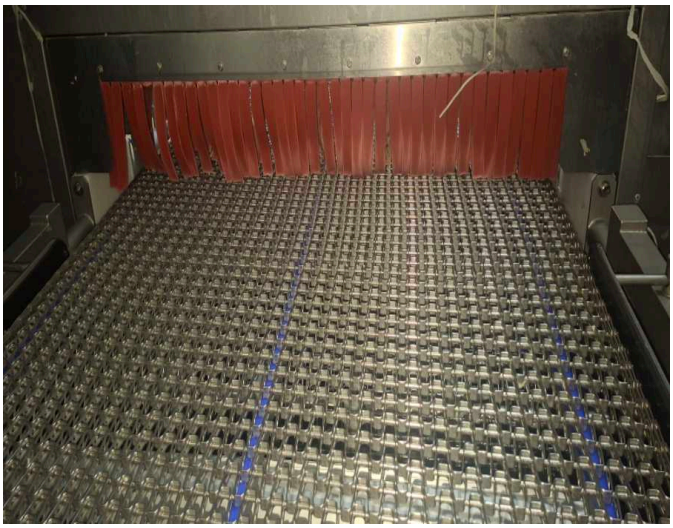

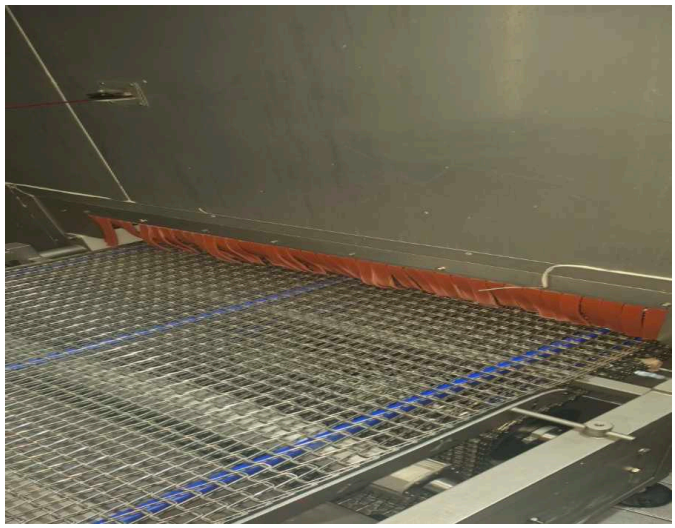







34. FLOOR



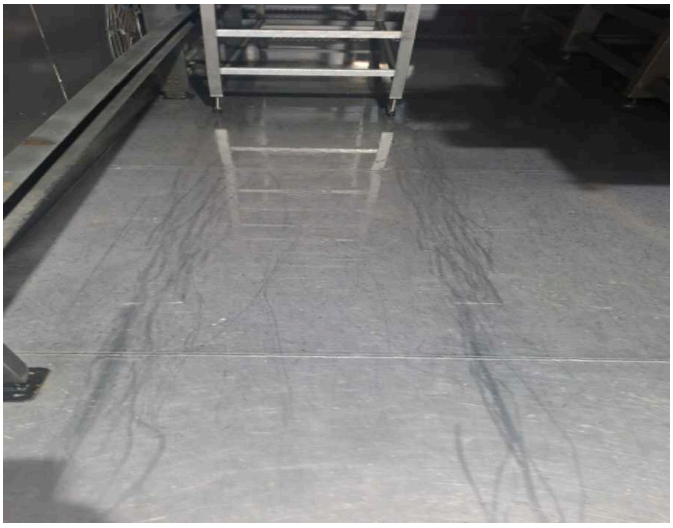


35. MESS FLOOR

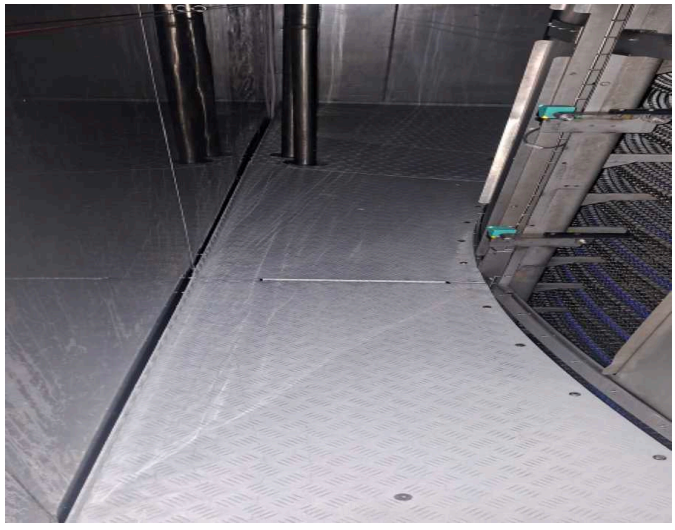



36. INTERNAL DOORS









37. ENCLOSURE DRAINS





38. CAT LADDER.





FANS

SN	Inspection Item	Note	Good	Repair	Replace	NA
39	FANS	Fan are all in place,but some fans doesn't have guards on please fit guards.	○	✕	○	○
40	FAN GUARDS	There are some fans that doesn't have fan guards on. Please fit fan guards.	○	✕	○	○

SN	Inspection Item	Note	Yes	No	NA
41	FANS RUNNING		○	○	⊖
42	MOTOR NOISES		○	○	⊖

SN	Inspection Item	Note	Pass	Fail	NA
43	FAN DIRECTIONS		○	○	⊖

39. FANS









40. FAN GUARDS











IN-FEED FRAME


SN	Inspection Item	Note	Good	Repair	Replace	NA
44	INFEED SHAFT	Infeed shaft flange roller is damaged please replace.	○	○	✕	○
45	BELT GUIDES	Belt guides are in place and in good condition	✓	○	○	○
46	PRODUCT HEIGHT	Product height is in good working condition. Have tested and resetted at the HMI	✓	○	○	○
47	IN-FEED RETURN SHAFTS	In-feed return shaft is in good condition.	✓	○	○	○
48	BEARINGS	Bearings are running dry please grease. Bearing size P206	○	✕	○	○

44. INFEED SHAFT



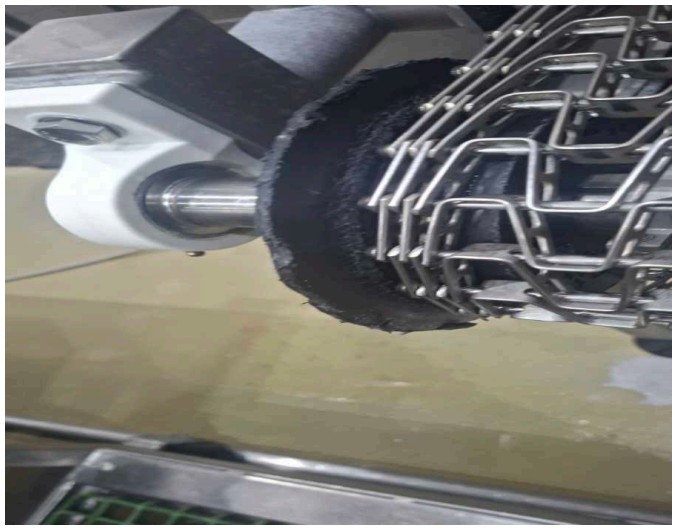


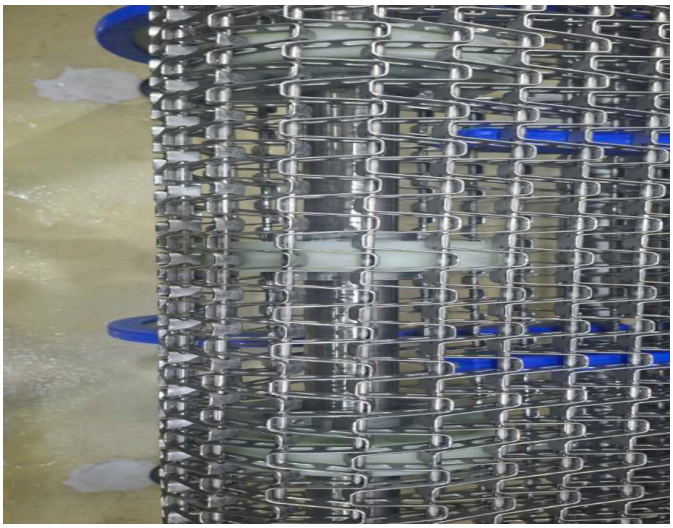

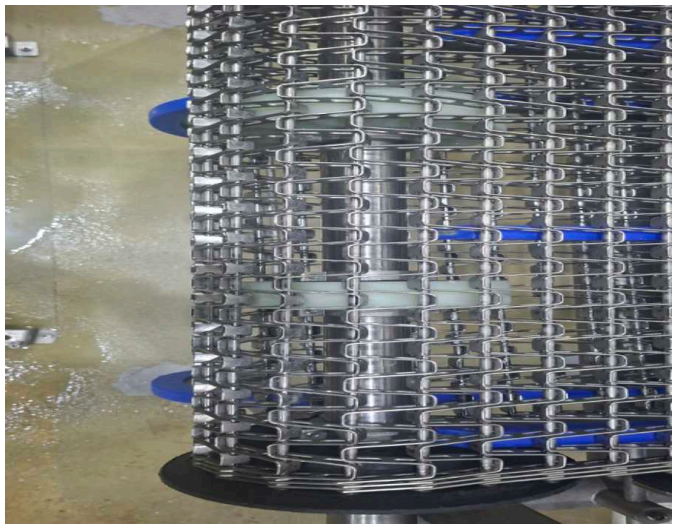

45. BELT GUIDES



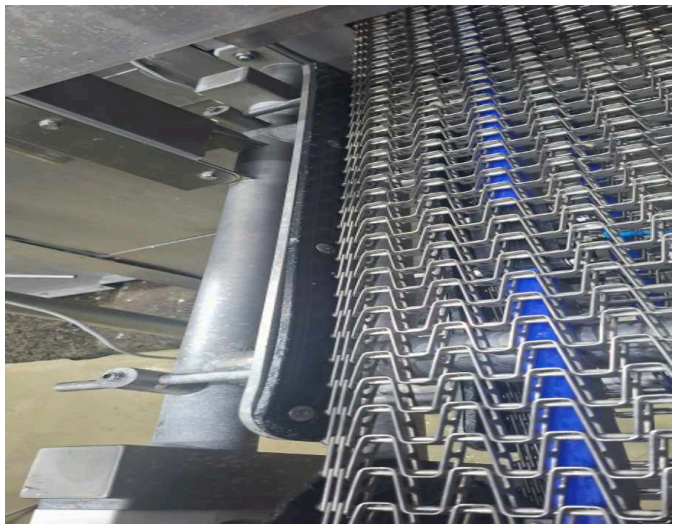







46. PRODUCT HEIGHT






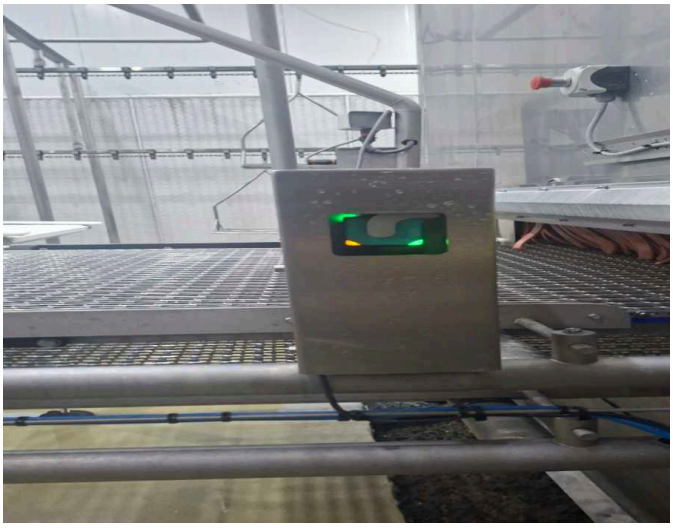


47. IN-FEED RETURN SHAFTS

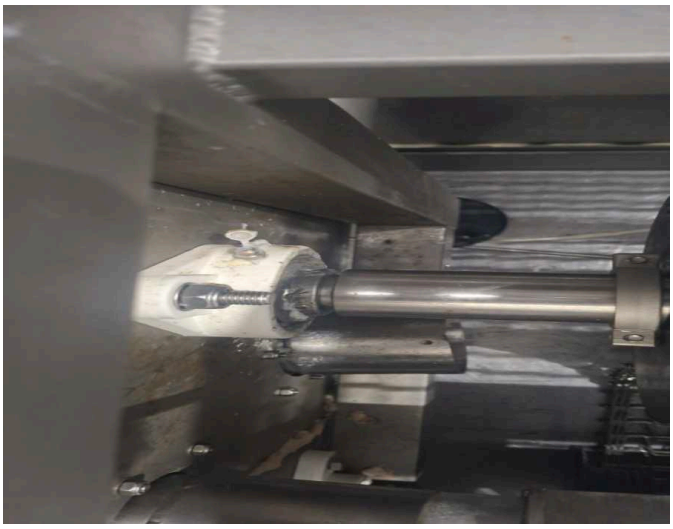





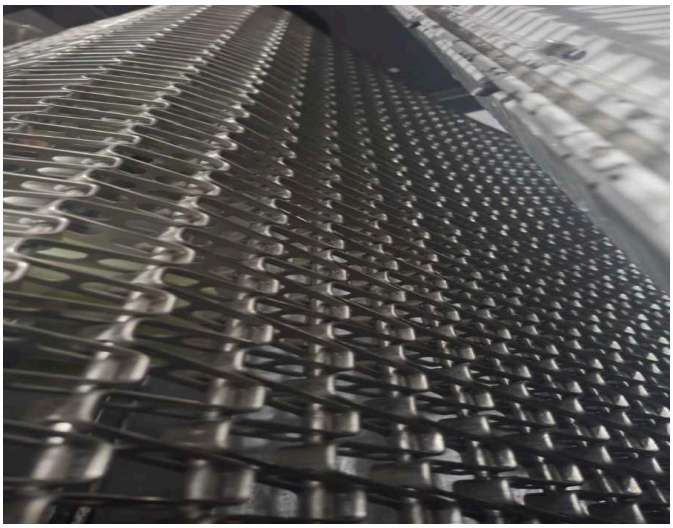

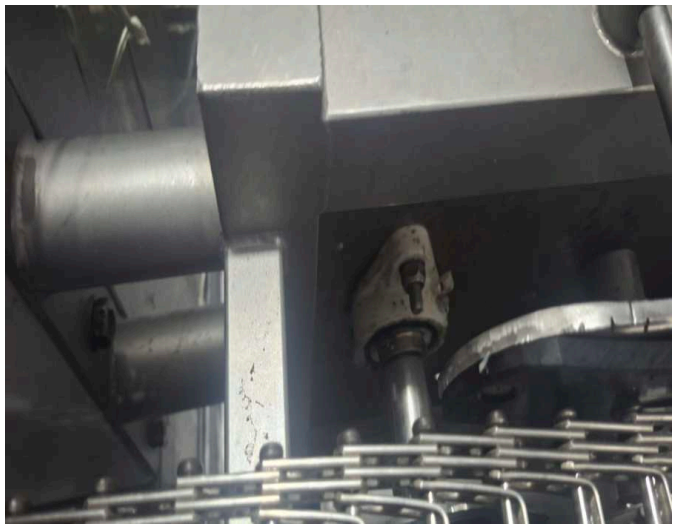

48. BEARINGS

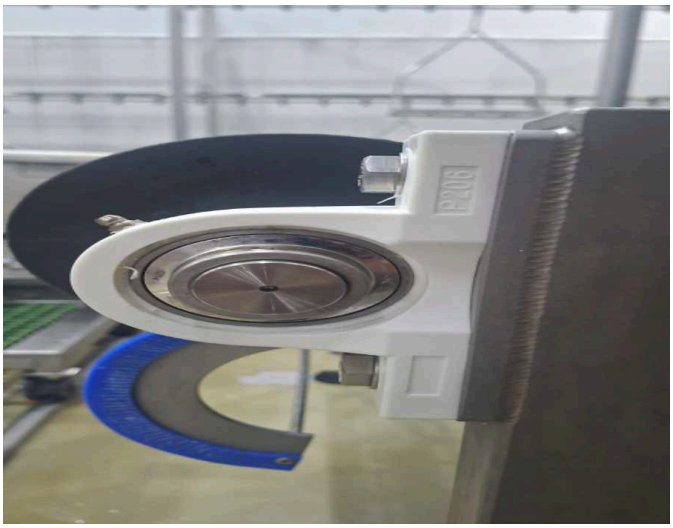

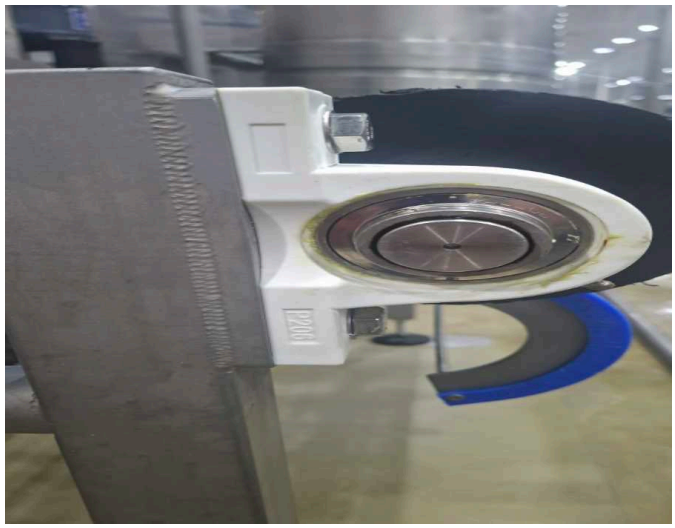





MAIN DRIVE GEARBOX


SN	Inspection Item	Note	Good	Repair	Replace	NA


49	MAIN DRIVE GEARBOX	Main drive gearbox is in a good condition there are no visible oil leaks from the gearbox and from the motor	✓	○	○	○
50	HEADER TANK	Header tank is in good condition,there are no visible oil leaks.	✓	○	○	○
51	MAIN DRIVE ELECTRICAL MOTOR	Main drive electrical motor is in good working condition and there are no visible oil leaks from the motor side	✓	○	○	○

49. MAIN DRIVE GEARBOX






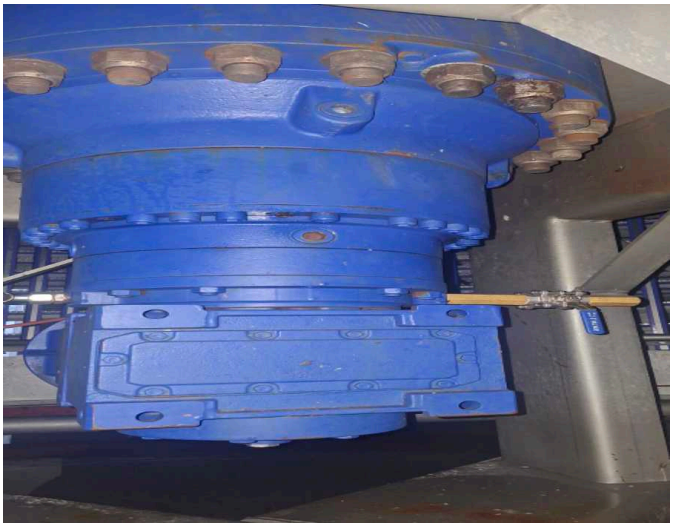


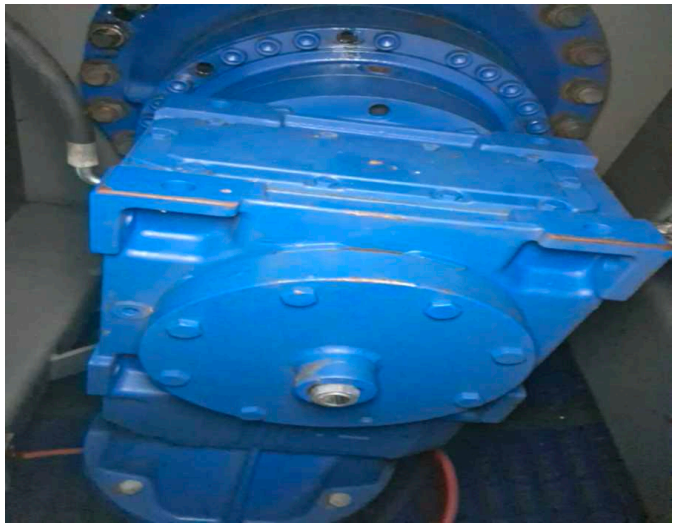

50. HEADER TANK

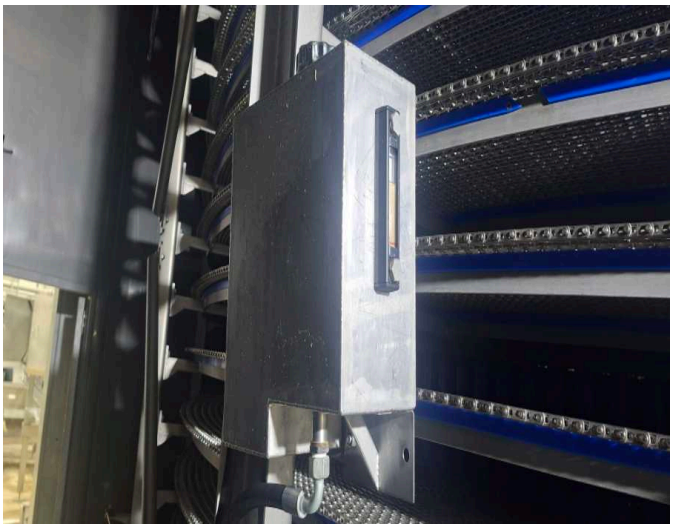




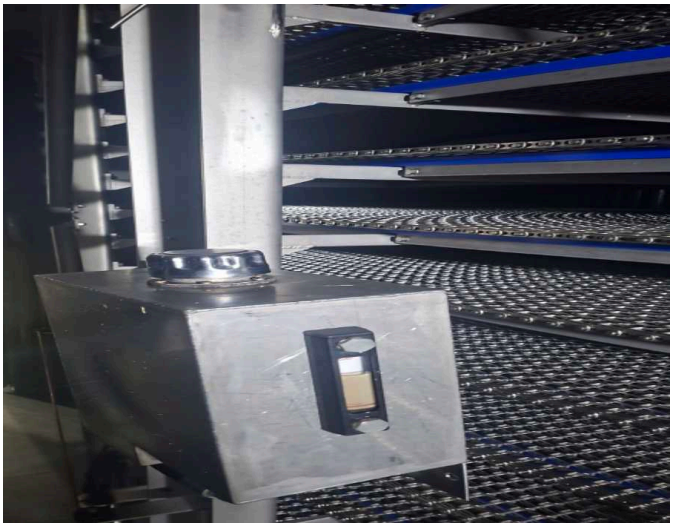

51. MAIN DRIVE ELECTRICAL MOTOR



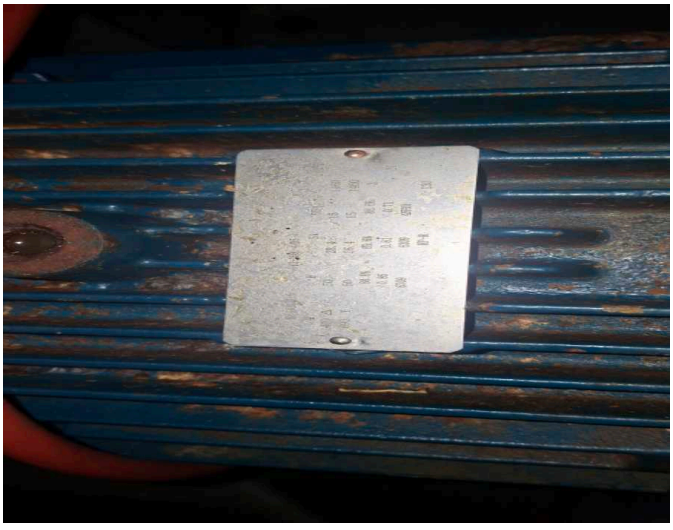





PANEL


SN	Inspection Item	Note	Good	Repair	Replace	NA
52	PANEL CONDITON	The control panel is in a good condition	✓	○	○	○
53	HMI	HMI screen is clear and visible also in a good condition	✓	○	○	○

52. PANEL CONDITON








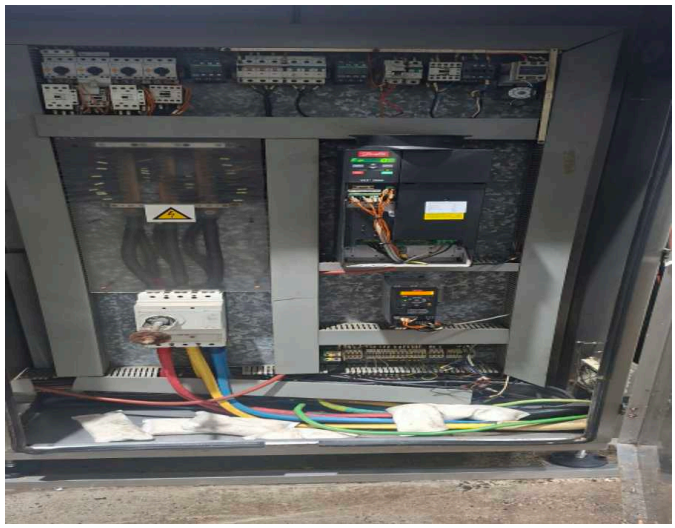

53. HMI

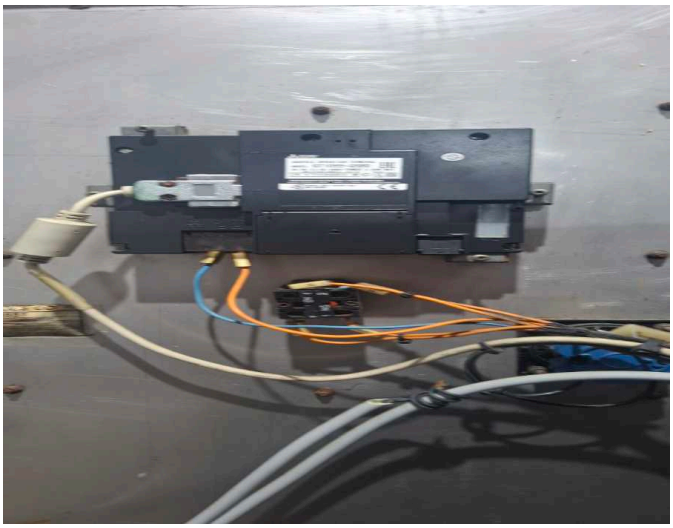







SPIRAL FRAME

SN	Inspection Item	Note	Good	Repair	Replace	NA

54	RAIL ARMS & RAILS	Rail arms and rails are in good condition. There are no bent arms or missing rails	✓	○	○	○

54. RAIL ARMS & RAILS

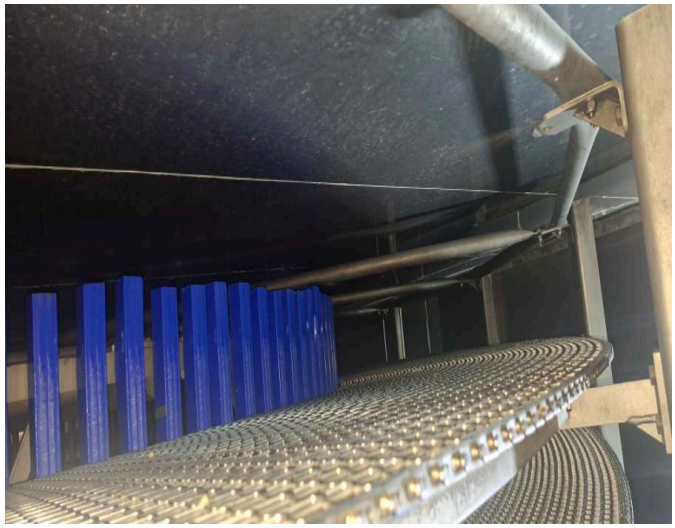


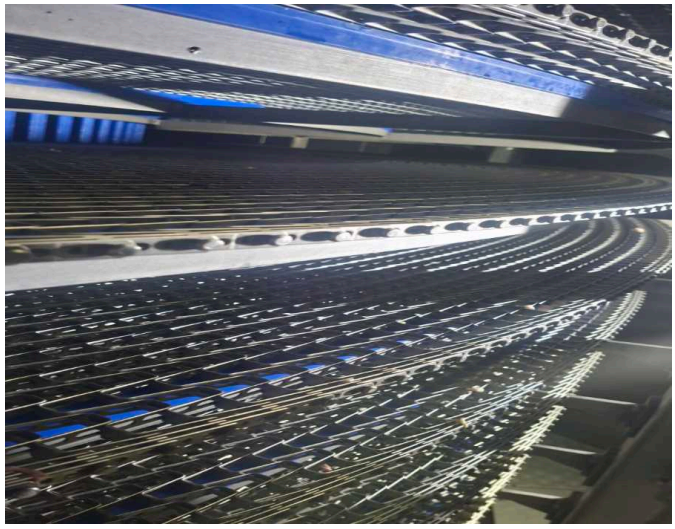


SPIRAL RUNNING CONDITION

SN	Inspection Item	Note	Good	Repair	Replace	NA
55	TEST RUN SPIRAL	Did run the freezer spiral. There are no hooking or other noises.	✓	○	○	○

55. TEST RUN SPIRAL

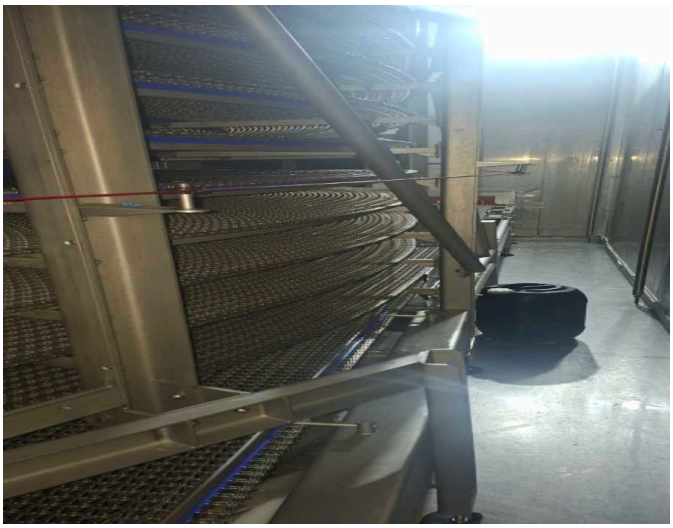







SPUTNIK FRAME

SN	Inspection Item	Note	Good	Repair	Replace	NA
56	SPUTNICK FASTNERS	Sputnick fastners are in good good condition,there are no missing or rusted fasteners.	✓	○	○	○

SN	Inspection Item	Note	Yes	No	NA
57	SPUTNIK FRAME LEVEL		○	○	−

56. SPUTNICK FASTNERS









TAKE-UP FRAME

SN	Inspection Item	Note	Good	Repair	Replace	NA
58	OVER DRIVE SHAFT	Over drive shaft bearings,roller,collars,sprockets and flanges are still in a good condition.	✓	○	○	○
59	OVER DRIVE GEARBOX & MOTOR	Overdrive gearbox is leaking from output shaft seal	○	○	✗	○
60	TAKE-UP IDLER SHAFTS	Take up idler shaft bearings,rollers,collars and flanges are still in good condition. Please clean old grease off from bearing housing. Bearing size FL206	✓	○	○	○
61	WEIGHTED ROLLER & WEIGHT BOX	Weighted rollersf,flanges are in good condition.	✓	○	○	○
62	ELECTRICAL	There are no loose or open connections cables are still in good condition.	✓	○	○	○

63	TAKE UP RETURN STATION	Take up return station is in good condition bearings are well greased. Bearing sizes FL206	✓	○	○	○
64	BELT GUIDES ON TAKE-UP AND RETURN	Belt guides are in place and in good condition.	✓	○	○	○

SN	Inspection Item	Note	Yes	No	NA
65	TAKE-UP BAFFLES.		○	○	−

58. OVER DRIVE SHAFT









59. OVER DRIVE GEARBOX & MOTOR










60. TAKE-UP IDLER SHAFTS









61. WEIGHTED ROLLER & WEIGHT BOX

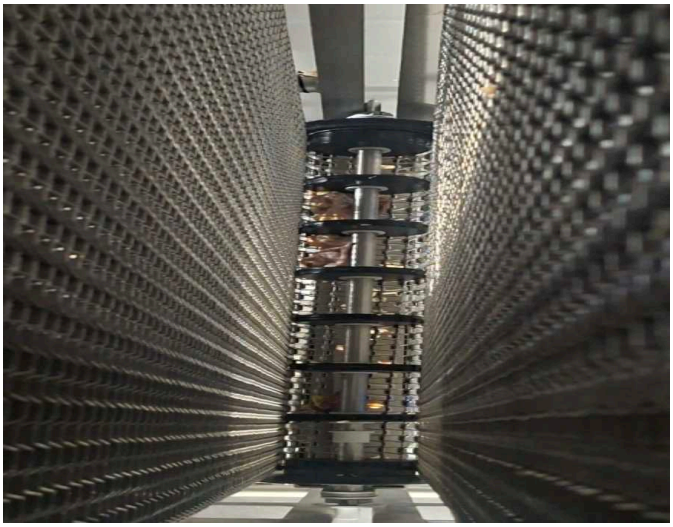

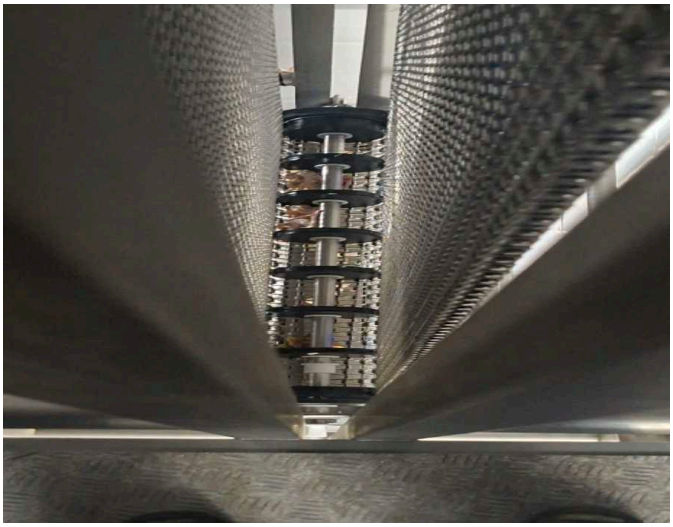

62. ELECTRICAL



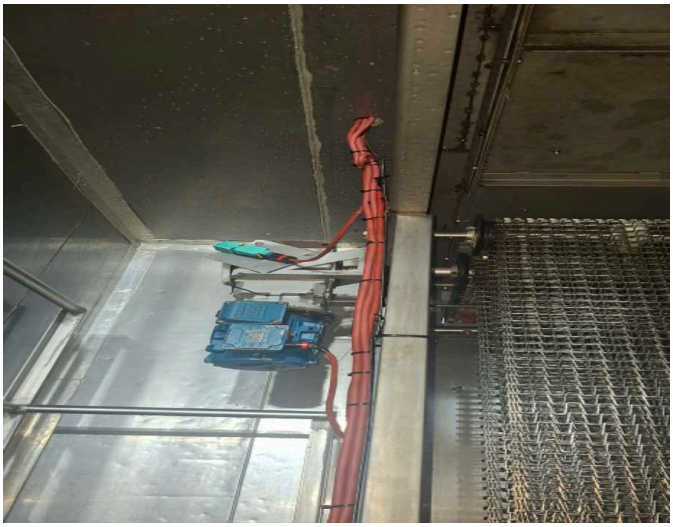


63. TAKE UP RETURN STATION








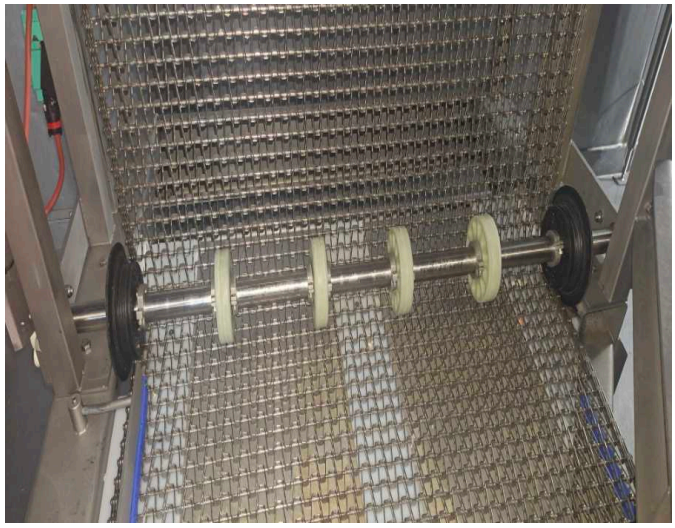

64. BELT GUIDES ON TAKE-UP AND RETURN

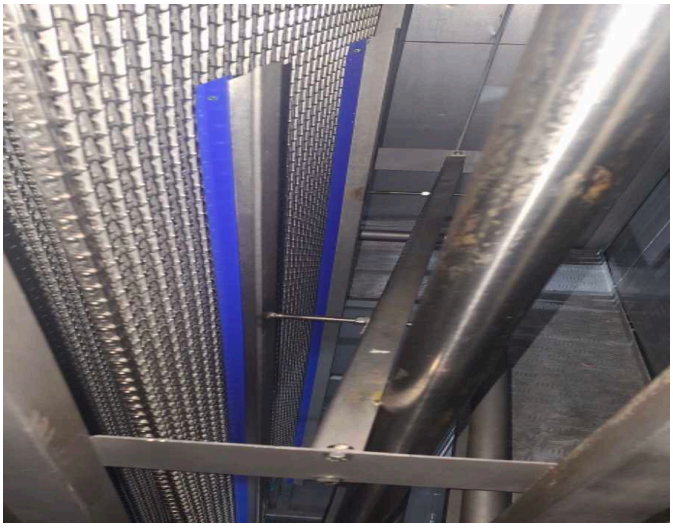








TIER LIFTS

SN	Inspection Item	Note	Good	Repair	Replace	NA
66	FLIP FLOPS	Flip-flops are in good working condition.	✓	○	○	○
67	TIER LIFT SENSORS	Tier lift sensors are all working and in place.	✓	○	○	○

66. FLIP FLOPS



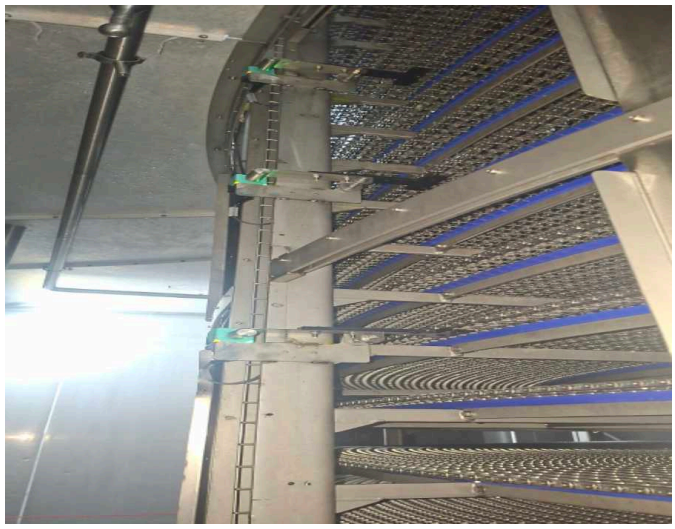







67. TIER LIFT SENSORS





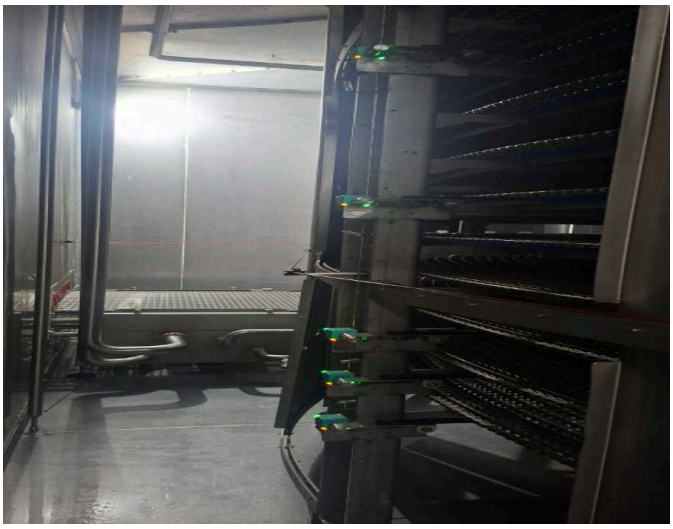

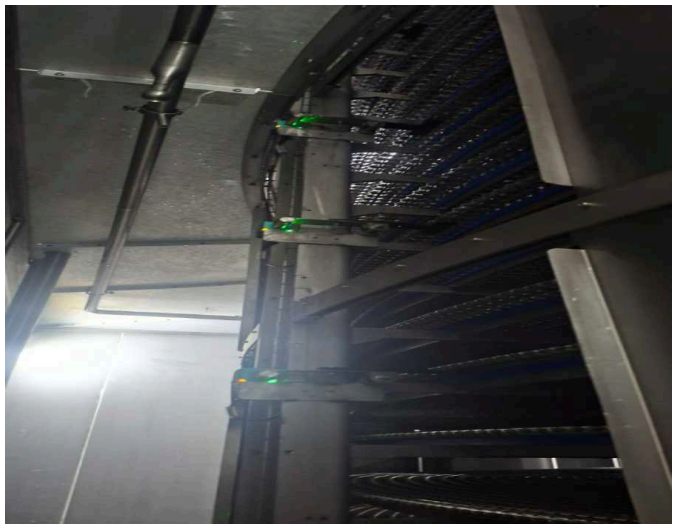

WEAR-STRIPS


SN	Inspection Item	Note	Good	Repair	Replace	NA

68	DRUM BAR WEAR-STRIP	Drum-bars wearstrips are still in place and in good condition.	✓	○	○	○
69	RAIL WEAR-STRIP	Rail wearstrip is still in good condition. There are no missing wearstrips.	✓	○	○	○

68. DRUM BAR WEAR-STRIP







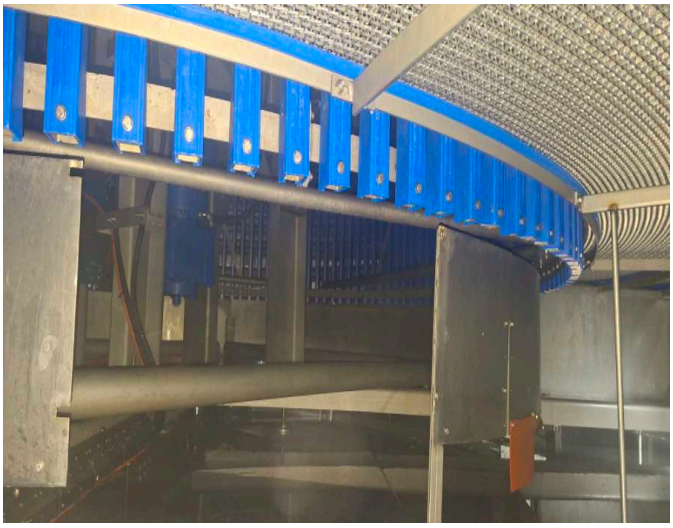





69. RAIL WEAR-STRIP

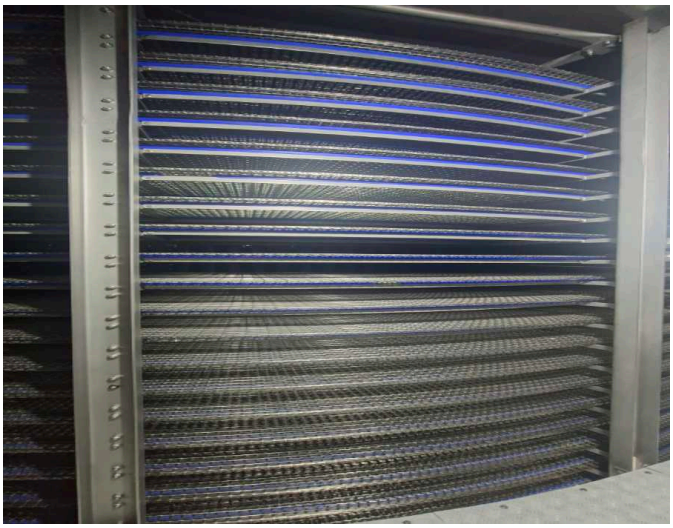

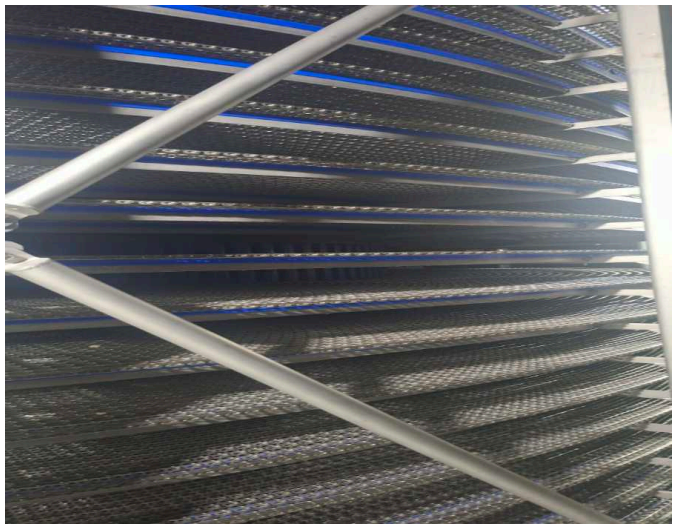

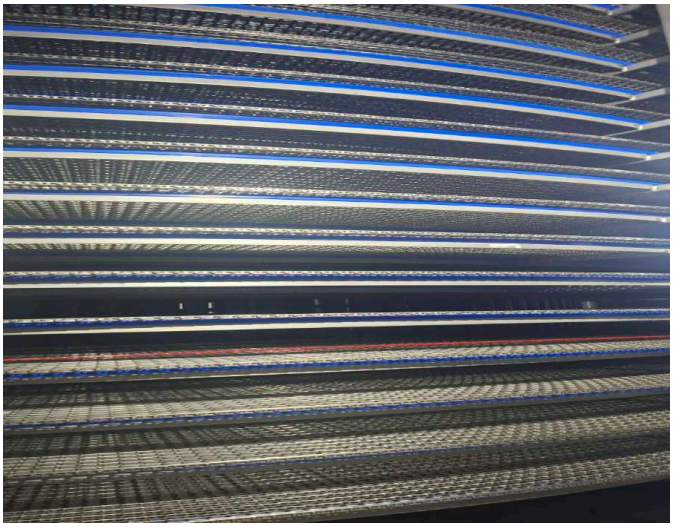

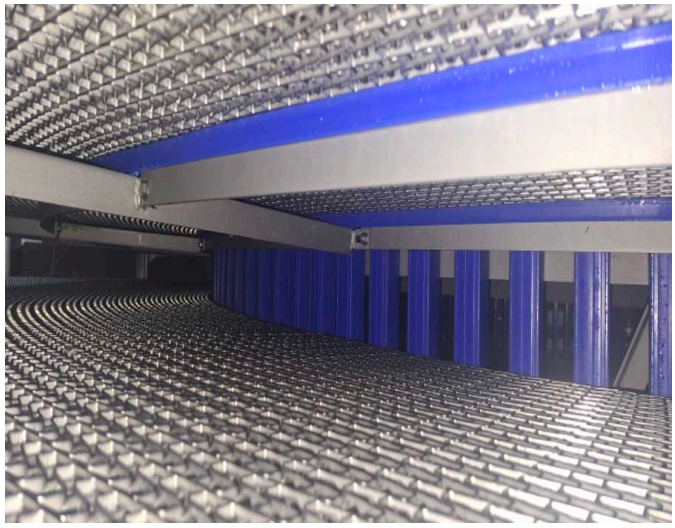

Additional Note

Overall Condition:	Minor Repair required
Asset Safe to Use:	**Yes**
Maintenance Required:	Yes
Asset Status	Maintenance Required
Maintenance Priority:	Medium

Custom Business Fields

Client Name : Goldi Standerton.

Contact details : 0114620044



_____ _____

Dale Technician Signature **Client Signature**