

Axis Plumbing NSW BW-24187	INSPECTION & TEST PLAN		ITP NUMBER: 016	Revision No: A	Sanitary Plumbing
	Approved for use by Darren Shoobridge, Project Manager		ITC # 000001	Revision Date: 24/09/2026	
	Riverside Precinct — Building A		Progress 100% · Reviewed & approved		

W - Witness; H - Hold Point; S - Surveillance; X - Self Inspection

Drawing Number	HC-201 REV C	Area	Level 3 — Amenities and Riser — Level 3, Grid 4-7
Location / Loc.Ref	CONTROLD0C > HYDRAULICS > SANITARY PLUMBING		

MATERIALS:

Item:	Requirements:	Batch / cert. ref.	Check
Sanitary pipework	PVC-U DWV to AS/NZS 1260, WaterMark certified	DWV PVC-U 100/65/50, WM-020458	X
Fittings and solvent cement	AS/NZS 1260 fittings, priming fluid and cement to AS/NZS 3879	Solvent cement type P, Batch 24-0917	X
HDPE pipework (where specified)	PE to AS/NZS 5065 with electrofusion / butt fusion joints	Inspection openings, WM-020458	X
Brackets and supports	Proprietary supports at the centres required by AS/NZS 3500.2 Section 8	Brackets and clips, Batch 24-0955	X
Fire collars	Tested system to AS 4072.1 matching the FRL of the element penetrated	Vent cowls, WM-021234	X

INSPECTION & TEST PLAN

No.	Installation:	Acceptance Criteria	Point	Initial & Date
1.0	Check current revision of drawings issued for construction, including any RFI or site instruction affecting this area.	In accordance with the project Drawing Register. Superseded revisions removed from site.	X	DS 24/09/2026
2.0	Set out sanitary plumbing against the coordinated services model / shop drawings. Confirm no clash with structure, ductwork, electrical or ceiling zones and that the design falls or grades can be achieved.	In accordance with the coordinated shop drawings and the hydraulic specification. Clashes resolved and reissued before installation.	X	DS 24/09/2026
3.0	Check materials delivered to site for compliance and damage (PVC-U DWV / HDPE — check for damage and correct SN/class). Record batch / lot numbers and WaterMark or certification details.	In accordance with AS/NZS 3500.2:2021 Section 2.3 'Selection and Use of Materials and Products', WaterMark certification and the hydraulic specification.	X	DS 24/09/2026
4.0	Check pipe support, bracketing and fixing centres, including provision for thermal movement and seismic restraint where specified.	In accordance with AS/NZS 3500.2:2021 Section 8 'Fixing and Support', manufacturer's requirements and the hydraulic specification. Fixings suitable for the substrate.	X	DS 24/09/2026
5.0	Check pipe sizes, grades and fall of all branch and stack pipework against the approved drawings. Grade achieved: 1.65 %	In accordance with AS/NZS 3500.2:2021 Section 6 'Sanitary Plumbing' and Section 3.4 for grades. Minimum falls achieved throughout.	X	DS 24/09/2026
6.0	Check trap types, seal depths and trap ventilation for each fixture group. Trap seal depth: 50 mm	Trap seal depth and venting in accordance with AS/NZS 3500.2:2021 Section 6 'Venting' and Section 10. No unvented arrangement outside the permitted limits.	X	DS 24/09/2026
7.0	Check stack offsets, expansion joints, and provision for building and thermal movement.	In accordance with AS/NZS 3500.2:2021 and the pipe manufacturer's requirements. Anchors and guides installed as detailed.	X	DS 24/09/2026
8.0	Check inspection openings and access points to stacks and branches are provided and accessible after fit-out.	In accordance with AS/NZS 3500.2:2021 and the approved drawings. Access panels coordinated with the architect.	X	DS 24/09/2026
9.0	Check penetrations through fire and acoustic rated elements are sealed with a tested and approved system. Note: Fire collars installed by others to the tested system; penetrations witnessed and photographed before closing in.	Fire collars / wraps installed in accordance with AS 4072.1 and the tested system, matching the FRL of the element penetrated. Acoustic seals in accordance with the acoustic report.	M	DS 24/09/2026
10.0	Check acoustic lagging to stacks and branches within noise-sensitive areas.	In accordance with the acoustic report and the hydraulic specification. Lagging continuous, including at brackets and penetrations.	X	DS 24/09/2026
11.0	Hydrostatic test with water to finished ground level, minimum test duration of 15 minutes. Test duration held: 30 minutes Released by M. Hartley (INSP-3341) 24/09/2026	15 minutes or greater with no loss of water, in accordance with AS/NZS 3500.2:2021 Section 15 'Testing'.	W	DS 24/09/2026
12.0	Air test the installed section, pressurised and stabilised prior to timing the test. Test pressure held: 1500 kPa Released by M. Hartley (INSP-3341) 24/09/2026	Test pressure of 30 kPa held for a minimum of 15 minutes with no measurable loss, in accordance with AS/NZS 3500.2:2021 Section 15 'Testing' and the hydraulic specification.	W	DS 24/09/2026
13.0	Apply pipe identification and directional flow markings to the sanitary plumbing.	Black / "SANITARY" identification in accordance with AS 1345 and AS 2700, at intervals and locations required by the hydraulic specification.	X	DS 24/09/2026
14.0	Seal test gates and cap all open ends on completion of the section.	Dust caps and temporary seals fitted to all open ends to prevent ingress of debris.	X	DS 24/09/2026
15.0	Flush pipework on completion of that section and confirm free discharge.	In accordance with the hydraulic specification. No debris, free flow	X	DS


INSPECTION & TEST PLAN				
No.	Installation:	Acceptance Criteria	Point	Initial & Date
		observed at the downstream point.		24/09/2026
16.0	Final visual inspection of the completed installation; make good all damage, protective coatings and surrounds.	No visible defects. Area left clean and all protection removed. Defects register updated.	X	DS 24/09/2026
17.0	Record as-installed dimensions, invert levels and deviations for the as-built / work-as-executed drawings.	Marked-up drawings and survey pick-up submitted to the design team prior to covering.	X	DS 24/09/2026

TEST RECORD (3.0)	
AXIS SIGN-OFF	ADDITIONAL SIGN-OFF (CLIENT / SUPERINTENDENT)
Step 1 Australian Standard minimum test criteria Name: Darren Shoobridge	AS/NZS 3500.2:2018 section 15.2 · 30 kPa · 15 minutes Name: M. Hartley
Step 2 Service: Sanitary Plumbing	Company: BESIX WATPAC
Step 3 Date completed: 24/09/2026 Test type: AIR TEST	17 of 17 applicable items signed
Step 4 Date of test Signature: _____ Date: 24/09/2026	Signature: _____ Date: 24/09/2026
Step 5 Final test — time started / ended	
Step 6 Pressure at start (kPa)	
Step 7 Pressure loss (kPa) or loss at end (ml)	
Step 8 Test equipment	
Step 9 Total loss (kPa) or make-up water (ml)	
Step 10 Test pass	
Step 11 ITP compliance check complete	
Step 12 Additional notes	

PHOTOGRAPHIC RECORD

ITP 016 — Sanitary Plumbing · Level 3 — Amenities and Riser · Level 3, Grid 4-7

Plan extract — HC-201 REV C · Level 3 hydraulic services — layout · 1 highlighted extent, 1 location marked

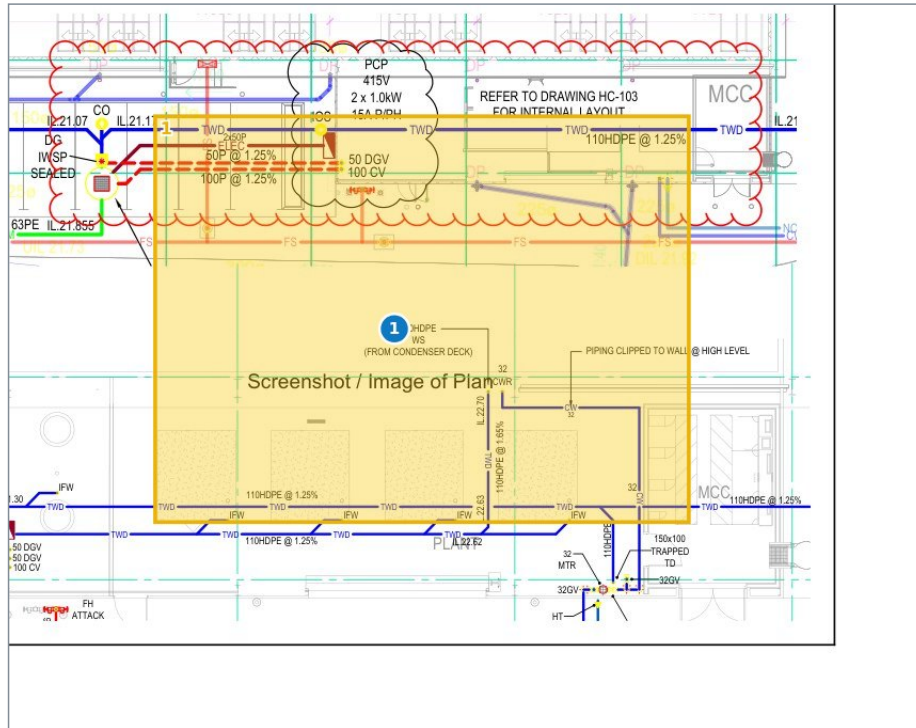

1. Yellow area — Level 3 amenities — sanitary plumbing extent
1. Stack SS-01 at grid 5, connection to Level 2 below (1 photo)

Photographs (3)



24/09/2026 05:45:48
ITP 016 — Sanitary Plumbing
Level 3 — Amenities and Riser · Item 1.0

Item 1.0 · Installation
24/09/2026 05:45:48 (recorded)



24/09/2026 05:45:59
ITP 016 — Sanitary Plumbing
Level 3 — Amenities and Riser · Item 3.0

Item 3.0 · Installation
24/09/2026 05:45:59 (recorded)



24/09/2026 05:46:29
ITP 016 — Sanitary Plumbing
Level 3 — Amenities and Riser · Pin 1

Pin 1 · Installation
24/09/2026 05:46:29 (recorded)