

UDROŻNIENIE ŁÓDZKIEGO WĘZŁA KOLEJOWEGO (TEN-T), ETAP II, ODCINEK ŁÓDŹ FABRYCZNA - ŁÓDŹ KALISKA/ŁÓDŹ ŻABIENIEC – PROJEKT POIIS 5.1-15

TBM 13.08 M - CONSTRUCTION FOLLOW-UP

IDENTIFICATION TABLE

Client	PBDiM - Energopol
Project	Udrożnienie Łódzkiego Węzła Kolejowego (TEN-T), Etap II, Odcinek Łódź Fabryczna - Łódź Kaliska/Łódź Żabieniec – Projekt POIIS 5.1-15
Task	TBM 13.08 m - CONSTRUCTION FOLLOW-UP
Type of document	Daily Report 03/09/2024
Date	04/09/2024
Document ID	LWK-000-T-KO-SWS-210476_00.docx
Language	English
Number of pages	11

AUTHOR		REV
Opracował	Miriam Polizzi	00
Projektant	Paolo Cucino - Inżynierska mostowa i konstrukcyjno-budowlana, upr. nr ŁOD/TR/0247/19	SWS Engineering S.p.A. Via della Stazione, 27 38123 Trento Cod. Fisc. 00580910222 P.IVA: 00580910222

INDEX

1.	INTRODUCTION	3
2.	FACE PRESSURES AND EXCAVATION VOLUMES	4
3.	THRUST AND CUTTERHEAD TORQUE	5
4.	GROUT INJECTION	6
5.	GUIDANCE	7
6.	MONITORING	8
7.	COMPENSATION GROUTING ACTIVITIES	10
8.	SOIL CONDITIONING	11

1. INTRODUCTION

S-1222 TBM EPB machine with 13.08 m excavation diameter is currently mining Axis 23, in the section between Polesie Station and Śródmieście Station. TBM has restarted from chainage 1+962.

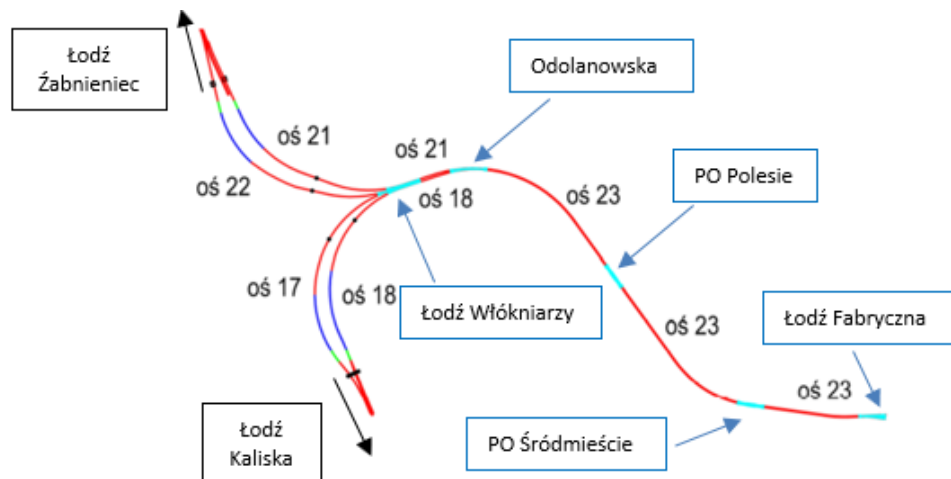


Figure 1-1 Overview of main structural elements of the Project

This daily follow-up report aims to give a general overview of S-1222 TBM drive during 03/09/2024. It includes EPB face pressure, belt scale parameters, thrust and torque values, primary grout parameters, guidance, as well as monitoring follow-up data.

According to VMT system, TBM is at Chainage 1+647.17 after the erection of ring n. 257; which corresponds to a total excavation length of 319.3 m from the starting chainage.

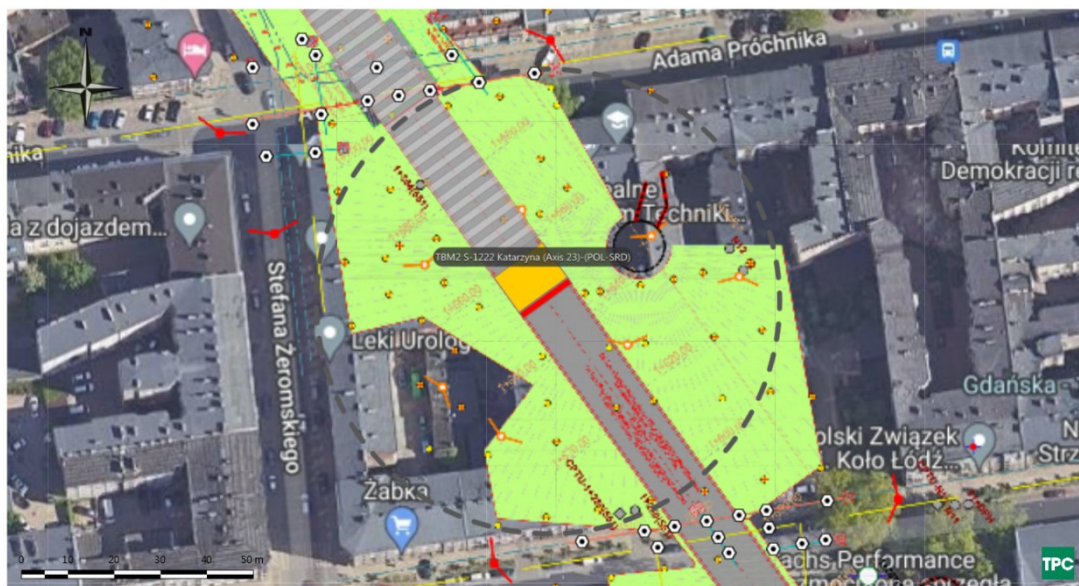


Figure 1-2 Plan view of TBM Position on 04/09/2024

2. FACE PRESSURES AND EXCAVATION VOLUMES

Average EPB pressure at the crown is at about 1.7 bar. The value is within the attention values. Figure 2-1 shows EPB sensors.

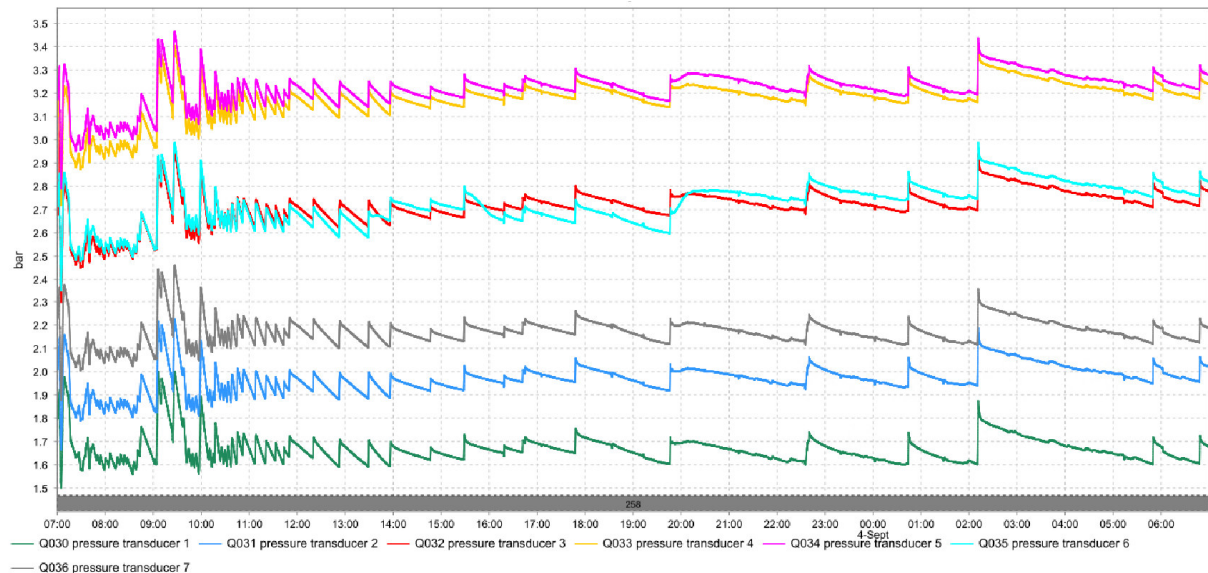


Figure 2-1 EPB pressure sensor

The delta between pressure transducer 1 and 2 has an average value of 0.3 bar indicating that the bulk chamber is correctly filled with material.

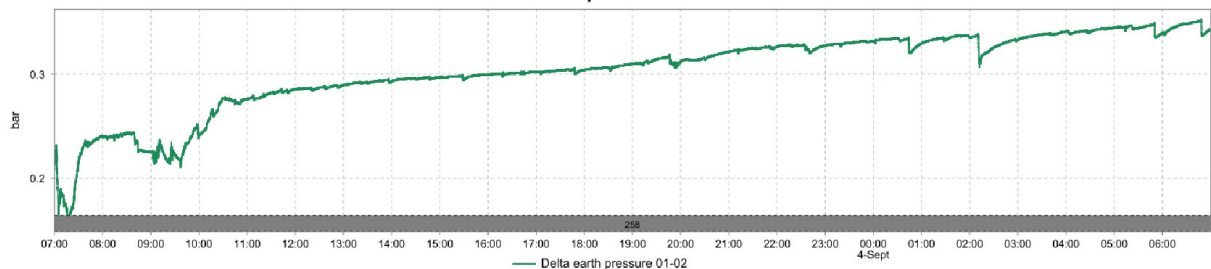


Figure 2-2 Delta between pressure sensors 1 and 2

Belt scale n. 1 and belt scale n. 2 show similar values. The belt scale value is a raw indication of the excavated material quantity.

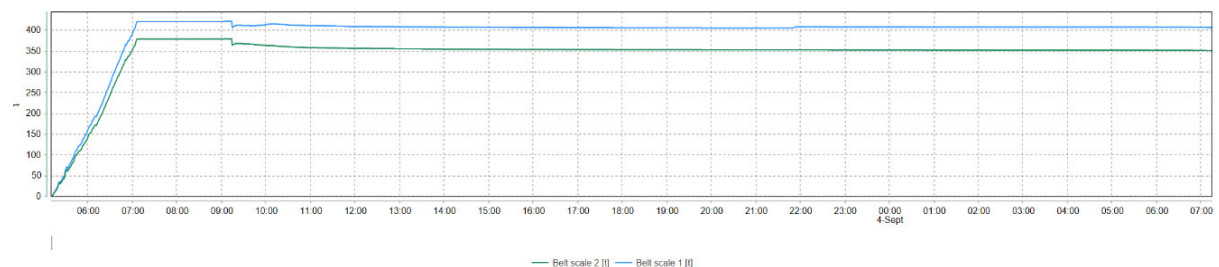


Figure 2-3 Belt scales

3. THRUST AND CUTTERHEAD TORQUE

During excavation, the average torque is of 5.9 MNm.

During advancement, average advance rate is of 8 mm/min.

During excavation, thrust force shows an average value of 71 MN and a maximum of 76.8 MN.

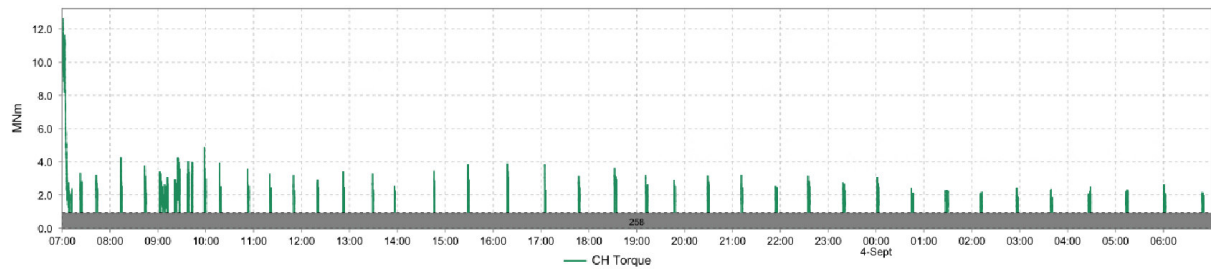


Figure 3-1 CH Torque

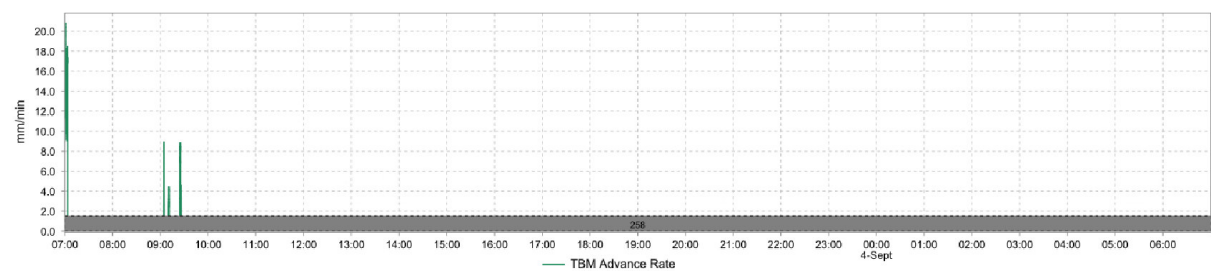


Figure 3-2 Advance rate

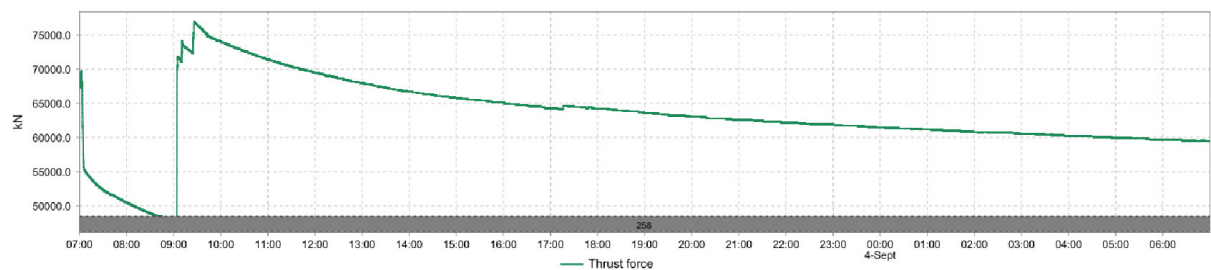


Figure 3-3 Thrust force

4. GROUT INJECTION

Grout injection has a volume above the minimum theoretical annular volume $\pm 10\%$ of 13.54 m^3 . Ration B/A is at 5%.

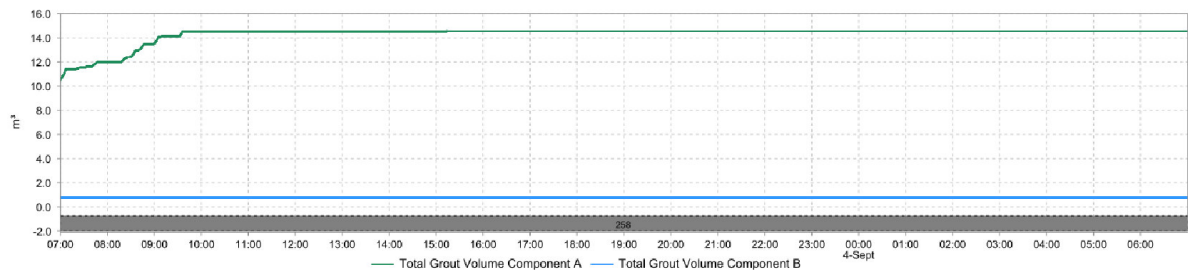


Figure 4-1 Grout volumes

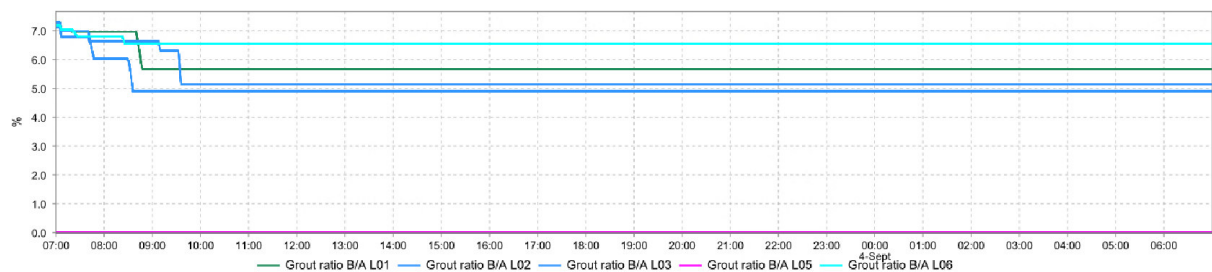


Figure 4-2 Volume ratio Components B/A

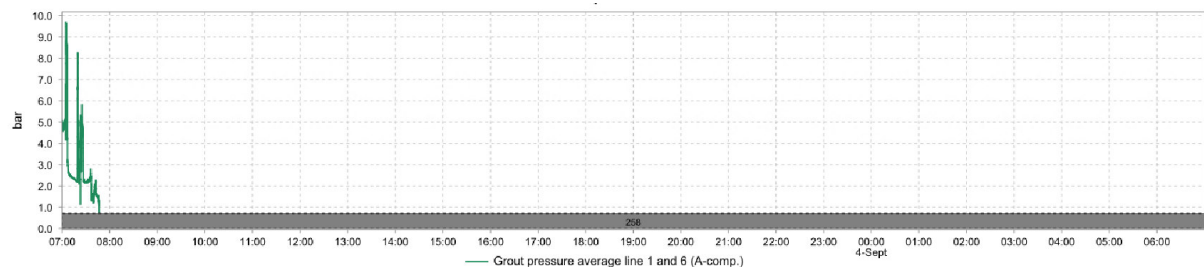


Figure 4-3 Average injection pressure line 1 and 6

5. GUIDANCE

The TBM vertical deviation is of about 0.27 mm on the front edge of the shield and the horizontal deviation of about -5.56 mm (Figure 5-1). Maximum radial deviation is of 5.57 mm.

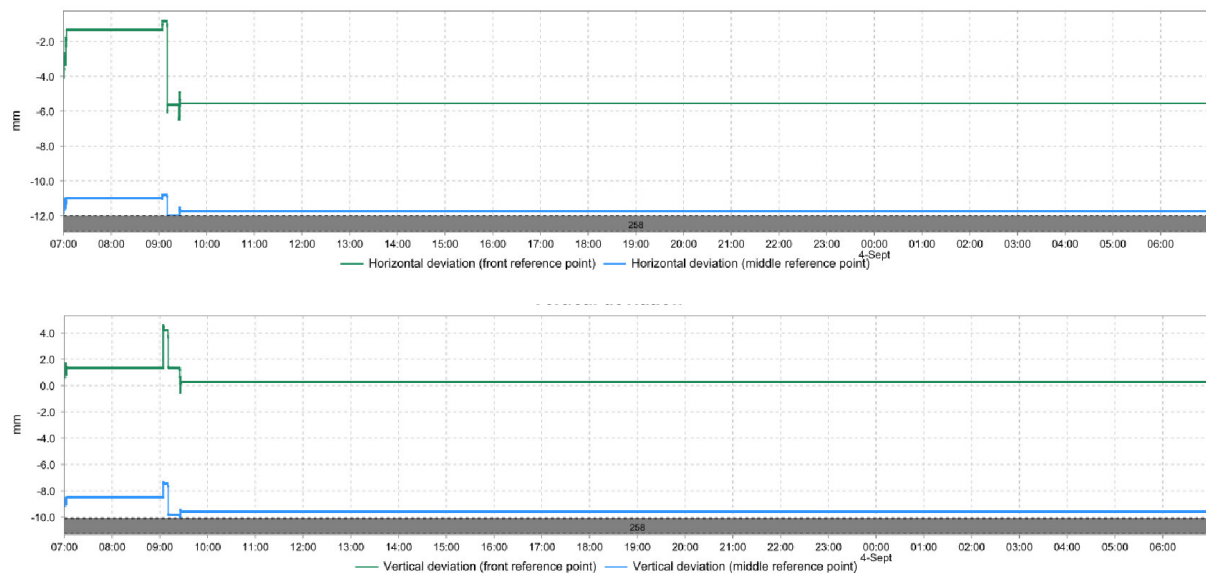


Figure 5-1 Machine deviation from the alignment

6. MONITORING

According to Geoscope, settlements of the buildings above the tunnel are kept within the limits.



Figure 6-1 Monitoring points

The monitoring points on Prochnika street are stable.

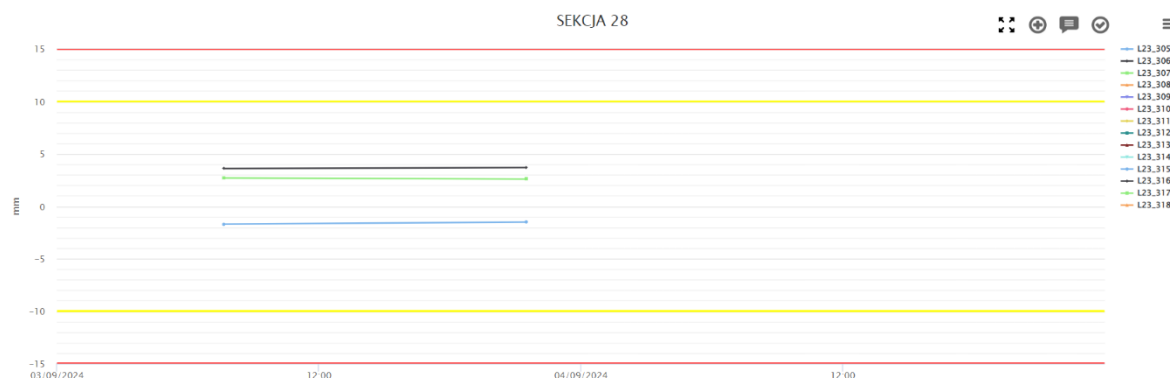


Figure 6-2 Settlement of Section on Prochnika street

On PR0440, monitoring points show a downward trend for points along tunnel axis: PR0440-05R with a maximum settlement of about 4 mm and PR0440-04R of about 1 mm.

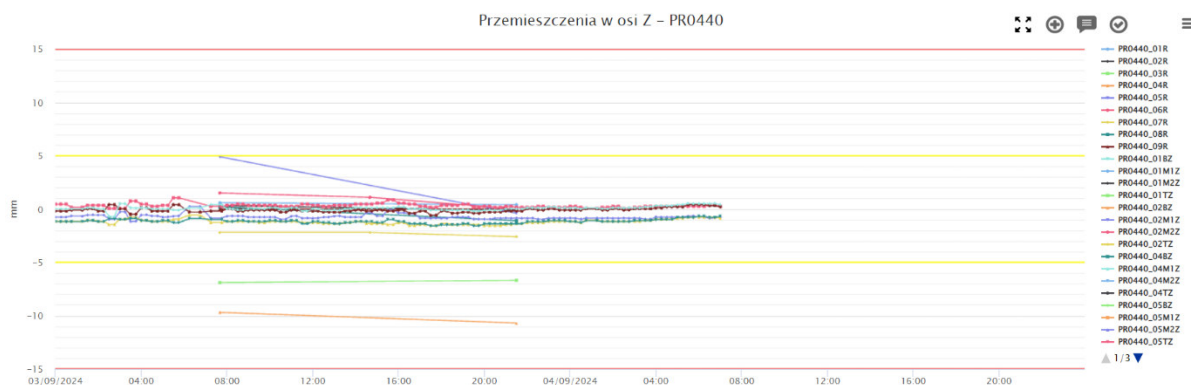


Figure 6-3 Settlement of building PR0440

On PR0460, monitoring points show a small uplift trend for point PR046_A_13.

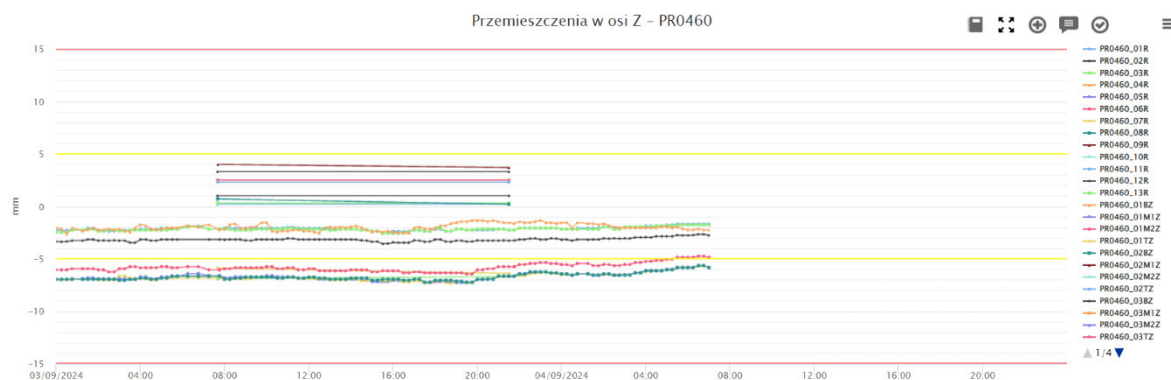


Figure 6-4 Settlement of building PR0460

On MA0210, monitoring points are stable.

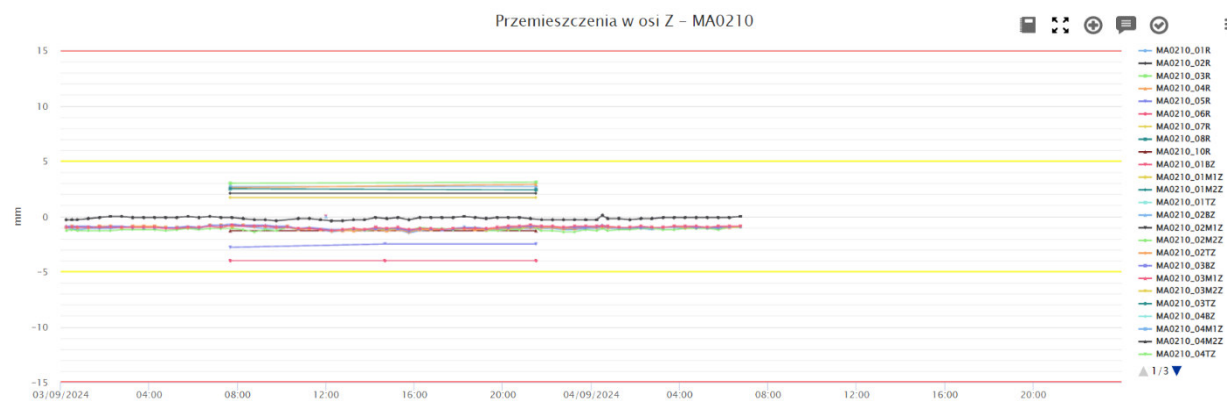


Figure 6-5 Settlement of building MA0210

On MA0230, monitoring points show a small downward trend for point MA0230_04R.

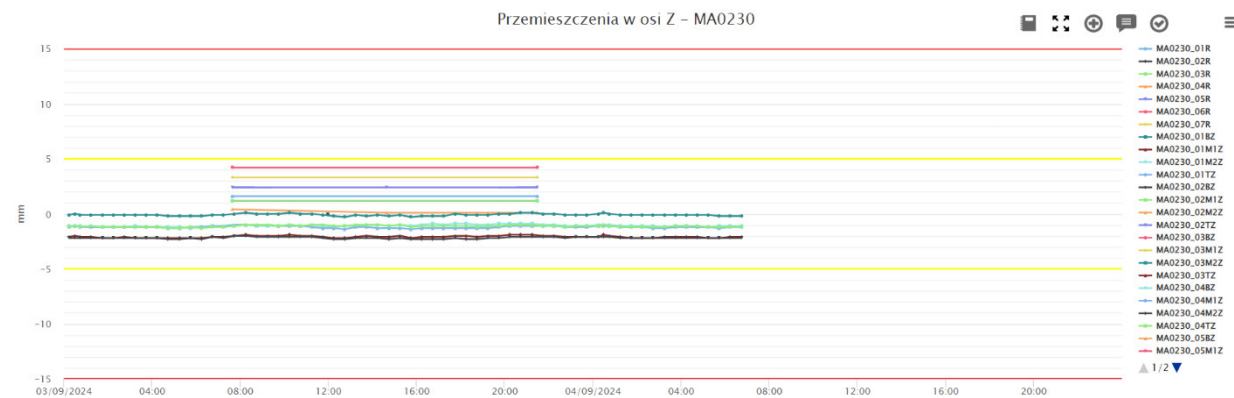


Figure 6-6 Settlement of building MA0230

7. COMPENSATION GROUTING ACTIVITIES

According to Raport Dobowy 03/09/2024 of Soletanche, compensation grouting has been performed on the 03/09/2024 from Shaft 3 in Próchnika 42.

The total amount of declared injected volume is 27461.11 l.

8. SOIL CONDITIONING

The volume of injected foam is plotted in the following Figure. The FIR value is computed based on the excavated material amount per ring and reported in the Table.

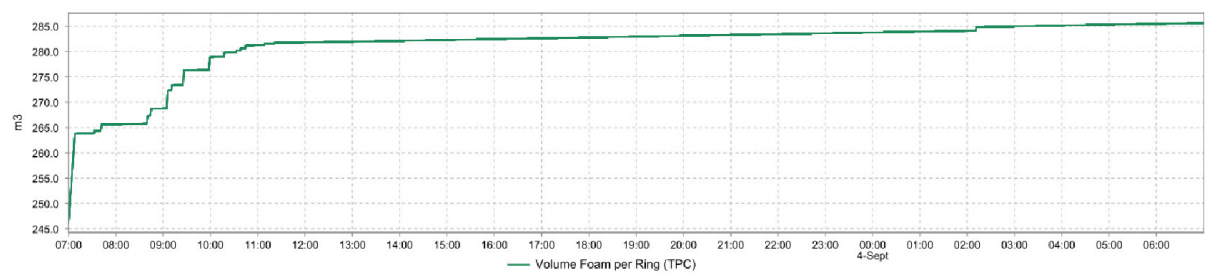


Figure 8-1 Injected foam volume

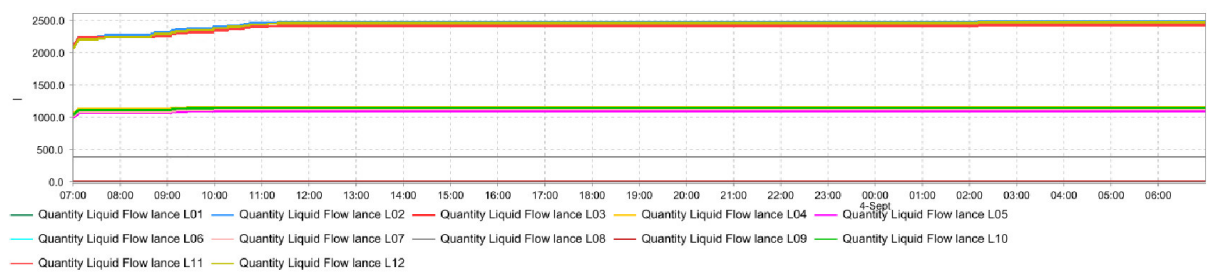


Figure 8-2 Conditioning liquid volume