

TECHNICAL MEMORANDUM

**PERRY: Design and Open-Water Verification
of a LoRa-Activated Vertical Profiling Float***Pressure Equipped Robot for Research and Yield*

J. O. Jackson

Crush Depth float team, MATE ROV international competition

ABSTRACT. PERRY is a vertical profiling float: on a LoRa activation signal it runs three profiles to a set depth, logging temperature, pressure, and depth, and transmits the record on resurfacing. The hull is acetone-vapor-smoothed ABS closed by static o-rings; field testing showed marine grease admitting water at the seals, and the switch to silicone grease fixed it. A 50 mL buoyancy engine moves the craft, which has a mass of roughly 4.5 kg. In open water it profiled to 4 m, resurfaced, and returned its data. The author owned the programming, the electronics, and the buoyancy design on a team build.

1 Pressure Sealing

The hull is a sealed pressure vessel, and the sealing strategy is the core mechanical problem of the craft. Static o-ring seals close the hull. The seal design covered o-ring groove sizing, seal-stack layout, and selection of a grease for assembly.

The grease selection was decided by test. The first field tests were run with marine grease, and the hull took on water at the seals. Switching to silicone grease stopped the ingress, and the open-water mission was run on silicone.

The hull is FDM-printed in ABS on a Bambu Lab printer, which leaves a layered, porous surface unsuited to sealing. The printed hull was acetone-vapor smoothed in a chamber, using the solvent pass as a conformal surface treatment to close layer lines. The print was set up for the treatment: extra perimeter walls were added so the smoothing pass could not open the surface into the infill.



Figure 1. Left: PERRY as assembled for the open-water mission. Right: on the deck at the test site, other teams' floats behind.

2 Buoyancy Engine

Depth is driven by a buoyancy engine rather than thrusters. A NEMA17 stepper motor, running through a TMC2209 driver under UART control, changes the craft's displacement by 50 mL to move it between the surface and the target depth. The craft has a mass of roughly 4.5 kg (10 lb). The 50 mL allowance was set by estimate against that mass and confirmed by trial rather than by a formal buoyancy calculation; that is recorded as a limitation in Section 5.

3 Electronics and Firmware

An ESP32 runs the mission logic: arming over LoRa, profile sequencing, sensor logging, and data return. Depth and pressure are read from a Blue Robotics Bar02 pressure sensor on the I²C bus. The LoRa link is a REYAX RYLR896 module on a 115200-baud UART. The stepper driver is commanded over a second UART. All electronics were assembled and soldered on protoboard.

Table 1. System summary.

Subsystem	Component	Interface / process
Controller	ESP32	mission logic, logging, radio
Pressure and depth	Blue Robotics Bar02	I ² C
Depth drive	NEMA17 stepper, TMC2209 driver	UART; 50 mL displacement change
Radio	REYAX RYLR896 LoRa	UART, 115200 baud
Hull	FDM ABS, Bambu Lab printer	chamber vapor smoothed; static o-rings; silicone grease
Mass	roughly 4.5 kg	not formally weighed
Assembly	protoboard, hand soldered	—

4 Open-Water Verification

The craft completed its mission profile in open water: it profiled to 4 m, resurfaced, and delivered its logged data over the radio link. Figure 2 shows the commanded mission profile. The logged dataset itself was not retained (Section 5), so no measured profile is reproduced here.

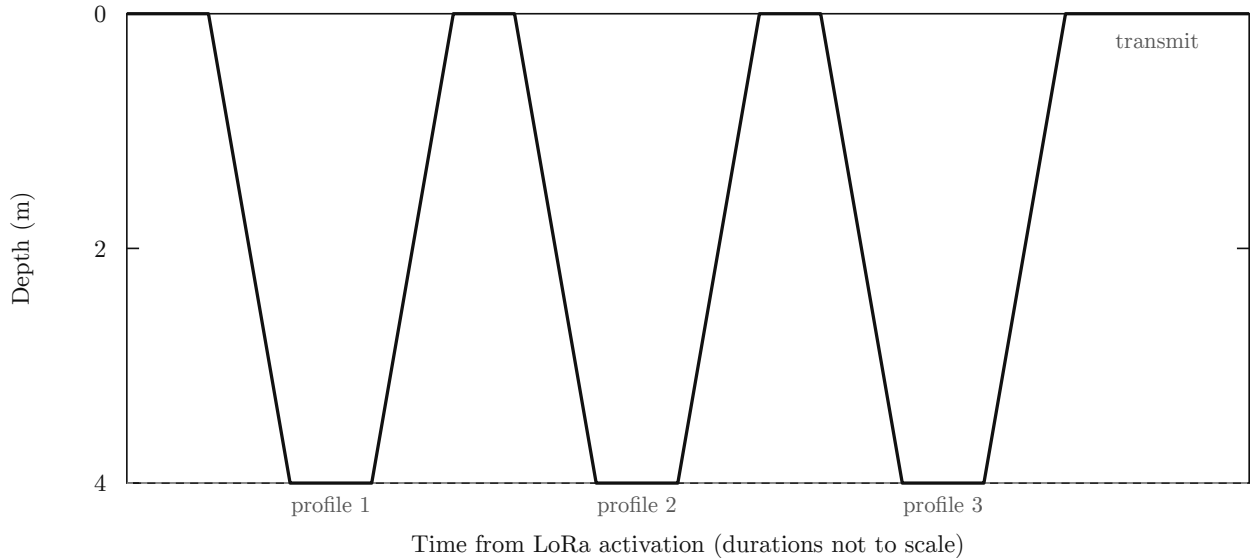


Figure 2. Commanded mission profile: three descents to the 4 m target and return, then data transmission at the surface. This is the commanded sequence, not a plot of logged data; durations are schematic.

5 Known Limitations

- Seal integrity is verified to 4 m only. Maximum safe operating depth has not been characterized.
- The buoyancy engine's 50 mL allowance and the craft mass were set and checked by trial, not by a formal buoyancy budget. Displacement was not measured.
- The o-ring groove dimensions and the original design files were not retained.
- The logged dataset from the mission was not retained; the record of the profile is the mission outcome, not the data.
- Effective LoRa range was not measured; the link is verified only at mission distances.
- Sensor sample rate was not formally recorded.
- Single Bar02 sensor with no redundancy; a sensor fault ends the mission.

6 Role and Attribution

Team project, Crush Depth float team. The author owned the programming, the electronics, and the physics and buoyancy side of the craft, and previously served as Float Team Technical Lead, taking the subteam through LoRa communications, ESP32 development, stepper motors and drivers, and board assembly.