

Interim Progress & Drawdown Report — No. 5

Halyard Quarter · 8-storey mixed-use · prepared for the Lender · site inspection 14 Aug 2026 (Month 13 of 22)

ILLUSTRATIVE SAMPLE — project identity, budget, programme and cost plan are representative; prepared to demonstrate the AssetProof monitoring & drawdown report a lender or investor would receive.



Approved design — scheme at practical completion (reference for all progress assessment).

Scheme	96 apartments over ground-floor retail
Gross floor area	~9,800 m ² (illustrative)
Construction facility	US\$42.0m
Programme	22 months · inspection at Month 13
Drawn to date (thru #4)	US\$22.0m (52%)
This request (No. 5)	US\$4.5m

Recommendation


Release a reduced US\$3.1m; hold US\$1.4m. Independently verified work-in-place (exterior) is **US\$20.8m (50%)** against US\$22.0m already drawn — so draws are marginally **ahead** of what can be independently verified. Release is supported only to the level backed by (a) verified exterior progress and (b) internal works evidenced by the contractor. **Hold US\$1.4m** pending façade catch-up (claimed 55%, verified 38%) and an **internal capture** to substantiate MEP and fit-out claims that drone imagery cannot see. No structural or compliance concerns; the frame is topped out and sound.

What this drone inspection can — and cannot — verify

Verified (exterior, high confidence): site, substructure, superstructure frame, roof, envelope/façade, podium shell, external works — each read directly from dated aerial imagery against the approved design. **Not verifiable from the air (flagged, not counted as verified):** MEP first fix and internal fit-out — these sit behind the façade and require an internal capture or contractor evidence. AssetProof reports the contractor's internal figures but does **not** certify them from drone imagery. This is the discipline: we certify only what we can see.

66%

planned / programme



50%

independently verified (exterior)



+10%

reported internal (unverified)

MEP & fit-out per contractor; pending internal capture.

Progress by element — verified against the approved design & programme

Element	Cost	Plan	Verified	Progress	Method	Status
Enabling / demolition / site	4%	100%	100%		Drone	Complete
Substructure / foundations	12%	100%	100%		Drone	Complete
Superstructure frame	22%	100%	100%		Drone	Topped out
Roofing & waterproofing	4%	90%	90%		Drone	On track
Envelope / façade & glazing	16%	55%	38%		Drone	Behind
Retail podium (shell)	3%	70%	60%		Drone	On track
External works / landscaping	3%	10%	5%		Drone	Early
MEP services	20%	50%	45%*		Internal*	Unverified
Internal fit-out & finishes	16%	20%	10%*		Internal*	Unverified

* Internal works sit behind the façade and are not verifiable from aerial imagery; figures are the contractor's, reported pending an internal capture. Verified % for exterior elements is AssetProof's independent read of dated site imagery against the approved design.

Site evidence — inspection of 14 Aug 2026



Aerial capture, 14 Aug 2026: frame topped out; façade and glazing installed to the lower floors only; upper floors remain open structure.



Deviation: upper ~4 floors — curtain wall & glazing not installed; open frame. Drives the façade shortfall (verified 38% vs 55% claimed).



Verified: lower floors — cladding & glazing installed and weathertight; consistent with the approved design.

Deviations & exceptions


Envelope / façade & glazing	Claimed 55%, verified 38%.	EXCEPTION
Curtain wall installed to lower floors only; upper ~4 storeys open. ~3 weeks behind the weathertightness milestone; delays internal trades that follow.		
MEP & internal fit-out	Reported 45% / 10% — not verifiable from the air.	EXCEPTION
Recommend an internal capture (walk-through or 360 imagery) before further reliance on these figures for drawdown.		
Draw vs verified position	Drawn US\$22.0m vs verified US\$20.8m.	EXCEPTION
Draws marginally ahead of independently-verifiable progress — tighten the next release to verified work.		

Drawdown request vs verified work-in-place

Item	Amount	of facility	Action
Independently verified WIP (exterior, drone)	US\$20.8m	50%	—
Internal works reported (MEP + fit-out) — unverified	US\$4.5m	+10%	Unverified
Verified + reported ceiling	US\$25.3m	60%	—
Drawn to date (through No. 4)	US\$22.0m	52%	—
Requested now (No. 5)	US\$4.5m	—	Requested
Recommended release now	US\$3.1m	—	Release
Recommended hold	US\$1.4m	—	Hold

Monitored build timeline — every inspection on record

The same site, flight by flight, from enabling works to the inspection point (highlighted). Each frame is a dated, sealed capture; the trend is what catches slippage early.

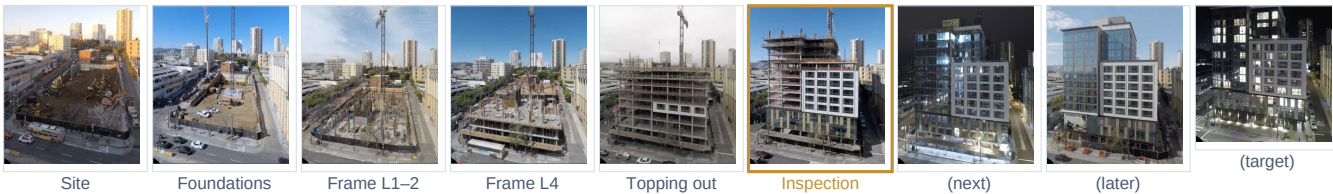

Chain of custody & certification

Each capture is sealed to the project and date, server-timestamped and fingerprinted, and read independently before issue. **AssetProof provides the independent evidence and the completion analysis — an opinion and a defensible point of departure — and certifies only what the imagery shows.** The drawdown figure is **certified by [Licensed Quantity Surveyor / Engineer], Reg. No. _____**, who signs the release. Internal works are excluded from the verified figure until an internal capture is provided.

Illustrative sample prepared by AssetProof to demonstrate the Development Monitoring & Drawdown output; project identity, budget, programme and cost plan are representative. Not a certification and not financial advice. assetproofsolutions.com